

1.	No. 143	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 					
2.	City/County: City of St. Louis, MO						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes	8. On National Register or part of estab. district? No					
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address:	Street address: 6212 Bowman \bigwedge VL 15. Style: Queen Anne					
16.	Date(s): c. 18	Date(s): c. 1895 - 1900					
17.	Architect: unk	Architect: unknown 18. Builder: unknown					
19.	Original Use: r	esidence 20. Present Use:	residence				
21.	No. of stories:	2 1/2 22. Basement? yes 23. W	Wall construction: masonry				
24.	Foundation mate	rial: stone 25. Roof type	e/material: gabled/slate				
26.	No. Bays: Fron	t 2 Side 3 27. Wall trea	atment: red brick				
28.	Plan shape: see	site map 29. Changes: Addi	tion? rear Altered?				
30.	Exterior condit	public? no					
32.	Other Surveys i	n which included: Heritage/St. Lo	ouis survey, 1971				
	d slate bell roo	f with cresting & a finial; the s	rner tower features a four- ides of the tower are mentally arched front (and				

Straight-sided bay window at first story front; angled bay window on south side.

1-story rear frame addition.

one 2nd story side) windows have stone voussoirs at the ends; stone sills.

Frame porch has turned wood columns & balustrade.

^{34.} History and Significance: No pre-1926 building permits are available for this city block. Heritage/St. Louis files indicate that they were told that William B. Buechner was the original owner in 1899, but that they failed to find other documentation or any information regarding architect, builder, etc.



- No. 142 3. Location of Negatives: Missouri Office of Historic 1. Preservation, P. O. Box 176, Jefferson City, MO 65102 2. City/County: Prepared by: Cynthia Hill Longwisch, Landmarks Assn. City of St. 4. Louis, MO of St. Louis, 917 Locust, 7th Floor, St. Louis, MO St. Louis Public Records, 5. Date: 8/15/91 6. Sources of information: City Hall; MO Historical Soc.; Heritage/St. Louis files Building? yes 8. On National Register or part of estab. district? No 9. Ownership: Private 10. Visible from public road? Yes 11. Endangered? No 12. Original name: 13. Present name/owner's name: Street address: 14. 6218 Bowman 15. Style: Bungalow 16. Date(s): c. 1925 17. Architect: 18. Builder: unknown unknown Original Use: residence 19. 20. Present Use: residence 21. No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry Foundation material: 25. 24. stuccoed Roof type/material: side gable 26. No. Bays: 27. Wall treatment: stuccoed Front 3 Side 3 28. Plan shape: see site map 29. Changes: Addition? Altered? 30. Open to public? Exterior condition: good 31: 32. Other Surveys in which included: Heritage/St. Louis survey, 1971 Further description of important features: This house features undulating
- patterned roof shingles. The narrow shed-roof dormer is recessed in the roof so its windows are actually longer than they appear. The roof extends to become the roof of the full-width, enclosed porch. No permits appear post-1926 for an alteration of the porch, so it is perhaps original, although the double doors appear to be replacements. Side gable is "half-timbered."
- 34. History and Significance: All inactive (earlier than 1926) building permits are unavailable for this city block. James P. Odell, a clerk for the Pershing Hotel, is listed as living here in 1930, but not 1925.



- 3. Location of Negatives: Missouri Office of Historic 1. No. 184 Preservation, P. O. Box 176, Jefferson City, MO 65102 2. City/County: City of St. 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 Louis. MO 6. Sources of information: St. Louis Public Records, Date: 8/15/91 City Hall: MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No 9. Ownership: Private 10. Visible from public road? Yes 11. Endangered? No 12. Original name: "Ladies Home Journal House" 13. Present name/owner's name: 15. Style: Prairie School 14. Street address: 6215 Bowman 16. Date(s): 2/8/1910 - building permit (Heritage/St. Louis) Architect: Ladies Home Journal 18. Builder: R. Dawson & Son 17. Original Use: residence 20. Present Use: residence 19. No. of stories: 2 22. Basement? yes 23. Wall construction: frame 21. 24. Foundation material: concrete 25. Roof type/material: pyramid hip and the second section of the second and the second 26. No. Bays: Front 6 Side 6 27. Wall treatment: wood clapboarding 28. Plan shape: see site map 29. Changes: Addition? side Altered? 30. Exterior condition: fair Open to public? no 31: 32. Other Surveys in which included: Heritage/St. Louis survey, 1971 33. Further description of important features: The roof has wide overhanging eaves. Windows are multipane casements. Narrow wood banding at sills. Front 1-story room also hipped. Bracketed entrance overhang. Garage and room at side are done in similar style but were a later addition, according to a neighbor who
- 34. History and Significance: This house is known as the "Ladies Home Journal House" because the plans were supposed to have come from an issue of the magazine. Heritage/St. Louis found a permit taken out by Mary E. Wright in 1910 for a \$3,500 frame house, R. Dawson & Son, arch. They initially dismissed it because Geo. W. Clinton was known to be the first owner; however, Mary E. Wright was his mother-in-law and lived with him before & after this house was built, and she owned this lot. Although the plat # is wrong, permit is surely for this house.

lived here c. 1907-20. South side clapboarding and chimney in fairly poor

shape.



1.	No. 141	•	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St.		by: Cynthia Hill Longwisch, Landmarks Assn.					
	Louis MO	of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building: yes	8. On National Register or part of estab. district? No						
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:	Original name:						
13.	Present name/owner's name:							
14.	Street address:	6224 Bowman	15. Style: Col. Rev./Craftsman					
16.	Date(s): c. 19	Pate(s): c. 1925						
17.	Architect: unk	nown	18. Builder: H. C. Vollmar?					
19.	Original sae: r	esidence 20.	Present Use: residence					
21.	No. of stories:	2 22. Base	ement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: concrete	25. Roof type/material: mock gambrel*					
26.	No. Bays: Fron	t 4 Side 2	27. Wall treatment: aluminum siding					
28.	Plan shape: see	site map 29.	Changes: Addition? Altered?					
30.	Exterior condit	ion: good	31: Open to public? no					
32.	Other Surveys i	n which included:	Heritage/St. Louis survey, 1971					
gabi impr 6-ov kets	ed 2-story, but ression of a full ver-1. A gabled s. A one-story f	the inset eaves for width dormer mound hood shelters the lateroofed room a	features: *This house is really a side- form the roofline of a gambrel, giving the inted on a gambrel roof. Paired windows are doorway, supported by curved wood brac- it the west side has multipane (french One feature of this (cont'd. below)					

34. History and Significance: house different from others of its type is the drive-in basement/garage at the left, possible because of the steep grade. This house is very similar to survey #36, #37 and #65, all houses built by H. C. Vollmar c. 1927. Building permits prior to c. 1926 are not available for this city block and this house is not listed in those 1926 and newer. Music teacher Carl Rossow lived in this house in 1930 but not in 1925, leading to a circa date of 1925.



1.	No. 162	3. Location of Negatives: Missouri Office of Historic						
2.	City/County: City of St. Louis, MO	Preservation, P. O. Box 176, Jefferson City, MO 65102 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,						
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:							
13.	Present name/ow	Present name/owner's name:						
14.	Street address:	Street address: 6225 Bowman 15. Style: Queen Anne						
16.	Date(s): c. 18	(s): c. 1890						
17.	Architect: unk	nown 18. Builder: unknown						
19.	Original Use: r	esidence 20. Present Use: residence						
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame						
24.	Foundation mate	rial: stone 25. Roof type/material: gabled						
26.	No. Bays: Fron	t 5 Side 3 27. Wall treatment: vinyl siding						
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes						
30.	Exterior condition: good 31: Open to public? no							
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971						
wind wrap	house is cut ou lows. Across the s around and is	tion of important features: The projecting front gable of t at the corners of both stories for the placement of angled front of the resulting bay window, a flat-roofed porch topped with an iron railing. Square wood posts support it. the porch is probably the same as the original, but the						

^{34.} History and Significance: has been given to the side gable. Windows are 1-over-1. Diamond-shaped windows in the gables.
Building permit unavailable. Heritage/St. Louis files say John W. Taylor lived here from 1892-95. He was an inspector and member of the Episcopalian church. By 1898, he had moved to 2518 Clifton (now razed and replaced).

(cont'd. below)

execution is doubtless more spare. The same cut-out treatment



	of St 6. S City 8. O 10. V	Source Hall; On Nat Visibl	es of MO H	informa listoric	ation: Stal Soc.; I	Louis Feritage/ t of esta	Landmarks Assn. Louis, MO 6310 Public Records, St. Louis files ab. district? No Endangered? No						
lding? yes ership: vate ginal name: sent name/own eet address: e(s): c. 189	8. 0 10. V ner's na 2187 C	Hall; On Nat Visible Time:	ional	Regist	eal Soc.; Here or part	Heritage/	St. Louis files ab. district? No Endangered? No						
ership: vate ginal name: sent name/own eet address: e(s): c. 189	8. 0 10. V ner's na 2187 C	On Nat	ional	Regist	er or part	t of esta	ab. district? No Endangered? No						
yate ginal name: sent name/own eet address: e(s): c. 189	10. V ner's na 2187 C	visibl	e fro	 	c road?	Yes 11.	Endangered? No						
sent name/own eet address: e(s): c. 189	2187 C	lifto	on		15. Styl	le: Quee	en Anne						
eet address: e(s): c. 189	2187 C	lifto	on		15. Styl	le: Quee	en Anne						
e(s): c. 189	95 - 190		on		15. Sty	le: Quee	en Anne						
		0		<u></u>									
hitect: unkı							: c. 1895 - 1900						
	nown	known 18. Builder: unknown											
ginal Use: re	esidence	:	20.	Presen	it Use: re	sidence							
of stories:	2	22.	Basem	ent? ye	es 23. Wa	all const	cruction: frame						
ndation mate	rial: s	tone		25.	Roof type,	/material	: gabled ell						
Bays: Fron	t 3 S	ide	<u> </u>	27.	Wall treat	ment: na	irrow siding						
n shape: see	site ma	ıp	29.	Change	s: Additi	ion?	Altered?						
Exterior condition: good 31: Open to public? no													
er Surveys in	n which	inclu	ded:	Herita	ge/St. Lou	is surve	ey, 1971						
	Bays: Fron shape: see erior conditer Surveys in the characteristics.	dation material: s Bays: Front 3 S shape: see site material: s erior condition: gooder Surveys in which ther description of	dation material: stone Bays: Front 3 Side shape: see site map erior condition: good er Surveys in which includes the description of importance and the stone of the stone	Bays: Front 3 Side shape: see site map 29. erior condition: good er Surveys in which included: ther description of important	dation material: stone 25. Bays: Front 3 Side 27. shape: see site map 29. Change 27. crior condition: good 31: cr Surveys in which included: Heritation of important feature	Bays: Front 3 Side 27. Wall treat shape: see site map 29. Changes: Additionary and the shape in which included: Heritage/St. Low ther description of important features: The first state of the state of	Days: Front 3 Side 27. Wall treatment: nation shape: see site map 29. Changes: Addition?						

gonal tower with a finial rises above a small porch. Siding may be vinyl.

House is located at the end of a long private drive.

^{34.} History and Significance: No inactive building permits are accessible for this city block, so definite dating is difficult. Daniel Tevis, listed as being in the insurance business at 721 Olive, lived in this house as early as 1901.



	No. 002	3. Location of Negatives: Missouri Office of Histor Preservation, P. O. Box 176, Jefferson City, MO					
1.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks A of St. Louis, 917 Locust, 7th Floor, St. Louis, MO					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership:	8. On National Register or part of estab. district?					
	Private	10. Visible from public road? Yes 11. Endangered					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address:	treet address: 2190 Clifton 15. Style: Hall & Parlor					
16.	Date(s): 4/23/	1932 - building permit					
17.	Architect:	18. Builder: H. C. Vollmar					
19.	Original Use:	residence 20. Present Use: residence					
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: mas	sonry				
24.	Foundation mate	rial: stuccoed 25. Roof type/material: side gab	le				
26.	No. Bays: From	t 3 Side 3 27. Wall treatment: painted brick					
28.	Plan shape: see site map 29. Changes: Addition? rear Altered?						
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
33.	Further descrip	tion of important features: Window have flat arches, 6	5-				

Like many houses in the area, the foundation material is obscured by a stucco-

cornice. Unpainted brick stoop of more recent vintage. One side chimney.

Modest brick

over-1 panes, brick sills. Three dormers on front elevation.

a cost of \$3,000 and specifies hot air heat.

like wash.

^{34.} History and Significance: H. C. Vollmar was a contractor who worked extensively in the Clifton Heights vicinity during the 1920s and 1930s, often taking out several permits at a time. The permit for this house shows



1.	No. 003	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 2194 Clifton 15. Style: Composite						
16.	Date(s): c. 1910						
17.	Architect: unknown 18. Builder: unknown						
19.	Original Use:	residence 20. Present Use: residence					
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate:	rial: concrete 25. Roof type/material: gabled/asphalt					
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: vinyl siding					
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971						
33.	Further description of important features: A three-sided bay window ends from the gabled front end. Windows are replacements. Dormers on						

front and side elevations. Wooden deck on front probably replaces an

original porch.

^{34.} History and Significance: No inactive building permits are available for this city block and active permits begin c. 1932.



1.	No. 004 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102								
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101							
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files							
7.	Building? yes						No		
9.	Ownership: Private 10. Visible fr						11.	Endangered?	
12.	Original name:								
13.	Present name/owner's name:								
14.	Street address: 2198 Clifton 15. Style: Queen Anne								
16.	Date(s): c. 19	00	_						
17.	. Architect: unknown 18. Builder: unknown								
19.	Original Use:	residence	20	. Prese	ent Us	se: resi	dence		
21.	No. of stories:	2 1/2 22. 1	Base	ment? ye	es 2	23. Wall	constru	uction: fram	e
24.	Foundation mate	rial: stone		25.	Roof	type/mat	erial:	gabled/asp	halt
26.	No. Bays: Fron	t 2 Side 3		27.	Wall	treatmen	t: clap	pboarding	
28.	Plan shape: see site map 29. Changes: Addition? Altered?								
30.	Exterior condit	ion: good		31:	Oper	to publ	ic? no	0	,t,
32.	Other Surveys in	n which include	led:	Herita	age/St	t. Louis	survey	, 1971	
33.	Further descrip	tion of import	tant	feature	es: 1	A sunburs	t meda	llion highli	ghts

the front gable of this house, which also features carved gingerbread brackets in the small front porch. Windows have been replaced. Porch appears to have seen repoured more or less recently.

^{4.} History and Significance: No building permits were available for this buse.



1. No. 139

3. Location of Negatives: Missouri Office of Historic

<u> </u>	NO. 139	Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	4. Prepa						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes							
9.	Ownership:	8. On Na	8. On National Register or part of estab. district? No					
	Private	10. Visib	10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:							
13.	Present name/ow	ner's name:						
14.	Street address:	2490 Clift	on	-	15. Styl	e: Ameri	ican Foursqu	are
16.	Date(s): c. 19	00						
17.	Architect: unk	chitect: unknown 18. Builder: unknown						
19.	Original Use: r	esidence	20.	Presen	t Use: re	sidence		
21.	No. of stories:	2 22.	Basem	ent? ye	s 23. Wa	ll consti	ruction: fra	ne ne
24.	Foundation mate	rial: stucc	oed	25.	Roof type/	material:	: hipped	
26.	No. Bays: Fron	t 3 Side	3	27.	Wall treat	ment: vir	nyl siding	
28.	Plan shape: see	site map	29.	Change	s: Additi	on?	Altered?	yes
30.	Exterior condit	ion: good		31:	Open to p	ublic? r	no	
32.	Other Surveys i	n which incl	uded:	Herita	ge/St. Lou	is survey		
A fr at l atio	Further descripthis house are a cont-facing dorme eft side project n. Wide porch hed space; the or	variation of r has been f s very sligh as been infi	the 3 itted tly an lled w	-over-1 with a d has n vith win	seen thro vent rathe arrow hood dows and d	ughout Cl r than a , apparer oors to p	lifton Heigh window. Win ntly an alter	ts. ndow r- n-

^{34.} History and Significance: pillars are still clearly in place. No building permits this early are available for this city block. William F. Sherman, salesman for Hamilton Brown Shoe Co., is listed in directories as living in this house in 1901.



1.	No. 138	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 					
2.	City/County: City of St. Louis, MO						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/own	Present name/owner's name:					
14.	Street address:	address: 2500 Clifton 15. Style: Shingle					
16.	Date(s): 1901	(Heritage/St. Louis)					
17.	Architect: bui	lders 18. Builder: Detjen & Charleville					
19.	Original Use: re	esidence 20. Present Use: residence					
21.	No. of stories:	2 1/2 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate:	rial: stone 25. Roof type/material: gabled					
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: asbes.& alum. sidg.					
28.	Plan shape: see	site map 29. Changes: Addition? Altered?					
30.	Exterior condit	ion: fair/good 31: Open to public? no					
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971						

first story is topped by a second, smaller open porch with bracketed cornice above. Both have turned wood columns. House has a rambling, asymmetrical shape with many angles. Door has side and fanlights. Right side of facade has cutout corners to form bay window. Half asbestos, half aluminum siding.

34. History and Significance: No inactive building permits were microfilmed

for this city block. Heritage/St. Louis has a notation that this house has a building permit dated 8/10/1901 for \$1,800. Henry Detjen and B. Charleville, St. Louis builders, were the names on the permit.



1.	No. 136	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name: Fry Memorial Methodist Episcopal Church						
13.	Present name/owner's name: Dr. Fry Memorial Methodist Episcopal Church						
14.	Street address: 2501 Clifton/2 photos 15. Style: Gothic Revival						
16.	Date(s): 8/17/1905 - building permit; 9/30/1905 - cornerstone laid						
17.	Architect: Wil	liam Anelett Cann 18. Builder:					
19.	Original Use: c	hurch 20. Present Use: church					
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: stone 25. Roof type/material: complex					
26.	No. Bays: Fron	t 9 Side n/a 27. Wall treatment: red brick					
28.	Plan shape: see	site map 29. Changes: Addition? Altered?					
30.	Exterior condit	ion: good 31: Open to public? yes					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
the entr	er also houses th tower. Stone-ca cance highlighted	tion of important features: A square, flat-roofed bell e entrance; a wood tracery railing with corner finials tops pped buttresses flank the limestone compound gothic arched by stone tracery. Large gothic stained glass windows are h and south sides of the west wing. The polygonal apse					

^{34.} History and Significance: gothic-arched stained glass windows above and paired flat-arched stained glass windows below, all with stone sills. The grade slopes away from the church on the north, exposing the basement level. The original church was erected in 1892 and burned in 1905. It was named for Dr. Benjamin St. James Fry, the primary early promoter of Clifton Hts. and a Methodist minister. Fry lived at 2933 Lucas, but was responsible for bringing many

extends to the east/northeast, with paired double-rowlock (cont'd. below)





1.	No. 135	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership: Private	8. On National Register or part of estab. district? No. Visible from public road? Yes 11. Endangered? No. Visible from public road?					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 2515 Clifton 15. Style: Composite						
16.	Date(s): c. 19	Date(s): c. 1900					
17.	Architect: unk	nown 18. Builder: unknown					
19.	Original Use: r	esidence 20. Present Use: residence					
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: stone 25. Roof type/material: complex					
26.	No. Bays: Fron	t 2 Side 2 27. Wall treatment: vinyl siding					
28.	Plan shape: see	site map 29. Changes: Addition? rearq Altered? yes					
30.	Exterior condition: good 31: Open to public? no						
32.	Other Surveys is	n which included: Heritage/St. Louis survey, 1971					
33.	-	tion of important features: The central pyramidally-hipped is gabled at the front with a secondary hip at the north					

side. A shed-roof porch has straight brick pillars. Bay window under the

altered. Rear 1-story frame addition.

gabled left end, front elevation. Window to right of porch appears to have been

^{34.} History and Significance: George B. Cummings, an elder in the Clifton Heights Presbyterian Church and bookkeeper at Mercantile Trust, lived in this house in 1902, the earliest listing of a name at this address. --Heritage/St. Louis files [building permit not available]



1.	No. 161	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102							
2.	City/County: City of St. Louis, MO	4. Prepar	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	•	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes								
9.	Ownership:	8. On Nat	lonal	kegister	or part of	estab. district? No			
	Private	10. Visibl	e fro	m public	road? Yes	11. Endangered? No			
12.	Original name:								
13.	Present name/owner's name:								
14.	Street address:	ress: 2518 Clifton 15. Style: Tudor Revival							
16.	Date(s): 10/13/1937 - building permit								
17.	Architect: bui	lder		18. Buil	der: Jacob	Schaefer			
19.	Original Use: r	esidence	20.	Present	Use: reside	nce			
21.	No. of stories:	1 22.	Basem	ent? yes	23. Wall c	onstruction: masonry			
24.	Foundation mate	rial: stone		25. Ro	of type/mate	rial: gabled			
26.	No. Bays: Fron	t 4 Side 4	1	27. Wa	ll treatment	: buff brick			
28.	Plan shape: see	site map	29.	Changes:	Addition?	Altered?			
30.	Exterior condition: good 31: Open to public? no								
32.	Other Surveys i	n which inclu	ıded:	Heritage	/St. Louis s	urvey, 1971			
trim Main	lighted by an as med with a darke front window is	ymmetrical gar r buff brick. of the casem	able. The ment t	Front el front do ype and h	evation wind or has a bas as a soldier	ce of this house is ows and doors are ket-handle arch. lintel and sill of balustrade with a			

^{34.} History and Significance: Karin Jansson took out the building permit for this house in 1937, hiring builder Jacob A. Schaefer to construct the \$4,000 30 x 33' house. Schaefer was the president-treasurer of Schaefer Construction Co.; Theresa Schaefer was the vice president and E. L. Carson was the secretary.

top header course of the darker brick. Low rear addition is apparently original.



1.	No. 160	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,						
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files						
9.	Ownership: Private	8. On National Register or part of estab. district? N 10. Visible from public road? Yes 11. Endangered? N						
12.	Original name:):						
13.	Present name/ow	ent name/owner's name:						
14.	Street address:	2522 Clifton	15. Style: Queen Anne					
16.	Date(s): c. 18	e(s): c. 1890; altered 1954, 1975						
17.	Architect: unk	nown	18. Builder: unknown					
19.	Original Use: r	esidence 20.	Present Use: residence					
21.	No. of stories: 2 22. Basem		ment? yes 23. Wall construction: frame					
24.	Foundation mate	rial: stone	25. Roof type/material: complex					
26.	No. Bays: Fron	t 3 Side 3	27. Wall treatment: vinyl siding					
28.	Plan shape: see	site map 29.	Changes: Addition? Altered? yes					
30.	Exterior condit	ion: good	31: Open to public? no					
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971							

- 33. Further description of important features: Another unfortunate example of modernization, this house still retains a bit of its original detailing. All the windows have been replaced and several altered. The hipped roof has a small windowed gable at right and a gabled 2nd-story porch at left. This porch surmounts a projecting bay at the bottom story, and features bracketed fretwork, turned spindles and a wood balustrade. A second bay window (cont'd. below)
- 34. History and Significance: is located on the left (northeast) side at the first story. The entrance porch has a shed roof and wood posts with no railing. No inactive building permits are available for this city block. Heritage/St. Louis records indicate that Samuel Pye, manager of the Western Methodist Book Concern, lived here from 1888-91. Pye was an original Clifton Hts. Trustee; he moved to 3510 Lindell in 1892. This information is based on the presumed orig-



1.	No. 134	3. Location of Negatives: Missouri Office of Historic						
2.	City/County: City of St. Louis, MO	Preservation, P. O. Box 176, Jefferson City, MO 65103 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63103						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,						
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files						
9.	Ownership: Private	8. On National Register or part of estab. district? No. 10. Visible from public road? Yes 11. Endangered? No.						
12.	Original name:							
13.	Present name/ow	resent name/owner's name:						
14.	Street address:	Street address: 2523 Clifton			15. Style:	Queen	Anne	
16.	Date(s): c. 19	900						
17.	Architect: unk	: unknown 18			3. Builder: unknown			
19.	Original Use: r	esidence	Present Use: residence					
21.	No. of stories:	2 22.	Baseme	ent? yes	s 23. Wall	constru	uction: frame	
24.	Foundation material: concrete			25. R	Roof type/ma	erial:	complex	
26.	No. Bays: Front 3 Side 5			27. Wall treatment: asphalt siding				
28.	Plan shape: see site map 29.			Changes: Addition? yes Altered? yes				
30.	Exterior condition: good			31: Open to public? no				
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971						1971	

hipped, with multiple gables facing in different directions. Twin gables on the front elevation have different depths, probably originally forming an ell for an open porch, now enclosed. A south side gabled bay projects from the house, its corners cut out and bracketed at the first story to allow angled windows to form a more traditional bay window configuration. 1-over-1 (cont'd. below)

^{34.} History and Significance: double-hung sash windows. House is covered with brick-look siding, except for the first story front elevation, which has been altered. Rear second story frame porch is up on "stilts." Inactive building permits for this city block have not been microfilmed and so are unavailable, making exact dating impossible.



3. Location of Negatives: Missouri Office of Historic

Preservation, P. O. Box 176, Jefferson City, MO 65102

No. 159

City/County:

1.

2.

.	City of St. 4. Prepared by: Cynthia Hill Longwisch, Landmarks Ass Louis, MO of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63							
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,						
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:							
13.	Present name/owner's name:							
14.	. Street address: 2526 Clifton 15. Style: Bungaloid							
16.	Date(s): c. 1920; alteration 1926							
17.	Architect: unk	nown	18. B	18. Builder: unknown				
19.	Original Use: r	inal Use: residence 20. Present Use: residence						
21.	No. of stories:	1 22. Bas	ement? y	yes 23. Wall construction: masonry				
24.	Foundation mate	material: stone 25. Roof type/material: front gable						
26.	No. Bays: Front 3 Side 4 27. Wall treatment: red brick							
28.	Plan shape: see	site map 29	. Chang	ges: Addition? rear Altered? yes				
30.	Exterior condition: fair/good 31: Open to public? no							
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971							
fron appl wind	t gable end of the task that t	his house. Larg ppear to have be inum?) siding. from the front	e, block en "mode This sid elevatio	res: A round vent is located in the clike brackets are located at the ernized" into clunky boxes by the ling also appears on the frame bay on. A small porch at the left (north oof. Windows (cont'd. below				
34.	History and Sig	nificance: are	6-over-1	with flat arches and stone sills.				

No pre-1926 building permits are available for this city block, so the date of construction is unknown. A permit was taken out on 7/20/1926 for the alteration of this dwelling by B. Kindsen; no specifics were given, but it may have

A 1-story frame addition is attached at rear.

been for the rear addition.



	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 						
City/County: City of St. Louis, MO	4. Prepare	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
Date: 8/15/91				ion: St. Louis Public Records,			
Building? yes	_						
Ownership: Private	8. On National Register or part of estab. district? No. Visible from public road? Yes 11. Endangered? No. Visible from public road?						
Original name:	<u> </u>						
Present name/ow	ner's name:						
Street address:	2530 Clifton			15. Style: Queen Anne			
Date(s): c. 19	10		<u> </u>				
Architect: unk	nown	1	8. Bui	lder: unknown			
Original Use: re	esidence	20.	Present	Use: residence			
No. of stories:	2 22. B	aseme	nt? yes	23. Wall construction: frame			
Foundation mate	rial: concret	е	25. R	oof type/material: gabled			
No. Bays: Fron	t 3 Side 2		27. W	all treatment: asbestos siding			
Plan shape: see	site map	29.	Changes	: Addition? Altered?			
Exterior condit	ion: good		31:	Open to public? no			
Other Surveys in	n which includ	ed:	Heritag	e/St. Louis survey, 1971			
	Louis, MO Date: 8/15/91 Building? yes Ownership: Private Original name: Present name/own Street address: Date(s): c. 19 Architect: unkn Original Use: re No. of stories: Foundation mate: No. Bays: From Plan shape: see Exterior condit	Louis, MO Date: 8/15/91 Building? yes Ownership: Private Original name: Present name/owner's name: Street address: 2530 Clifton Date(s): c. 1910 Architect: unknown Original Use: residence No. of stories: 2 Foundation material: concret No. Bays: Front 3 Side 2 Plan shape: see site map Exterior condition: good	Louis, MO Date: 8/15/91 Building? yes Ownership: Private Original name: Present name/owner's name: Street address: 2530 Clifton Date(s): c. 1910 Architect: unknown Original Use: residence Foundation material: concrete No. Bays: Front 3 Side 2 Plan shape: see site map 29. Exterior condition: good	Louis, MO Date: 8/15/91 Building? yes Ownership: Private Original name: Present name/owner's name: Street address: 2530 Clifton Date(s): c. 1910 Architect: unknown Original Use: residence No. of stories: 2 Poundation material: concrete Side 2 Plan shape: see site map Of St. Louis, 917 Locus 6. Sources of informat City Hall; MO Historica 8. On National Registe 70. Visible from public 8. On National Registe 71. Visible from public 72. Street address: 2530 Clifton 18. Bui 18. Bui 18. Bui 19. Changes			

- has a heavy molded wood cornice that returns at the base of the gable to enclose the pediment; a square, multipane window is located above. Three 1-over-1 double-hung sash windows are evenly spaced across the 2nd story gable end. A wrap-around porch is supported by thin square posts. It features a decorative open cornice. Transomed door. Rear frame porch.

 34. History and Significance: The pre-1926 building permits are not available
- for this city block, so definite dating is not possible. Heritage/St. Louis records show Charles E. Rodgers owning the property in 1916, the first reference to ownership under the house number it bears today. The house is similar to other c. 1890 homes in the area, but could be as new as 1915, especially considering the concrete foundation not often used in this area before 1920. It is the foundation that is pushing the circa date forward.



1.	No. 133	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:	· · · · · · · · · · · · · · · · · · ·					
13.	Present name/ow	ner's name:					
14.	Street address:	2531 Clifton 15. Style: Tudor(-ish)					
16.	Date(s): c. 19	00					
17.	Architect: unk	nown 18. Builder: unknown					
19.	Original Use: r	esidence 20. Present Use: residence					
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: stone 25. Roof type/material: gabled ell					
26.	No. Bays: Fron	t 3 Side 2 27. Wall treatment: asbestos siding					
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered? yes					
30.	Exterior condit	ion: good 31: Open to public? no					
		n which included: Heritage/St. Louis survey, 1971					

- 33. Further description of important features: This house has a little of the fantasy cottage in its aspect. The chimneys are shaped by corbeling. Triangular eyebrow dormers on the north and east sides have tiny diamond panes. The front gable is bisected by a wood cornice supported by curved brackets; more brackets appear lower down at the eave. Carved decoration is also present overhead at the top of the steps. The original porch is probably (cont'd. below)
- 34. History and Significance: enclosed at left; what is left is an uncovered, patiolike, elevated front expanse sheathed in (perma?)stone. Rear frame addition is up on "stilts" to keep it level with the house on the steep rear grade. The inactive building permits for this city block were not microfilmed, so an exact date is not possible. However, the house was owned in 1930 by Patrick J. Hussey, whose daughter (the owner of the house in 1970) told Heritage/St. Louis



1.	No. 157			_		Office of Historic		
2.	City/County: City of St. Louis, MO	4. Pr	Preservation, P. O. Box 176, Jefferson City, MO 65102 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	1				uis Public Records,		
7.	Building? yes					tage/St. Louis files		
9.	Ownership: Private	: 				estab. district? No 11. Endangered? No		
12.	Original name:							
13.	Present name/ow	ner's nam	er's name:					
14.	Street address:	2534 CI	2534 Clifton 15. Style: Tudor Revival					
16.	Date(s): 2/14/	1928 - bı	uilding pe	ermit				
17.	Architect: bui	lder		18. Bu	ıilder: Alber	t Koberman		
19.	Original Use: r	esidence	20.	Preser	nt Use: resid	ence		
21.	No. of stories:	2 2	22. Baser	nent? ye	es 23. Wall	construction: masonry		
24.	Foundation mate	rial: st	tone	25.	Roof type/mat	erial: front gable		
26.	No. Bays: Fron	t 3 Si	ide 2	27.	Wall treatmen	t: yellow/brown brick		
28.	Plan shape: see	site mag	29.	Change	es: Addition?	rear Altered?		
30.	Exterior condit	ion: good	<u></u>	31:	Open to publ	ic? no		
32.	Other Surveys i	n which i	included:	Herita	age/St. Louis	survey, 1971		
used	lows appear in the labove. Two tri	e asymmet partite w	trical gal	ole end ith 6-ov	of this house ver-1 double-h	of paired 1-over-1; siding has been ung sash and stone dier course. Round-		

sills have blind (stuccoed) round arches bisected by a soldier course. Round-arched doorway at left. Shed roof dormer on left side. 1-story rear frame addition.

34. History and Significance: This house and survey #156 next door were listed on a single permit taken out by Oliver Graf in 1928. The 24 x 24' houses cost \$3,500 apiece and had hot water heat. The permit names Albert Koberman as the

builder. Koberman was in real estate and lived at 4324 Beethoven in 1925. Graf was a printer. He moved into the other house on the permit. It is not known

whether he sold or rented out this one.



1.	No. 132	:		-	s: Missouri Office of Historic Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Pı							
5.	Date: 8/15/91				on: St. Louis Public Records, Soc.; Heritage/St. Louis files				
7.	Building? yes			····					
9.	Ownership: Private		8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:	Original name:							
13.	Present name/ow	ner's na	me:						
14.	Street address:	2537 C	lifton	1	5. Style: Tudor Revival				
16.	Date(s): 7/20/	1931 - bi	uilding pe	ermit					
17.	Architect: Oli	ver Popp		18. Buil	der: M. Goldstein				
19.	Original Use: r	esidence	20.	Present	Use: residence				
21.	No. of stories:	1	22. Baser	ment? yes	23. Wall construction: masonry				
24.	Foundation mate	rial: si	tone	25. Ro	of type/material: gabled				
26.	No. Bays: Fron	t 4 S	ide 3	27. Wa	ll treatment: mottled buff brick				
28.	Plan shape: see	site maj	p 29.	Changes:	Addition? Altered?				
30.	Exterior condit	ion: good	d.	31: 0	pen to public? no				
32.	Other Surveys i	n which	included:	Heritage	/St. Louis survey, 1971				
	the state of the s		· · · · · · · · · · · · · · · · · · ·						

large chimney dominates the design's front elevation. A garage is incorporated

candomly-placed limestone accents at the corners highlight this house.

Further description of important features: A limestone door surround and

nto the overall plan. 1-over-1 paned windows have stone sills.

4. History and Significance: Builder M. Goldstein took out the 1931 permit

^{4.} History and Significance: Builder M. Goldstein took out the 1931 permit hat listed four houses (survey #129-132). Costing \$5,000 each, the 25 x 45' ouses were designed by St. Louis architect Oliver Popp. See information about opp attached to survey #129.



			<u> </u>					
1.	No. 156	3.			F Negatives: Missouri Office of Historic on, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO		4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Cit			information: St. Louis Public Records, Historical Soc.; Heritage/St. Louis files			
7.	Building? yes							
9.	Ownership: Private	8.			Register or part of estab. district? No om public road? Yes 11. Endangered? No			
12.	Original name:	ginal name:						
13.	Present name/own	ner's	name:					
14.	Street address:	reet address: 2538 Clifton 15. Style: Tudor Revival						
16.	Date(s): 2/14/	1928 -	buildin	g pe	ermit			
17.	Architect: bui	lder		PRESENTATION OF THE PROPERTY O	18. Builder: Albert Koberman			
19.	Original Use: re	esiden	ce	20.	Present Use: residence			
21.	No. of stories:	2	22. B	asem	ment? yes 23. Wall construction: masonry			
24.	Foundation mate	rial:	stone		25. Roof type/material: front gable			
26.	No. Bays: Fron	t 3	Side 3		27. Wall treatment: brown brick			
28.	Plan shape: see	site	map	29.	Changes: Addition? rear Altered?			
30.	Exterior condit	ion: g	ood	-	31: Open to public? no			
32.	Other Surveys in	n whic	h includ	ed:	Heritage/St. Louis survey, 1971			
door wind	house extends do way. Roof is co ows in front fea	ownwar vered ture b	d at the with und lind (st	rig ulat ucco	features: The asymmetrical gable end of ght side to provide room for a round-arched ting-patterned shingles. Two tripartite oed) arches bisected by a soldier course frames the windows and outlines the corners			

^{34.} History and Significance: timbering in the gable end. Shed-roof dormer at left side. Side openings have double-rowlock segmental arches. Rear 1-sty addn Oliver Graf took out the permit for this house and for 2534 (survey #157) next door in 1928. The 24 x 24' houses each had hot water heat and cost \$3,500 each. Real estate man Albert Koberman of 4324 Beethoven is listed as the builder. Graf moved into this house himself.

(cont'd. below)

of the house. Paired windows above are 9-over-1. Half-



1.	No. 131	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes	8. On National Register or part of estab. district? No					
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/ow	ner's name:					
14.	Street address:	2541 Clifton 15. Style: Tudor Revival					
16.	Date(s): 7/20/	1931 - building permit					
17.	Architect: Oli	ver Popp 18. Builder: M. Goldstein					
19.	Original Use: r	esidence 20. Present Use: residence					
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: stone 25. Roof type/material: gabled					
26.	No. Bays: Fron	t 4 Side 1 27. Wall treatment: mottled red brick					
28.	Plan shape: see	site map 29. Changes: Addition? Altered?					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					

the corners and provides a door surround. The chimney is a central element in the design and the garage is incorporated into the plan. 1-over-1 windows have

stone sills.

^{34.} History and Significance: This is the third of four dwellings listed on a single permit taken out in 1931 by M. Goldstein. The 25 x 45' houses cost \$5,000 each and had hot water heat. Local architect Oliver Popp did the designs for the houses; city directory information about him is attached to survey \$129.



1.	No. 130			-	es: Missouri Box 176. Je:		of Historic City, MO 6510
į	City/County: City of St. Louis, M O	4. Prepare	ed by:	Cynthi		isch, L	andmarks Assn.
5.	Date: 8/15/91	•			ion: St. Lo		olic Records, . Louis files
7.	Building? yes				er or part of	- -	
	Ownership: Private			-	road? Yes		Endangered? No
12.	Original name:				····	<u> </u>	
13.	Present name/ow	ner's name:					
14.	Street address:	2545 Clifto	n	Pri danique primare	15. Style:	Tudor	Revival
16.	Date(s): 7/20/	1931 - buildi	ng perm	it			
17.	Architect: Oli	ver Popp	18	. Bui	lder: M. Go	ldstein	ı
19.	Original Use: r	esidence	20. P	resent	Use: resid	ence	
21.	No. of stories:	1 22.	Basemen	t? yes	23. Wall	constru	ction: masonry
24.	Foundation mate	rial: stone	A	25. R	loof type/mate	erial:	gabled
26.	No. Bays: Fron	t 4 Side 3	+	27. W	all treatmen	t: brow	n/multi brick
28.	Plan shape: see	site map	29. C	hanges	: Addition?	yes	Altered?
30.	Exterior condit	ion: good	ar ar interpretation	31:	Open to publ	ic? no)
32.	Other Surveys i	n which inclu	ded: H	leritag	re/St. Louis	survey,	1971
of th	Further descrip e facade encomp age-house style	asses a small	er gabl	e over	the entrance	e and t	he linteled,

Stone is used randomly on corners and as the door surround. The large chimney is central to the design of the house. A 1965 brick enclosure for the 1965

swimming pool makes the house substantially larger than its neighbors.

^{34.} History and Significance: M. Goldstein took out the permit for this and three neighboring houses in 1931. The 25 x 45' houses were to cost \$5,000 each. Architect Oliver Popp did the design. See attached, survey #129, for more information on Popp.



1.	No. 129		Negatives: Missouri Office of Historic on, P. O. Box 176, Jefferson City, MO 6510					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91		information: St. Louis Public Records, listorical Soc.; Heritage/St. Louis files					
7.	Building? yes							
9.	Ownership: Private		Register or part of estab. district? No m public road? Yes 11. Endangered? No					
12.	Original name:							
13.	Present name/ow	ner's name:						
14.	Street address:	2549 Clifton	15. Style: Tudor Revival					
16.	Date(s): 7/20/	1931 - building per	ermit					
17.	Architect: Oli	ver Popp	18. Builder: M. Goldstein					
19.	Original Use: r	esidence 20.	Present Use: residence					
21.	No. of stories:	1 22. Baseme	nent? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: stone	25. Roof type/material: gabled					
26.	No. Bays: Fron	t 4 Side 2	27. Wall treatment: brown/multi brick					
28.	Plan shape: see	site map 29.	Changes: Addition? Altered?					
30.	Exterior condit	ion: good	31: Open to public? no					
32.	Other Surveys i	n which included:	Heritage/St. Louis survey, 1971					
corp	ners of detailing	like the chimney a house design with a	features: Stone is used randomly at the and projecting entrance. A garage is ineexposed rafter ends, multipane door and ad-arched. 1-over-1 windows with stone					

sills and flat arches. Chimney is a prominent part of the overall design.

^{34.} History and Significance: M. Goldstein took out a single permit listing four dwellings (survey #129-#132; 2549-45-41-37 Clifton) in 1931. The 25 x 45' houses each cost \$5,000 and had hot water heat. Goldstein is listed on the permit as the owner/builder, and St. Louis architect Oliver Popp is the architect (see attached for city directory information on Popp).

Popp, Wm Charles and Oliver J.

1944 Oliver same r. but no occ listed

1960 Oliver same r.

```
U.S. Census 1880 Soundex P100:
                                            ref to Enum Dist 63, sheet 15, line 21
 Wm Charles Popp age 34, born Germany
                                        910 Hickory
 wife Frances, 32, b. Bohemia
 son Chas W or H? 10, b. Mo
 son Oliver J. 9, b. MO
 son Louis P. 8, b. MO
 dau Fannie, 5, b. MO
 dau Flora 3, b. MO
dau Laur 1/12 b. MO
 1900 U.S. Soundex
                         ref to E.D. 88, s, 13
 Oliver J. Popp b. 1871 MO r. 418 S. 9th
wife Annie J. b. 1872 MO
 dau Adele b. 1896 MO
 Wm. C. b. 1846 Germ r. 910 Hickory
 Frances b. 1848 Ger
 Francia? b 1874 MO
 Laura b. 1878
 Wm F. b 1881
 Hilda b. 1885
 City Directories:
 no Wm 1857
 didn't check 1860
 186X4Wm, Carpenter, r. Winter bet South & Stoddard
 1872 67
                     t. 1118 S. 11th
                     r. 1117 Stoddard
 1870
 1872 "
              11
                     r. 1414 Hamptranck
        " capr, John Marzulef (carpenter) r. 1414 State
 1873
 1874 carp r. 1414 S. 13th
 1875 C
          r. 1416 State
 1878 Wm C, carp r. 1415 S. 11th
                  r. 1415 Menard
 1879
 1882
           blder, 910 Hickory
 1883
            carp 910 Hickory
 1884
1888 Oliver J. draughtsman, r. 910 Hickory
      Wm C. carp, 910 Hickory
 1890
      same
 1896
         Wm Chas Popp & son, architects
                                          908 Hickory, r. 910 Hickory
 1900
        xxmm Oliver J., arch, 918 Hickory (typo?)
          Wm_Ch, contr. 910 Hickory
       Oliver, archt 520 Olive and 1118 S. 9th
       Wm Ch contr 910 Hickory
 1904 Oliver archt 816 Olive, r. 1118 S. 9th
      Wm Charles contr 908 Hickory, r. 910 Hickory
 1905 Oliver, same, but Wm Charels not listed
 1907 Oliver, same office but r. 4976A Reber Pl
 1930 Oliver, Archt & Supt, 1528 Arcade Bldg, 812 Olive r. 4046 Magnolia
 1936
         same
 1939
         same
 1941 Oliver J., archt, 4046 Magnolia (no office listing
```

1961 not listed



1.	No. 155	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	· -	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	!				is Public Records, cage/St. Louis files		
7.	Building? yes			-		estab. district? No		
9.	Ownership: Private			public		11. Endangered? No		
12.	Original name:	,						
13.	Present name/ow	ner's name:	_					
14.	Street address:	2554 Clift	on	1	5. Style:	Queen Anne		
16.	Date(s): c. 18	90						
17.	Architect: unk	nown	1	8. Buil	der: unknow	·n		
19.	Original Use: r	esidence	20.	Present	Use: reside	ence		
21.	No. of stories:	2 22.	Baseme	nt? yes	23. Wall o	construction: frame		
24.	Foundation mate	rial: stone		25. Ro	oof type/mate	erial: gabled		
26.	No. Bays: From	t 4 Side	4	27. Wa	ıll treatment	asbestos siding		
28.	Plan shape: see	site map	29.	Changes:	Addition?	Altered?		
30.	Exterior condit	ion: good	<u>' </u>	31: 0	pen to publi	ic? no		
			uded:		e/St. Louis s	1071		

story is supported by square posts sheathed in the same siding as the house. It features a dentilled cornice. At the south side of the house, a projecting, gabled bay is cut out at the corners on the first story for angled window placement in a bay window. Door has sidelights and fanlight. 1-over-1 windows.

34. History and Significance: No pre-1926 building permits are available for this city block. Heritage/St. Louis records show an Elder of the Clifton Hts.

Presbyterian Church, George McCrea, vice-president of Bain-Chapman Mfg. Co. at 114 N. Main, living here in 1891. This is using the supposed original house number of 6330 Clifton. The first reference they list using the present house number is 1916, when Laura L. Jones lived here.



1.	No. 128	3. Location of Negatives: Missouri Office of Preservation, P. O. Box 176, Jefferson Ci	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Land of St. Louis, 917 Locust, 7th Floor, St. Loui	lmarks Assn.
5.	Date: 8/15/91	6. Sources of information: St. Louis Public City Hall; MO Historical Soc.; Heritage/St. I	
7.	Building? yes		
9.	Ownership:	8. On National Register or part of estab. di	istrict? No
	Private	10. Visible from public road? Yes 11. End	langered? No
12.	Original name:		
13.	Present name/ow	er's name:	
14.	Street address:	2555 Clifton 15. Style: Queen Ann	ne
16.	Date(s): c. 19	5	
17.	Architect: unk	own 18. Builder: unknown	
19.	Original Use: r	sidence 20. Present Use: residence	
21.	No. of stories:	2 22. Basement? yes 23. Wall constructi	ion: frame
24.	Foundation mate	ial: stone 25. Roof type/material: ga	abled
26.	No. Bays: Fron	4 Side 2 27. Wall treatment: alumin	um siding
28.	Plan shape: see	site map 29. Changes: Addition? Al	ltered? yes
30.	Exterior condit	on: good 31: Open to public? no	
32.	Other Surveys i	which included: Heritage/St. Louis survey, 19	971
havi	extends through ing some fanciful	ion of important features: The dominant center the porch was probably an open second-story por ornamentation, prior to the aluminization of the centered around the pavilion, having square we	rch, possibly his house.

a wood balustrade. The front corners of this house are cut out for windows to

(cont'd. below)

be inset at an angle. A single round-arched window looks onto

No inactive (c. 1950 and earlier) building permits are available for this city block. In 1907 Arville A. van Cleave, proprietor of the Grand View Fire Clay Mines, lived here.

^{34.} History and Significance: the porch at the left (south) side. Several of the windows have clear center panes completely surrounded by squares of stained glass.



1.	No. 154	1	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepar	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	•			ion: St. Lou l Soc.; Herit			
7.	Building? yes	-	_					
9.	Ownership: Private		8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:	·						
13.	Present name/ow	ner's name:	_					
14.	Street address:	2600 Clifto	on		15. Style:	Queen	Anne	
16.	Date(s): c. 19	00						
17.	Architect: unk	nown	and a second sec	18. Bui	lder: unknow	wn	-	
19.	Original Use: r	esidence	20.	Present	Use: reside	ence		
21.	No. of stories:	2 22.	Baser	ment? yes	23. Wall	constru	uction: fram	е
24.	Foundation mate	rial: stone		25. R	oof type/mate	erial:	complex	
26.	No. Bays: From	t 3 Side 3	3	27. W	all treatmen	t: asbe	estos siding	
28.	Plan shape: see	site map	29.	Changes	: Addition?		Altered? y	es
30.	Exterior condit	ion: good		31: (Open to publ	ic? no	ס	
32.	Other Surveys i	n which inclu	ıded:	Heritage	e/St. Louis	 survey,	, 1971	
								

- 33. Further description of important features: The main roof of this house is pyramidally hipped; gables project from that. An angled corner bay is topped with a gable at the left (northwest) corner; the first-floor window of this bay has been replaced, while above, the original tripartite window remains. Other windows are 1-over-1 double-hung sash. Rectangular window is sideways in right gable. Door surround features engaged pilasters and a dentilled entablature.
- 34. History and Significance: No building permits prior to 1926 are available for this city block. References to this house are somewhat confusing, because its house number was different before 1908. Heritage/St. Louis records site a 1916 directory reference to Robert McCord living here (2600) and a 1901 reference from Fry Church to Elmira Sebastian, widow of Charles, living at 6342 Clifton, which is supposedly the original house number. Either date could be acceptable as the earliest occupant.



1.	No. 127	†	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepar	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	7			cion: St. Louis Public Records,			
7.	Building? yes	City Hall;	, MU 1	Historica	al Soc.; Heritage/St. Louis files			
9.	Ownership:	8. On Nat	tiona	l Registe	er or part of estab. district? No			
,.	Private	10. Visibl	le fr	om public	c road? Yes 11. Endangered? No			
12.	Original name:							
13.	Present name/ow	ner's name:						
14.	Street address:	2601 Clifto	on	, The state of the	15. Style: Queen Anne			
16.	Date(s): c. 19	00						
17.	Architect: unk	nown		18. Bui	ilder: unknown			
19.	Original Use: r	esidence	20.	Present	Use: residence			
21.	No. of stories:	2 22.	Baser	ment? yes	23. Wall construction: frame			
24.	Foundation mate	rial: stone		25. I	Roof type/material: hipped			
26.	No. Bays: Fron	t 6 Side 4	4	27. V	Wall treatment: narrow siding			
28.	Plan shape: see	site map	29.	Changes	s: Addition? Altered?			
30.	Exterior condit	ion: good		31:	Open to public? no			
32.	Other Surveys i	n which inclu	uded:	Heritag	ge/St. Louis survey, 1971			
	t elevation echo	es the repeat	ted a	ngles of	s: A hipped-roof dormer on the the roofline. 1-over-1 double-hun t side has cutouts at ground floor			

corners to place angled windows, forming a "bay window." A long frame porch is

supported by square wood columns; wood balustrade; dentilled cornice. The

siding is recent (vinyl?), replacing old asbestos siding.

^{34.} History and Significance: No building permits prior to c. 1950 are available for this city block. Apparently the first to live in the house was Monroe R. Cramer, a Trustee and Secretary of nearby Fry Methodist Church. Cramer, a clerk at Simmons Hardware, moved from 3743 S. Broadway to nearby Famous Ave. in 1887. He is listed (at what apparently is this address - the numbers changed in 1908) in 1901. --Heritage/St. Louis files



No. 153	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No			
Original name:				
Present name/owner's name:				
Street address: 2604 Clifton 15. Style: Colonial Revival				
Date(s): c. 1915				
Architect: unknown 18. Builder: unknown				
Original Use: residence 20. Present Use: residence				
. No. of stories: 2 22. Basement? yes 23. Wall construction: f				
Foundation material: concrete 25. Roof type/material: gambrel				
No. Bays: Front 3 Side 2 27. Wall treatment: (aluminum?) sid				
Plan shape: see	site map 29. Changes: Addition? Altered?			
Exterior condit	ion: good 31: Open to public? no			
Other Surveys i	which included: Heritage/St. Louis survey, 1971			
	City/County: City of St. Louis, MO Date: 8/15/91 Building? yes Ownership: Private Original name: Present name/own Street address: Date(s): c. 191 Architect: unkn Original Use: re No. of stories: Foundation mater No. Bays: Front Plan shape: see Exterior condition			

33. Further description of important features: This gambrel house has an almost full-width dormer on the front elevation. A nearly flat porch roof below is supported by two tapered Craftsman pillars attached to a beam. Wood cross-buck porch railing; (perma?)stone on porch foundation. Windows are mostly 3-over-1 double-hung sash. Rear frame porch.

^{34.} History and Significance: No building permits before 1926 are available for this city block. This is one of the houses in Clifton Heights that had a different address to start with, so some confusion exists regarding building references. From Heritage/St. Louis files: 1916: Clyde A. Jennings lived here at the 2604 address; 1901: Robert S. McCallen is listed at 6344 Clifton, which allegedly became 2604 - their source was evidently Fry Church records. It seems doubtful to this surveyor that this house dates to c. 1900, hence my circa date.



1.	No. 152	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 							
2.	City/County: City of St. Louis, MO								
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files							
7.	Building? yes								
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No							
12.	Original name:	<u> </u>							
13.	Present name/own	owner's name:							
14.	Street address:	2608 Clifton 15. Style: modified Queen Anne							
16.	Date(s): c. 19	00		<u> </u>	~			Viena de la companya del companya de la companya de la companya del companya de la companya de l	
17.	Architect: unk	nown		18. Bu	ıilde	r: unkno	wn		
19.	Original Use: re	esidence	20.	Preser	nt Us	e: resid	ence		
21.	No. of stories:	2 22.	Basem	ent? ye	es :	23. Wall	constru	ction: fram	ne
24.	Foundation mate	rial: stone		25.	Roof	type/mat	erial:	complex	
26.	No. Bays: Fron	t 4 Side 2	2	27.	Wall	treatmen	t: alum	ninum siding	3
28.	Plan shape: see	site map	29.	Change	es: /	Addition?		Altered? y	/es
30.	Exterior condit	ion: good		31:	Ope	n to publ	ic? no)	
32.	Other Surveys i	n which inclu	ıded:	Herita	ige/S	t. Louis	survey,	1971	
	Further descripto obscure its or ly should have be	iginal style,	, whic	h was p	probal	bly a mod	est Que		t

character of a house.

ring of detailing and how the alteration of windows can destroy the original

^{34.} History and Significance: All inactive building permits for this city block are unavailable.



1.	No. 151	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,				
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No				
9.	Ownership:	8. On National	register of part of estab. district: No			
	Private	10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:	÷:				
13.	Present name/ow	ent name/owner's name:				
14.	Street address:	ress: 2612 Clifton 15. Style: Queen Anne				
16.	Date(s): c. 19	000				
17.	Architect: unk	lown	18. Builder: unknown			
19.	Original Use: r	esidence 20.	Present Use: residence			
21.	No. of stories:	2 22. Basem	ent? yes 23. Wall construction: frame			
24.	Foundation mate	rial: stone	25. Roof type/material: cross gable			
26.	No. Bays: Fron	: 3 Side 2	27. Wall treatment: clapboarding			
28.	Plan shape: see	site map 29.	Changes: Addition? Altered?			
30.	Exterior condit	on: good	31: Open to public? no			
32.	Other Surveys i	which included:	Heritage/St. Louis survey, 1971			

^{33.} Further description of important features: The clipped gables of this house feature imbricated wood shingles and a small, divided window. Below, 1-over-1 windows are possibly replacements. A porch extends across the front and wraps around; it features wood spindles above and wood balustrading; square wood posts. Open rear porch.

^{34.} History and Significance: No building permits issued prior to 1926 are available for this city block. Heritage/St. Louis files have no information on this house.



No. 126	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
Ownership:	8. On National Register or part of estab. district? No			
Private	10. Visible from public road? Yes 11. Endangered?			
Original name:	riginal name:			
Present name/own	Present name/owner's name:			
Street address:	treet address: 2615 Clifton 15. Style: Queen Anne			
Date(s): c. 190	00			
Architect: unk	nown 18. Builder: unknown			
Original Use: re	esidence 20. Present Use: residence			
No. of stories:	2 22. Basement? yes 23. Wall construction: frame			
Foundation mate:	rial: stone 25. Roof type/material: complex			
No. Bays: Front 2 Side 2 27. Wall treatment: clapboarding				
Plan shape: see	site map 29. Changes: Addition? Altered?			
Exterior condit	ion: fair/good 31: Open to public? no			
	City/County: City of St. Louis, MO Date: 8/15/91 Building? yes Ownership: Private Original name: Present name/own Street address: Date(s): c. 190 Architect: unknown Original Use: re No. of stories: Foundation mater			

^{33.} Further description of important features: The original undulating pattern of the roofing shingles is still intact. A wrap-around porch is supported by thin wood posts. Paired front windows. Side bay window at first story.

^{34.} History and Significance: The inactive building permits for this city block have not been microfilmed and are thus unavailable. Charles and W. T. Clymer were residents here in 1909, the earliest confirmed listing at this address. W. T. Clymer was a builder throughout St. Louis in the early decades of this century.



1.	No. 150	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 			
2.	City/County: City of St. Louis, MO				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files			
7.	Building? yes				
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/ow	ner's name:			
14.	Street address:	2620 Clifton 15. Style: modified Queen Anne			
16.	Date(s): c. 19	10			
17.	Architect: unk	nown 18. Builder: unknown			
19.	Original Use: r	esidence 20. Present Use: residence			
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonry			
24.	Foundation mate	rial: stuccoed 25. Roof type/material: complex			
26.	No. Bays: Fron	t 3 Side 4 27. Wall treatment: stuccoed/1/2 timber			
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered? yes			
30.	Exterior condit	ion: good 31: Open to public? no			
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971			
	se has been stucc	tion of important features: The entire exterior of this oed and rectilinearly "half-timbered." The hipped roof has			

porch has round arches and a permastone base. A side entrance in a projecting bay faces toward the front. Rear one-story addition. This house was probably originally a Queen Anne or variation thereof before it was entombed.

34. History and Significance: No inactive building permits are available for

front- and side-facing gables with diamond-shaped gable windows. A small front

^{34.} History and Significance: No inactive building permits are available for this city block. Heritage/St. Louis records indicate with a question mark that Eudorus Harden owned the house in 1916.



1.	No. 125	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/ow	ent name/owner's name:			
14.	Street address:	2623 Clifton 15. Style: Queen Anne			
16.	Date(s): c. 19	900			
17.	Architect: unk	nown	18. Builder: unknown		
19.	Original Use: r	esidence	Present Use: residence		
21.	No. of stories:	2 22. B	Basement? yes 23. Wall construction: masonry		
24.	Foundation mate	rial: stone	25. Roof type/material: complex		
26.	No. Bays: Front 2 Side 2		27. Wall treatment: buff & red brick		
28.	Plan shape: see	site map	29. Changes: Addition? rear Altered?		
30.	Exterior condit	ion: good	31: Open to public? no		
32.	Other Surveys i	n which includ	ided: Heritage/St. Louis survey, 1971		
the fret wind	vey #124 next doo house. A gabled twork, turned pos lows have pressed	r. The buff be wood porch fe ts and wood ba brick segment	tant features: This house is a virtual twin of brick facade gives way to a red brick body of eatures a pressed sunburst design in the gable, balusters. The door is transomed. Upper facade tal arches, while at the first story the prestivided fanlight. Both main (cont'd. below)		

^{34.} History and Significance: openings are paired 1-over-1 double-hung sash windows. All have stone sills. Raised string sill course on facade at both stories. Rear one-story frame addition. Dormer on west elevation. See Item 34, survey #124, for additional information.



1.	No. 124	3. Locati	ion of	Negativ	ves: Missouri Office of Historic				
2.	City/County:	Presei	Preservation, P. O. Box 176, Jefferson City, MO 65102						
	City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101							
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files							
7.	Building? yes								
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No							
12.	Original name:								
13.	Present name/owner's name:								
14.	Street address: 2627 Clifton 15. Style: Queen Anne								
16.	Date(s): c. 1900								
17.	Architect: unknown 18. Builder: unknown								
19.	Original Use: r	esidence	20.	Present	t Use: residence				
21.	No. of stories:	2 22.	Basen	nent? yes	s 23. Wall construction: brick				
24.	Foundation mate	rial: stone	q	25. I	Roof type/material: complex				
26.	No. Bays: Fron	t 2 Side 2	2	27. V	Wall treatment: buff & red brick				
28.	Plan shape: see	site map	29.	Changes	s: Addition? Altered?				
30.	Exterior condit	ion: good	<u> </u>	31:	Open to public? no				
32.	Other Surveys i	n which incl	uded:	Heritag	ge/St. Louis survey, 1971				
Wind	Further descrip are virtual twi lows on the front	tion of impor ns. The hip elevation ha	rtant ped an	features nd gabled ressed-bi	ge/St. Louis survey, 1971 s: This house and survey #125 d roof has a hipped-roof dormer rick segmental arches (2nd stor The main second story opening i				

34. History and Significance: cornice. Raised string sill courses on facade. Buff brick facade, red brick body of house. A gabled frame porch has a pressed sunburst design, fretwork, and turned posts. Transomed door. Seg. side arches. Heritage/St. Louis records indicate that a "Miss Elizabeth Wade described the house as 'old' in 1912." No further documentation was apparently made. Since both the statement and the source are vague, dating by this method is difficult.

pair of 1-over-1 windows with an arched transom; below, a divided fanlight high-

(cont'd. below)

lights paired 1-over-1 windows; all have stone sills.

The design could have been done anywhere from 1890 - 1905



1.	No. 123	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership:	8. On National Register or part of estab. district? No					
	Private	10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 2633 Clifton 15. Style: American Foursquare						
16.	Date(s): c. 1905						
17.	Architect: Walter J. Lewis? 18. Builder: unknown						
19.	Original Use: r	esidence 20. Present Use: residence					
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: stone 25. Roof type/material: hipped					
26.	No. Bays: Fron	t 2 Side 1 27. Wall treatment: asbestos siding					
28.	Plan shape: see	site map 29. Changes: Addition? Altered?					
30.	Exterior condit	ion: fair/good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
33.	Further descrip	tion of important features: A hipped-roof dormer on the					

front elevation has two windows. The frame porch has imbricated wood shingles in the gable end, a dentilled cornice and round wood columns. The doorway features sidelights and a rectangular fanlight. The house is very similar to survey #122 next door.

^{34.} History and Significance: The inactive permits for this city block are not available, so definite dating is not possible. However, the very similar house next door (survey #122) dates to at least c. 1905 and Heritage/St. Louis records show that Gustave Detjen, owner of this house c. 1916-30, felt that the two were both built by architect Walter Jefferson Lewis, who lived at 6255 Simpson.



MO 8/15/91 ng? yes hip: e 1 nal name: nt name/owner address: 2	4. Prepared of St. Louis 6. Sources City Hall; M 8. On Natio 0. Visible	i by: Cynts, 917 Loc of inform MO Histori	thia Hill Longwisch, Landmarks Assn. cust, 7th Floor, St. Louis, MO 63101 mation: St. Louis Public Records, ical Soc.; Heritage/St. Louis files ster or part of estab. district? No lic road? Yes 11. Endangered? No					
ng? yes hip: e 1 nal name: nt name/owner address: 2	City Hall; M 8. On Natio 0. Visible 's name:	MO Histori onal Regis	ical Soc.; Heritage/St. Louis files ster or part of estab. district? No lic road? Yes 11. Endangered? No					
ng? yes hip: e 1 al name: at name/owner address: 2	8. On Natio 0. Visible 's name:	onal Regis	ster or part of estab. district? No lic road? Yes 11. Endangered? No					
hip: e 1 nal name: nt name/owner address: 2	0. Visible 's name:		lic road? Yes 11. Endangered? No					
at name/owner			15. Style: American Foursquare					
address: 2			15. Style: American Foursquare					
the continue or continues of tabular stands are distant to the continue of the continues of the continues of tabular tables and the continues of tabular tables are continued to the continues of tabular tables are continued to table are cont	641 Clifton		15. Style: American Foursquare					
): c. 1905								
		Date(s): c. 1905						
Architect: Walter J. Lewis? 18. Builder: unknown								
al Use: resi	dence 2	20. Prese	ent Use: residence					
stories: 2	22. Ba	asement? y	yes 23. Wall construction: frame					
tion materia	1: stone	25.	Roof type/material: hipped					
ys: Front 2	Side 2	27.	Wall treatment: aluminum siding					
hape: see si	te map 2	29. Chang	ges: Addition? Altered?					
or condition	: good	31:	: Open to public? no					
Surveys in w	hich include	ed: Herit	tage/St. Louis survey, 1971					
-	hape: see si or condition Surveys in w	hape: see site map or condition: good Surveys in which include	hape: see site map 29. Chan or condition: good 31					

configuration goes. A small porch with a hipped roof is supported by round wood

columns.

^{34.} History and Significance: No inactive building permits earlier than 1950 have been microfilmed for this city block, leaving exact dates open to speculation. However, Heritage/St. Louis research indicates that local Episcopalian church records mention a Cummings family wedding in this house in 1908. A former owner of survey #123 (2633 Clifton) stated that architect Walter Jefferson Lewis designed these houses. Lewis lived at 6255 Simpson (survey #149), attributed to him in Heritage/St. Louis files.



1.	No. 224	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,						
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:							
13.	Present name/ow	ent name/owner's name:						
14.	Street address:	address: 2657 Clifton(no photo) 5. Style: Queen Anne						
16.	Date(s): c. 19	(s): c. 1900						
17.	Architect: unknown 18. Builder: unknown							
19.	Original Use: r	esidence 20. Present Use: residence						
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: brick/fr						
24.	Foundation mate	rial: stone 25. Roof type/material: side gable						
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: red brick/frame						
28.	Plan shape: see	site map 29. Changes: Addition? Altered?						
30.	Exterior condit	ion: good 31: Open to public? no						
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971						
pord rail	orick; frame aboven the contract of the contra	tion of important features: The first story of this house e. The side-gabled roofline has a wide overhang. A front st of the width of the house, with brick pillars and wood n the front elevation has 2 small windows. Soldier arches segmental arches on sides. No photo due to surveyor over-						

^{34.} History and Significance: No inactive building permits were available for this city block.

sight.

1.	Cl. Hts.(extra) 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102							
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes							
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No						
12.	Original name: Clifton Heights Police Station							
13.	Present name/owner's name: Amvets Alan Blest Post #6							
14.	Street address: 2718 Clifton 5. Style: Romanesque							
16.	Date(s): 4/6/1896 - building permit							
17.	Architect: builder 18. Builder: R. T. Dawson & Son							
19.	Original Use: residence 20. Present Use: residence							
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry						
24.	Foundation mate	rial: stone 25. Roof type/material: hipped						
26.	No. Bays: Fron	t 2 Side 3 27. Wall treatment: red brick						
28.	Plan shape: see	site map 29. Changes: Addition? side Altered? yes						
30.	Exterior condit	ion: good 31: Open to public? no						
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971						
this and here	he survey proper researcher happ Heritage/St. Lou at the end. A	tion of important features: This building is not included because of its alterations and addition; however, since ened to locate the building permit in a different city block is had verbally speculated so much about it, it's included corner tower has a steep pyramidal roof. Round arches all have pressed-brick hoods and limestone (cont'd. below)						

^{34.} History and Significance: sill course. Heavy, ornate limestone round-arched entrance features carved pillars. Stone water table. All windows infilled. Mondo ugly 1-story frame and concrete block addition at south side. The original 27 x 42' station cost \$3,500. Dawson was a local contractor sometimes referred to as an architect. The building has been the home of the Amvets Post #6 at least since c. 1970.



1.	No. 201	No. 201 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes							
9.	Ownership: Private	8. On National Register or part of estab. district? No. 10. Visible from public road? Yes 11. Endangered? No.						
12.	Original name: Clifton Park Rest Station							
13.	Present name/owner's name:							
14.	Street address: Clifton Park Lake 15. Style: Deco?							
16.	Date(s): c. 1930							
17.	Architect: unknown 18. Builder: unknown							
19.	Original Use: r	esidence 20. Present Use: residence						
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: concrete						
24.	Foundation mate	rial: concrete 25. Roof type/material: flat						
26.	No. Bays: Fron	t 3 Side 1 27. Wall treatment: painted						
28.	Plan shape: see	site map 29. Changes: Addition? Altered?						
30.	Exterior condit	ion: fair/good 31: Open to public? no						
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971						
33.	Further descrip	tion of important features: This is a public restroom for						

railing between.

Clifton Parkgoers. The top is studded with concrete posts with metal iron

^{34.} History and Significance: No permit was found for this building and no mention is made of it in the Heritage/St. Louis files.



		-						
1.	No. 203	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes							
9.	Ownership:	8. On Na	tional	Register	or part of	estab.	district? N	
	Private	10. Visib	le fro	m public .	road? Yes	11.	Endangered? N	
12.	Original name:							
13.	Present name/owner's name:							
14.	Street address: 2504 Clifton Park Ter. 15. Style: Col. Rev./Craftsman							
16.	Date(s): 12/9/	1927 - build	ling pe	rmit				
17.	Architect: bui	lder		18. Buil	der: Harry	C. Vol	lmar	
19.	Original Use: r	esidence	20.	Present	Use: resid	ence		
21.	No. of stories:	2 22.	Basem	ent? yes	23. Wall	constru	ction: frame	
24.	Foundation mate	rial: concr	ete	25. Ro	of type/mat	erial:	mock gambrel	
26.	No. Bays: Fron	t 4 Side	3	27. Wa	ll treatmen	t: viny	l siding	
28.	Plan shape: see	site map	29.	Changes:	Addition?	rear	Altered?	
30.	Exterior condit	ion: good	<u> </u>	31: 0	pen to publ	ic? no		
32.	Other Surveys i	n which incl	uded:	Heritage	/St. Louis	survey,	1971	

- 33. Further description of important features: *Like Vollmar's other gambrels, this one is really a 2-story side gable with an inset eave to simulate a true gambrel with a full-width dormer. Triple windows are 6-over-1. A one-story flat-roofed side addition is original; it has long multipane windows. Gabled and bracketed hood over door. Rear frame addition.
- 34. History and Significance: Harry C. Vollmar took out the permit for this and two other houses (survey #202 & #204) in 1927. The houses were to cost \$3,000 apiece. The 24 x 30' dwellings were to have hot air heat. The owner is listed as T. G. Eichman, who did not live in the dwellings. Interestingly, Heritage/St. Louis chose to single out this house as exceptionally worthy of architectural merit odd, when Vollmar built at least five others just like it



1.	No. 202	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes							
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:							
13.	Present name/owner's name:							
14.	Street address: 2506 Clifton Park Ter. 15. Style: Colonial Revival							
16.	Date(s): 12/9/1927 - building permit							
17.	Architect: bui	lder 18. Builder: Harry C. Vollmar						
19.	Original Use: r	esidence 20. Present Use: residence						
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame						
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable						
26.	No. Bays: Fron	t 4 Side 2 27. Wall treatment: wood clapboarding						
28.	Plan shape: see	site map 29. Changes: Addition? Altered?						
30.	Exterior condit	ion: good 31: Open to public? no						
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971						
33	Further description of important features. The windows of this house are							

^{33.} Further description of important features: The windows of this house are primarily paired 6-over-1 double-hung sash. A gabled and bracketed hood shelters the centered doorway. A one-story flat-roofed addition on the north side is original.

^{34.} History and Significance: This and two other houses were listed on a single permit taken out in 1927 by local builder Harry C. Vollmar. The houses were to cost 3,000 each; the 24 x 30' dwellings were listed as having hot air heat. T. G. Eichman, who according to city directories did not live in any of the three houses, is listed on the permit as the owner.



1.	No. 073	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
7.	Building? yes						
9.	Ownership: Private						
12.	Original name:						
13.	Present name/ow	ne/owner's name:					
14.	Street address:	eet address: 5952 Columbia 15. Style: Bungaloid					
16.	Date(s): 5/13/	Date(s): 5/13/1929 - building permit					
17.	Architect: bui	builder 18. Builder: Donovan Construction Co.					
19.	Original Use:	residence 20. Present Use: residence					
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: limestone 25. Roof type/material: front gable					
26.	No. Bays: Fron	t 3 Side 4 27. Wall treatment: brown brick					
28.	Plan shape: see	site map 29. Changes: Addition? Altered?					
30.	Exterior condit	ion: fair/good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
	house has a fro	tion of important features: The full-width porch roof of nt gable separate from and shallower than that of the house support pillars and smaller posts at the opening are of					

quarry-faced ashlar limestone. Porch side walls are brick with stone railing. Tripled windows flank centered door and have Craftsman-style 9-over-1 panes and stone sills.

34. History and Significance: A. Becker took out the 1929 building permit for this house, constructed by Donovan Constr. Co. The 26 x 45' house was to cost \$3,000. Becker does not appear at this address in city directories, and appar-

ently built it for speculation. The Donovan Constr. Co. does not appear in city directories as a contracting firm, nor are they listed in incorporated compan-

ies.



1.	No. 074	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes							
9.	Ownership:	8. On National Register or part of estab. district? No						
,	Private	10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:	ginal name:						
13.	Present name/owner's name:							
14.	Street address: 5956 Columbia 15. Style: Bungaloid							
16.	Date(s): 8/24/1926 - building permit							
17.	Architect: R. Terry 18. Builder: Milo M. Connole							
19.	Original Use:	residence 20. Present Use: residence						
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry						
24.	Foundation mate	rial: stuccoed 25. Roof type/material: front gable						
26.	No. Bays: Fron	t 3 Side 4 27. Wall treatment: red brick						
28.	Plan shape: see	site map 29. Changes: Addition? Altered?						
30.	Exterior condit	ion: good 31: Open to public? no						
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971						
rail	oorted by tapering ing and extends	tion of important features: Front gabled porch roof is g brick pillars. Porch has brick side walls with stone almost across the width of the house. Paired 3-over-1 dows and a single of the same type flank the centered front						

door. Side openings are flat-arched and have brick sills while stone sills are

present on the front elevation.

^{34.} History and Significance: The building permit for this house and its neighbor, 5960 Columbia (survey #75), were taken out by building contractor M. M. Connole, who was also listed as the owner. Connole resided at 2626 Sulphur in 1929. The two houses were to be 27 x 38' each, with hot air heat, and were to cost \$4,500 each. The Daily Record lists R. Terry as the architect; however, no one with that name fitting the description of architect/draftsman/



No. 072

City/County:

1.

2.

Location of Negatives: Missouri Office of Historic

Preservation, P. O. Box 176, Jefferson City, MO 65102

۷.	City/County: City of St. Louis, MO	City of St. 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn.						
5.	Date: 8/15/91	 Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files 						
7.	Building? yes	8. On National Register or part of estab. district? No						
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:	nal name:						
13.	Present name/ow	ner's name:						
14.	Street address:	5957 Columbia		15. Style:	Bungalow			
16.	Date(s): 8/30/	1927 - building pe	ermit					
17.	Architect: builder 18. Builder: Harry C. Vollmar							
19.	Original Use: residence 20. Present Use: residence							
21.	No. of stories:	1 1/2 22. Base	ment? y	es 23. Wall	construction: masonry			
24.	Foundation mate	rial: concrete	25.	Roof type/mat	erial: side gable			
26.	No. Bays: Fron	t 2 Side 1	27.	Wall treatmen	t: textured red brick			
28.	Plan shape: see	site map 29.	Chang	es: Addition?	Altered?			
30.	Exterior condit	ion: good	31:	Open to publ	ic? no			
32.	Other Surveys i	n which included:	Herit	age/St. Louis	survey, 1971			
has elev roof	rabled with expostriple 3-over-1 vation below. A for the full-wid	ed rafter ends and double-hung sash v roofline with wide	d sided windows e overh ed by s	with brick-lo , which are re anging eaves e traight brick	dormer of this house ok asphalt siding. It peated at the front xtends to become the pillars. The brick (cont'd. below)			
34.	History and Sig	nificance: toppe	d with	a header cours	e and square stones at			

This house and its neighbor, survey #71, were listed on the same 1927 permit taken out by local builder H. C. Vollmar. The 24 x 26' house cost \$3,000 and had hot air heat. Vollmar was very active locally during the 1920s and lived

the opening. Side openings are segmentally arched.

nearby at 6105 Simpson.



1.	No. 071	No. 071 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91				on: St. Louis Pub Soc.: Heritage/St	· ·		
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files						
9.	Ownership:	8. On Natio	onal Keg	ister ———	or part of estab.	district? No		
	Private	10. Visible	from pu	blic	road? Yes 11.	Endangered? No		
12.	Original name:							
13.	Present name/owner's name:							
14.	Street address: 5959 Columbia 15. Style: Bungalow							
16.	Date(s): 8/30/1927 - building permit							
17.	Architect: builder 18. Builder: Harry C. Vollmar					lmar		
19.	Original Use: residence 20. Present Use: residence							
21.	No. of stories:	1 1/2 22. Ba	asement?	yes	23. Wall constru	ection: masonry		
24.	Foundation mater	rial: concrete	e 25	S. Ro	oof type/material:	side gable		
26.	No. Bays: Fron	t 3 Side 1	27	'. Wa	all treatment: text	cured red brick		
28.	Plan shape: see	site map	29. Cha	inges:	Addition?	Altered?		
30.	Exterior condit	ion: fair/good	3	31: 0	Open to public? no)		
32.	Other Surveys in	n which include	ed: Her	itage	e/St. Louis survey,	1971		
Hous	ped gable and expose roof extends to	osed rafter end o form porch ro	ds; trip oof. Ta	ole 3- ipered	Dormer has brick over-1 double-hung brick pillars sup pair work; two cou	g sash windows		

34. History and Significance: Locally prolific builder Harry C. Vollmar took out a permit to build this house and its next-door neighbor, 5957 Columbia (#72) in August of 1927. The 24 x 26' houses were to cost \$3,000 apiece and to have hot air heat, all standard on Vollmar houses in the area. Vollmar was quite active in Clifton Heights, especially in the 1920s. He resided nearby at 6105 Simpson. Little else is known about him.

weave brickwork and a top header course are highlights. Centered doorway is flanked by paired 3-over-1 double-hung sash. Segmentally arched side windows.



1.	No. 075	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes		
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:	riginal name:	
13.	Present name/owner's name:		
14.	Street address: 5960 Columbia 15. Style: Bungaloid		
16.	Date(s): 8/24/1926 - building permit		
17.	Architect: R. Terry 18. Builder: Milo M. Connole		
19.	Original Use:	ginal Use: residence 20. Present Use: residence	
21.	No. of stories:	f stories: 1 22. Basement? yes 23. Wall construction: masonry	
24.	Foundation mate	rial: concrete 25. Roof type/material: front gable	
26.	No. Bays: Fron	Front 3 Side 3 27. Wall treatment: red/multichrome br	
28.	Plan shape: see	site map 29.	Changes: Addition? Altered?
30.	Exterior condition: good		31: Open to public? no
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		

with stone. Paired and single 3-over-1 double-hung sash windows with stone sills flank the front door. Side windows are flat-arched with brick sills.

^{34.} History and Significance: M. M. Connole, a building contractor, took out a building permit for this house and its neighbor, survey #74 next door. The permit allotted \$4,500 for each 27 x 38' house, both to have hot air heat. Connole was listed as both the owner and the builder; he lived at 2626 Sulphur by 1929, and is not listed as living in either house he built. R. Terry was the architect; a search of city directories fails to reveal anyone of that name who would qualify as an architect, builder, draftsman, etc.



Location of Negatives: Missouri Office of Historic

Preservation, P. O. Box 176, Jefferson City, MO 65102

3.

No. 070

1.

2.	City/County: City of St. Louis, MO		
		4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership: Private	8. On National Register or part of estab. district? No	
		10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address:	address: 5961 Columbia 15. Style: Bungalow	
16.	Date(s): 6/3/1927 - building permit		
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation material: concrete 25. Roof type/material: side gable		
26.	No. Bays: Front 2 Side 1 27. Wall treatment: textured red brick		
28.	Plan shape: see site map 29. Changes: Addition? rear Altered?		
30.	Exterior condition: good 31: Open to public? no		
32.	2. Other Surveys in which included: Heritage/St. Louis survey, 1971		
and fron Stra of p	has triple 3-over t elevation. Ove ight brick pillar orch are topped v	tion of important features: Large frame dormer is gabled r-1 double-hung sash windows, which also appear below in the erhanging roof extends to become roof of full-width porch. It is support roof at outside corners. Plain brick side walls with a header course and capped with limestone at the the right side. Segmentally arched (cont'd. below)	

^{34.} History and Significance: side windows. Rear frame addition. This house is the sixth of six listed on a single 1927 building permit taken out by H. C. Vollmar. For additional information, see Item 34 of survey #65.



1.	No. 076	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address:	Street address: 5964 Columbia 15. Style: Bungalow	
16.	Date(s): 10/8/1926 - building permit		
17.	Architect: Sidney Stokes, Jr. 18. Builder: Stokes Construction Co.		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable	
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: red/multichrome brk	
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes	
30.	Exterior condit	ion: good 31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
	coed; it has thr	tion of important features: Large front dormer has been ee, 3-over-1 double-hung sash windows also found on the e roof extends to become the full-width porch roof, sup-	

34. History and Significance: Meat cutter Otto Haenni commissioned the Stokes Constr. Co. to build this house in 1926. It cost \$5,000 for the 43 x 28' house. Furnace heat was listed on the permit. The architect was Sidney Stokes, Jr., the President-Treasurer of the Stokes Construction Co., located at 6117 Adeline Avenue. Loretta Stokes was listed as the Vice President-Treasurer.

ported by tapering brick pillars. The porch and front facade are laid in multichrome brick while the body of the house is plain red brick. On the north side,

a projecting bay window is also covered with rough-finish stucco.



1.	No. 069	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes		
9.	Ownership: Private	8. On National Register or part of estab. district? No	
		10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:	::	
13.	Present name/owner's name:		
14.	Street address: 5965 Columbia 15. Style: Bungalow		
16.	Date(s): 6/3/1927 - building permit		
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation material: concrete 25. Roof type/material: side gable		
26.	No. Bays: Front 3 Side 3 27. Wall treatment: textured red brick		
28.	Plan shape: see site map 29. Changes: Addition? Altered?		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
33. Further description of important features: Gable of large frame dormer is hipped; triple 3-over-1 double-hung sash windows centered in dormer. Roof has overhanging eaves and extends to become roof of full-width porch. Tapering brick pillars. Short brick porch walls have two courses of basketweave brick-			

work and a top row of headers; stones cap opening. Centered doorway flanked by

paired 3-over-1 double-hung sash windows. Segmentally arched side windows.

^{34.} History and Significance: This house is the fifth of six listed on a single building permit taken out in 1927 by builder H. C. Vollmar. See Item 34 of survey #65 for more information.



1.	No. 077	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	vner's name:	
14.	Street address:	5966 Columbia 15. Style: Bungaloid	
16.	Date(s): 2/3/1	Date(s): 2/3/1928 - building permit	
17.	Architect: bui	chitect: builder 18. Builder: Keithly Construction Co.	
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: masonr		
24.	Foundation mate	rial: stone 25. Roof type/material: side gable	
26.	. No. Bays: Front 3 Side 3 27. Wall treatment: textur		
28.	Plan shape: see site map 29. Changes: Addition? Altered?		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
	er almost qualif	tion of important features: Extremely large, frame front ies as a separate gable; it has exposed rafter ends and Paired, 6-over-1 double-hung sash windows have soldier	

arches. A full-width gabled porch is supported by straight brick pillars. One single and a set of triple 6-over-1 windows with brick sills flank the doorway.

Side openings have brick sills and double rowlock segmental arches.

^{34.} History and Significance: The 1928 building permit for this house is not entirely clear; James Keithly is listed as the owner, but the Daily Record says the Anna Inv. Co. was the owner of record. The Keithly Constr. Co. is listed in both as the builder and architect. The 28 x 25' house had furnace heat and the cost was shown as \$4,500. The Anna Inv. Co. is not listed in the 1929 city directory.



		·	
1.	No. 068	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership:	8. On National Regi	ster or part of estab. district? No
	Private	10. Visible from pub	lic road? Yes 11. Endangered? No
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address: 5967 Columbia 15. Style: Bungalow		
16.	Date(s): 6/3/1927 - building permit		
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation material: concrete		Roof type/material: side gable
26.	No. Bays: Front 2 Side 1 27.		Wall treatment: red brick
28.	Plan shape: see site map 29. Changes: Addition? Altered?		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
33.	Further description of important features: The gabled frame dormer of this		

peated on the lower front elevation. The roofline has wide overhangs and extends to cover the full-width porch. Straight brick pillars support the roof. The short brick side walls feature a course of basketweave brickwork and have stone caps at the opening. Side windows are segmentally arched. (cont'd. below)

house is vented and has triple 3-over-1 double-hung sash windows that are re-

^{34.} History and Significance: Steps and permastone planter in front of the porch are new.

H. C. Vollmar took out the 1927 permit that listed this and five other houses. For more information, see Item 34 of survey #65.



1.	No. 078	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address: 5970 Columbia 15. Style: Bungaloid		
16.	Date(s): 6/11/1928 - building permit		
17.	Architect: Vincil Hunter 18. Builder: Keithly Construction Co.		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: masonr		
24.	. Foundation material: stone 25. Roof type/material: side gal		
26.	No. Bays: Front 3 Side 3 27. Wall treatment: multichrome bric		
28.	Plan shape: see site map 29. Changes: Addition? Altered?		
30.	Exterior condit	ion: good 31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		

house is faced with brick and includes a soldier course above triple 6-over-1 double-hung sash windows. The roof has a wide overhang and rather steep pitch; the porch roof is attached to the house and acts as an extension of the main roof but has a shallower pitch. Stepped brick pillars with stone ornamentation support the porch roof. A center doorway is flanked by single, (cont'd. below)

^{34.} History and Significance: 8-over-1 double-hung sash windows with flat arches. Side windows are segmentally arched; some are stained glass. The Anna Inv. Co. is listed as the owner on the 1928 building permit. This company does not appear in city directories within this time frame. The Keithly Constr. Co., 4906 Southwest (also builders of survey #77) were the builders and Vincil F. Hunter, an architect with the Board of Public Service, designed it.



1.	No. 067	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	•	information: St. Louis Public Records,
7.	Building? yes		(istorical Soc.; Heritage/St. Louis files
9.	Ownership: Private		Register or part of estab. district? No om public road? Yes 11. Endangered? No
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address: 5971 Columbia 15. Style: Bungalow		
16.	Date(s): 6/3/1927 - building permit		
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	. Foundation material: concrete 25. Roof type/material: side gable		25. Roof type/material: side gable
26.	26. No. Bays: Front 2 Side 1 27. Wall treatment: red		27. Wall treatment: red brick
28.	Plan shape: see site map 29. Changes: Addition? rear Altered?		
30.	0. Exterior condition: good 31: Open to		31: Open to public? no
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		

house has exposed rafter ends and triple, 3-over-1 double-hung sash windows. The roofline extends to form the full-width porch roof, supported by straight brick pillars at the corners. Short solid brick side walls are capped with a header course and have stone insets at the steps. The doorway features Craftsman style panes. Triple windows on the front elevation (cont'd. below)

^{34.} History and Significance: are also 3-over-1 double-hung sash. Rear frame addition.

This house is the third in a series of six houses all listed on a single permit taken out by H. C. Vollmar in 1927. For additional information, see Item 34 of survey #65.



1.	No. 066	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes	8. On National Register or part of estab. district? No	
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address: 5973 Columbia 15. Style: Bungalow		
16.	Date(s): 6/3/1927 - building permit		
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: mason		
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable	
26.	No. Bays: Front 3 Side 2 27. Wall treatment: brown brick		
28.	Plan shape: see site map 29. Changes: Addition? rear Altered?		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971	
33.		tion of important features: The large frame dormer on this able, triple windows, and brick-look asphalt siding. The	

Side windows are segmentally arched. Rear frame addition.

roof of the house extends to form the porch roof; it has wide eaves. The porch features tapered brick pillars and short solid brick walls topped with a header course; short, stone-capped posts. Paired windows flank the center entrance.

^{34.} History and Significance: This house is the second of six listed on a single 1927 building permit taken out by H. C. Vollmar. See Item 34 of survey #65 for additional information.



1.	No. 079	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No	
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address: 5974 Columbia 15. Style: Bungalow		
16.	Date(s): 10/20/1924 - building permit		
17.	Architect: Fred A. Street 18. Builder: S. Stokes		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation material: concrete 25. Roof type/material: side gable		
26.	No. Bays: Fron	t 3 Side 4 27. Wall treatment: red brick	
28.	Plan shape: see	site map 29. Changes: Addition? Altered?	
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		

ported by tapering brick pillars. The brick side walls of the porch have been repointed in places and the steps are a new unit. Triple 1-over-1 windows are to the right of the sidelighted doorway and a small stained glass window is to

its left. Side windows have flat arches.

^{34.} History and Significance: Meat cutter J. Edward Haenni (presumably related to meat cutter Otto Haenni of 5964 Columbia, survey #76) had this house built for his residence. Fred A. Street is listed as the architect, but appears in city directories as "carpenter." S. Stokes, builder, became Stokes Constr. Co. by 1929. The 28 x 43' house cost \$4,000 to construct and featured furnace heat.



1.	No. 065	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes		
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address:	5977 Columbia 15. Style: Col.Revival/Craftsman	
16.	Date(s): 6/3/1927 - building permit		
17.	Architect: builder 18. Builder: Harry C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: masonr		
24.	Foundation material: concrete 25. Roof type/material: "gambrel"/t		
26.	No. Bays: Fron	t 3 Side 27. Wall treatment: textured red brick	
28.	Plan shape: see site map 29. Changes: Addition? Altered?		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
sect full	features a "moc ed with gambrel- -width dormers.	tion of important features: This house, like survey #36 and gambrel" roof: a standard two-story side gable is intershaped eaves. The effect is one of a gambrel roof with The roof features orange clay tile. The centered entrance ble frame hood supported by heavy wood brackets. Windows	

^{34.} History and Significance: flat-roofed room, apparently original, extends to the south; it has a new basketweave railing and second-floor access. Prolific local builder Harry C. Vollmar took out the permit for this house along with five others on a single permit in 1927 (survey #65 - 70). The 24 x 27' buildings were allotted a cost of \$3,500 apiece, and it was noted that they were to have hot air heat. Several Vollmars were in the St. Louis construction business in the 1920s & '30s; H. C. lived nearby at 6105 Simpson.

(cont'd. below)

are paired, 6-over-1 double-hung sash. A one-story,



1.	No. 080	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63103	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership:	8. On National Register or part of estab. district? No	
	Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address: 6004 Columbia 15. Style: Prairie School		
16.	Date(s): 10/1/1923 - building permit		
17.	Architect: E. Potter 18. Builder: Robert Dawson		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 2 1/2 22. Basement? yes 23. Wall construction: masonr		
24.	Foundation material: stone 25. Roof type/material: hipped/tile		
26.	No. Bays: Front 3 Side 4 27. Wall treatment: red brick		
28.	. Plan shape: see site map 29. Changes: Addition? Altere		
30.	Exterior condit	ion: good 31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		

- 33. Further description of important features: Red tile on the roof and porch and dormer roofs highlight this large house. A hipped-roof porch is supported by very large square brick pillars. Round bay projects on north side; rectilinear, room-size bay projects on south side. Brick sills, flat arches. Solid brick short porch walls are topped with a stone railing and end posts have stone caps. One-story rear addition/original feature (?). Large corner lot.
- 34. History and Significance: The building permit for this house was taken out by Edward O. Potter, a clerk with the Wabash Railway. The 42 x 32' house was to have hot water heat and cost \$10,000. The permit lists E. A. Potter as the architect, but no one with those initials listed in the city directories of the time appears qualified; perhaps it was a misprint and the owner designed it, or perhaps an out-of-town relative of his. Robert Dawson, a carpenter living at 6012 Columbia (survey #81 next door) built the house.



Location of Negatives: Missouri Office of Historic

3.

1. No. 207

	NO. 207	Preserva	ation, P.	O. Box 176, Jefferson City, MO 65103
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101		
5.	Date: 8/15/91	·		mation: St. Louis Public Records, cal Soc.; Heritage/St. Louis files
7.	Building? yes			
9.	Ownership:	8. On Natio	onal Regis	ter or part of estab. district? No
	Private	10. Visible	from publ	ic road? Yes 11. Endangered? No
12.	Original name:			
13.	Present name/ow	ner's name:		
14.	Street address:	6007 Columbia	a	15. Style: Classical Revival
16.	Date(s): c. 18	85 (Heritage/S	t. Louis)	
17.	Architect: unknown 18. Builder: unknown			
19.	Original Use: residence 20. Present Use: residence			
21.	No. of stories: 2 1/2 22. Basement? yes 23. Wall construction: masonry			
24.	Foundation material: stone 25. Roof type/material: side gable			Roof type/material: side gable
26.	No. Bays: Fron	t 4 Side 4	27.	Wall treatment: red brick/frame
28.	Plan shape: see	site map	29. Chang	ges: Addition? Altered? yes
30.	Exterior condition: good 31: Open to public? no			
32.	Other Surveys i	n which includ	ed: Herit	age/St. Louis survey, 1971
dows A ba	is located front and a heavy cor y window at the	and center on nice. A wide 2nd story is h	this larg cornice ov ighlighted	res: An elaborately ornamented dor- ge house; it has diamond-paned win- verhangs a fascia with carved swags. I by rounded modillions. Red sand- ls and decorative sill and lintel

^{34.} History and Significance: permanently missing, leaving the (replacement) door looking a little bare. It has a transom and a wood lintel/cornice. Heritage/St. Louis files state that Richard Eitman, president, Carondelet Avenue Furniture Mfg. Co., lived in this house at least 1887-93, with son Frederick (a clerk at the Post Office) continuing to live here at least through 1915. Their local source says that Eitman was both the original owner and the

(cont'd. below)

coursing on the front elevation. A porch roof is apparently



1.	No. 208	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 	
2.	City/County: City of St. Louis, MO		
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes		
9.	Ownership:	8. On National Register or part of estab. district? No	
	Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address:	6011-15 Columbia 15. Style: Classical Revival	
16.	Date(s): c. 1915		
17.	Architect: unknown 18. Builder: unknown		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: masonry		
24.	. Foundation material: stone 25. Roof type/material: flat		
26.	No. Bays: Fron	t 4 Side 4 27. Wall treatment: red brick	
28.	Plan shape: see site map 29. Changes: Addition? Altered?		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971	
held and jack	ly residence has the building's short brick wall arches; same ar	tion of important features: The flat roof of this multi- a short parapet; below, a raised rectangular area may have name originally. A brick-pillared porch has a railing above s below. Stone water table. Upper front windows have stone ches repeated below in brick; windows are paired 1-over-1. rowlock segmentally arched. Terra cotta coping & sills.	

^{34.} History and Significance: The inactive building permits (pre-1926) are unavailable for this city block.



1.	No. 081	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County:	rieservacion, r. O. Box 170, Serrerson City, Mo 03102	
	City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes		
9.	Ownership:	8. On National Register or part of estab. district? No	
	Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address: 6012 Columbia 15. Style: Bungaloid/Craftsman		
16.	Date(s): 3/20/1922 - building permit		
17.	Architect: builder 18. Builder: Robert L. Dawson		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 2 1/2 22. Basement? yes 23. Wall construction: mason		
24.	Foundation mate	rial: stone 25. Roof type/material: side gab./tile	
26.	No. Bays: Front 2 Side 3 27. Wall treatment: red brick		
28.	Plan shape: see site map 29. Changes: Addition? Altered?		
30.	Exterior condit	ion: good 31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		

^{33.} Further description of important features: The red clay tile roof of this house has wide overhanging eaves with large wood brackets. A dormer is located on the front elevation. Porch has hipped tile roof supported by tapering brick pillars at the outside corners. Porch has brick balusters with a stone railing. Doorway features sidelights and fanlight. Chimney is raised from the house wall and corbeled at the base.

^{34.} History and Significance: Robert L. Dawson, carpenter, took out the permit for this house, upon which his was the only name; we can only speculate that he both designed and built the house. He subsequently lived in and worked out of this house. The permit says only that the house cost \$6,000 and was to have hot water heat.



		ELECTORAL, RISTORIC INVENTORI SORVEI TORR	
r manamentinger forcers	No. 082	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address:	6016 Columbia 15. Style: Craftsman/Mission	
16.	Date(s): 2/3/1926 - building permit		
17.	Architect: builder 18. Builder: Harry C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation material: concrete 25. Roof type/material: flat		
26.	No. Bays: Fron	t 3 Side 6 27. Wall treatment: brown brick	
	Plan shape: see	site map 29. Changes: Addition? Altered?	
	Exterior condit	ion: good 31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
incl and a st	ures a shaped cu uding round blin water table cour ained glass wind	tion of important features: This small apartment building rvilinear brick parapet and brickwork detailing throughout, d arches infilled with basketweave patterning, soldier sill ses and a raised center door surround/pavilion incorporating ow above. Upper front windows have shaped soldier course ound. Side openings have double rowlock (cont'd. below)	

^{34.} History and Significance: segmental arches. Terra cotta inset crest below parapet. First story openings are french doors with non-functional "balconies." Local builder Harry C. Vollmar took out the permit to build a "tenement" for \$10,000 in 1926. The 36 x 56' building was to have hot water heat. Vollmar built extensively in Clifton Heights, usually single-family dwellings, and he lived at 6105 Simpson.



1.	No. 209	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files
7.	Building? yes	
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No
12.	Original name:	
13.	Present name/ow	ner's name:
14.	Street address:	6017 Columbia 15. Style: Classical Revival
16.	Date(s): 4/13/1909 - building permit (Heritage/St. Louis)	
17.	Architect: J. R. Gay 18. Builder:	
19.	Original Use: residence 20. Present Use: residence	
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry	
24.	Foundation material: concrete 25. Roof type/material: hipped	
26.	No. Bays: Front 3 Side 3 27. Wall treatment: red brick	
28.	Plan shape: see site map 29. Changes: Addition? Altered? yes	
30.	Exterior condition: good 31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971	
	house has hippe	tion of important features: The pyramidally hipped roof of d-roof dormers with triple 6-over-1 windows. A flat-roofed, rted by brick pillars with Corinthian capitals; the porch

has been infilled with windows. Paired windows on the front elevation are 9-over-1 and have stone lintels, as do front basement windows. Stone water table above egg & dart pressed brick course. Side windows double rowlock seg. arched.

^{34.} History and Significance: Owner J. N. Bonner, an employee of John E. Mitchell, had this house designed by architect J. R. Gay. The house cost \$3,400. This information is from Heritage/St. Louis, who had access to inactive building permits in the days before microfilming.



1.	No. 083	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 	
2.	City/County: City of St. Louis, MO		
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address: 6022 Columbia 15. Style: Bungalow		
16.	Date(s): 9/20/1923 - building permit		
17.	Architect: builder 18. Builder: Fred Hof		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation material: stone 25. Roof type/material: side gab./ti		
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: red brick	
28.	Plan shape: see site map 29. Changes: Addition? Altered?		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
	ver-1 double-hung	tion of important features: A frame shed dormer has triple sash windows. The red clay tile roof of the house extends th porch roof, supported by tapering limestone pillars. The	

Center doorway has transom; it is flanked by windows divided into multiple vert-

porch side walls are also of limestone, with a brick header course on top.

cal panes over a single pane; stone sills. Side openings are flat-arched.

^{34.} History and Significance: Mrs. Lena Groeschel, a widow who lived at 5829 Arsenal in 1923, hired carpenter/contractor Fred Hof to design and build this house. She subsequently lived here. Hof's residence/office was at 6614 Hoffman Avenue. The 25×32 ' house cost \$7,000 and was to have hot water heat.



1.	No. 084	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
9.	Ownership: Private	8. On National Register or part of estab. district? No			
		10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/owner's name:				
14.	Street address:	6024 Columbia 15. Style: Bungalow			
16.	Date(s): 2/10/1914 - building permit				
17.	Architect: builder or owner 18. Builder: Gunn & Cormack Co.				
19.	Original Use: residence 20. Present Use: residence				
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: brick/f				
24.	Foundation mate	rial: stone 25. Roof type/material: side gable			
26.	No. Bays: Front 3 Side 4 27. Wall treatment: red brick/cull ho				
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes			
30.	Exterior condition: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971			
stor	four 6-over-1 (y is frame while se. The rooflin four thin, square	tion of important features: A bracketed frame dormer feat- uneven spacing - see photo) double-hung windows. The upper the lower is brick with cull header bricks in every 7th e extends to become part of the full-width porch, supported wood pillars set atop the stone railing of the brick side doorway is flanked by single 3-over-1 (cont'd. below)			

^{34.} History and Significance: double-hung sash windows. A side bay window appears to be either new or altered from the original look.

Owner Charles W. Woodward, a foreman at Emerson Electric (moved out by 1923), hired woodworker Joseph Gunn and carpenter/contractor Donald M. Cormack of 6900 Wise to build this house for \$3,000 in 1914. The 25 x 28' house was to have furnace heat. The permit does not list a professional architect, but the permit



- No. 085 Location of Negatives: Missouri Office of Historic 1. 3. Preservation, P. O. Box 176, Jefferson City, MO 65102 City/County: 2. City of St. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO Louis, MO Sources of information: St. Louis Public Records. 5. Date: 8/15/91 City Hall; MO Historical Soc.; Heritage/St. Louis files Building? yes 8. On National Register or part of estab. district? No 9. Ownership: Visible from public road? Yes Endangered? No Private 10. 11. 12. Original name: Present name/owner's name: 13. 14. Street address: 6028 Columbia 15. Style: Craftsman 16. Date(s): 12/13/1923 - building permit 17. builder 18. Builder: Robert Hanna Architect: mulande Original Use: 20. Present Use: residence 19. No. of stories: 2 22. Basement? yes 23. Wall construction: masonry 21. Foundation material: 24. stone 25. Roof type/material: front gable* Side 5 26. No. Bays: Front 3 27. Wall treatment: red/multi brick 28. Plan shape: see site map 29. Changes: Addition? Altered? 30. Exterior condition: good 31: Open to public? 32. Other Surveys in which included: Heritage/St. Louis survey, 1971 *The front gable of this house Further description of important features: is hipped; the bracketed gable end features a stucco and wood infill. The tiled
- 34. History and Significance: first story, triple windows are flanked by two transomed doors with narrow, Craftsman-style paning. Side windows are mixed: some segmental arches, some flat.

The facade is laid in a multichrome brick while the body of the

Upper front windows are highlighted by square inset stones

The short porch walls are

(cont'd. below)

porch roof is supported by tapering stone pillars.

and sills; outer two windows are of stained glass.

also limestone.

house is red brick.

The permit for this house was taken out by realtor Robert Hanna, who is listed as the owner, builder and architect; he did not live in this house. The 27 \times 48' "tenement" house cost \$7,000 and had hot water heat.



1.	No. 086	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 		
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101		
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,		
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files		
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No		
12.	Original name:			
13.	Present name/ow	ent name/owner's name:		
14.	Street address:	6034 Columbia 15. Style: Craftsman		
16.	Date(s): 8/20/1925 - building permit			
17.	Architect: builder 18. Builder: M. R. Karhauk			
19.	Original Use: residence 20. Present Use: residence			
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: masonry			
24.	Foundation mate	rial: stone 25. Roof type/material: flat		
26.	No. Bays: Fron	t 3 Side 4 27. Wall treatment: textured red brick		
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered? yes		
30.	Exterior condition: good 31: Open to public? no			
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971		
roof the stor	ess the front of The gabled po latter of which he tops flank the	tion of important features: A gabled, bracketed cornice this flat-roofed house gives the impression of a gabled rch is supported by brick pillars and round wood columns, are probably not original. Short, stepped brick walls with steps and reflect the porch wall design. A large center y replaces paired originals; two doors (cont'd. below)		

Darker brick soldier arches return at the sides of the front windows. Side windows have double rowlock segmental arches.

The building permit for this "tenement" was taken out by M. R. Karhauk, who was listed as the owner, builder and architect. The name does not appear in city directories, so perhaps it was misspelled on the permit or he was not from St.

History and Significance: with Craftsman style paning flank the window.



1.	No. 087	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 		
2.	City/County: City of St. Louis, MO			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,		
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files		
9.	Ownership:	8. On National	Register	or part of estab. district? No
	Private	10. Visible fro	m public	road? Yes 11. Endangered? N
12.	Original name:			
13.	Present name/owner's name:			
14.	Street address:	Street address: 6038 Columbia 15. Style: Bungalow		
16.	Date(s): 8/29/1924 - building permit			
17.	7. Architect: builder 18. Builder: Harry C. Vo		lder: Harry C. Vollmar	
19.	Original Use: residence 20. Present Use: residence			
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: ma		23. Wall construction: masonr	
24.	Foundation material: stone		25. Ro	oof type/material: side gable
26.	No. Bays: Front 3 Side 2		27. Wa	all treatment: brown brick
28.	Plan shape: see	site map 29.	Changes:	: Addition? Altered?
10.	Exterior condition: good 31: Open to public? no			
2.	Other Surveys in which included: Heritage/St. Louis survey, 1971			
-				

^{3.} Further description of important features: The large frame dormer of this ouse has triple 3-over-1 double-hung sash windows. The roofline extends to orm the roof of the full-width porch, supported by stepped brick pillars. Very nort brick porch side walls are topped with a header course. The center, segnitally arched doorway is flanked by paired 3-over-1 double-hung sash windows. de openings are segmentally arched. Wide eave overhangs.

[.] History and Significance: The permit for this and two other houses (survey 8 and #89; 6100 & 6104 Columbia) were together on one, dated 1924, taken out Harry C. Vollmar, local builder. The 24 x 26' houses cost \$4,000 apiece and 1 furnace heat. Vollmar and his relatives were very active in building in . Louis; he lived at nearby 6105 Simpson (survey #174) and worked extensively



1.	No. 088	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
9.	Ownership: Private	8. On National Register or part of estab. district? No. 10. Visible from public road? Yes 11. Endangered? No.			
12.	Original name:	ginal name:			
13.	Present name/owner's name:				
14.	Street address: 6100 Columbia 15. Style: Bungalow				
16.	Date(s): 8/29/1924 - building permit				
17.	Architect: builder 18. Builder: H. C. Vollmar				
19.	Original Use: residence 20.		20. Pres	Present Use: residence	
21.	No. of stories:	1 1/2 22. B	asement? y	ves 23. Wall construction: masonry	
24.	Foundation material: concrete		e 25.	Roof type/material: side gable	
26.	No. Bays: Front 3 Side 3		27.	Wall treatment: textured brown brk	
28.	Plan shape: see site map 29. Changes: Addition? Altered??		res: Addition? Altered? ?		
30.	Exterior condition: good		31:	Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971				

house has three 3-over-1 double-hung sash windows. The roofline extends forward to become the roof of the full-width porch, supported by stepped pillars sheathed, along with the walls and foundation, with coursed stone resembling permastone; this may be an alteration. The segmentally-arched doorway is flanked by paired 3-over-1 double-hung sash. Side windows have segmental arches.

^{34.} History and Significance: This house and the two houses on either side are listed on a single permit taken out in 1924 by local builder Harry C. Vollmar. The houses cost \$4,000 apiece and had furnace heat. Vollmar worked in the Clifton Heights area primarily during the 1920s.



1.	No. 089	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 			
2.	City/County: City of St. Louis, MO				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
9.	Ownership: Private	8. On National Register or part of estab. district? No			
 		10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/owner's name:				
14.	Street address: 6104 Columbia 15. Style: Bungalow				
16.	Date(s): 8/29/1924 - building permit				
17.	Architect: builder 18. Builder: H. C. Vollmar				
19.	Original Use: residence 20. Present Use: residence				
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry				
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable			
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: red brick			
28.	Plan shape: see	site map 29. Changes: Addition? Altered?			
30.	Exterior condition: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971			
doub	ned shingles rema ble-hung sash win stepped brick pil	tion of important features: The original undulating-pat- in on this house. A large frame dormer has triple 3-over-1 dows. The roof extends to become the porch roof, supported lars. The brick side walls of the porch are topped with a caps its short pillars. A segmentally arched doorway is			

^{34.} History and Significance: rowlock segmental arches. This house is the third of three listed on a single permit taken out by H. C. Vollmar in 1924. The 24 x 26' houses cost \$4,000 each and had furnace heat. Vollmar was very active in building houses in the vicinity. He lived at 6105 Simpson.

(cont'd. below)

flanked by paired 3-over-1 windows. Side windows have double



1.	No. 090	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102		
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101		
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,		
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files		
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No		
12.	Original name:			
13.	Present name/ow	ner's name:		
14.	Street address:	6106 Columbia 15. Style: Bungalow		
16.	Date(s): 10/3/	1924 - building permit		
17.	Architect: bui	lder 18. Builder: Harry C. Vollmar		
19.	Original Use:	residence 20. Present Use: residence		
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable		
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: brown brick		
28.	Plan shape: see	site map 29. Changes: Addition? Altered?		
30.	Exterior condit	ion: good 31: Open to public? no		
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971		
beco the stor	eaves and three ome the porch roo roof. Brick sho	tion of important features: Frame dormer has wide overhang- 3-over-1 double-hung sash windows. The roofline extends to f, with exposed rafter ends. Stepped brick pillars support rt side walls of the porch have a top header course and t the opening. Centered, segmentally arched doorway is over-1 double-hung sash windows. Side (cont'd. below)		

^{34.} History and Significance: openings are segmentally arched. Local builder Harry C. Vollmar took out the permit for this and two neighboring houses (survey #91 & #92, 6110 & 6112 Columbia) on the same date in 1924. The 24 x 26' houses were to cost \$4,000 each and have furnace heat. H. C. was one of several members of the Vollmar family who worked as St. Louis contractors. He was very active in the Clifton Heights area, during the 1920s in particular, and he lived at 6105 Simpson.



4	N 001	OFFI F W		
1.	No. 091	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 		
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101		
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files		
7.	Building? yes	8. On National Register or part of estab. district? No		
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No		
12.	Original name:			
13.	Present name/ow	ner's name:		
14.	Street address: 6110 Columbia 15. Style: Bungalow			
16.	Date(s): 10/3/	1924 - building permit		
17.	Architect: bui	lder 18. Builder: H. C. Vollmar		
19.	Original Use:	residence 20. Present Use: residence		
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable		
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: brown brick		
28.	Plan shape: see	site map 29. Changes: Addition? Altered?		
30.	Exterior condit	ion: good 31: Open to public? no		
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971		
33. hous	Further descripse has exposed raends to become th	tion of important features: The gabled frame dormer of thi fter ends and triple 3-over-1 double-hung sash. The roof e porch roof, also with exposed rafter ends, supported by s. The short brick porch walls are topped with a header		

course and stone caps at the opening. A segmentally arched centered door features the original Craftsman storm door. It is flanked by (cont'd. below)

This house was on a single permit (along with survey #90 & #92, on either side) taken out in 1924 by builder H. C. Vollmar. Vollmar was quite prolific during the 1920s in this vicinity. The houses cost \$4,000 each and had furnace heat.

^{34.} History and Significance: paired 3-over-1 windows. Side windows are segmentally arched.



1.	No. 092	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
		8. On National Register or part of estab. district? No			
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/ow	ner's name:			
14.	Street address:	6112 Columbia 15. Style: Bungalow			
16.	Date(s): 10/3/	1924 - building permit			
17.	Architect: bui	ilder 18. Builder: H. C. Vollmar			
19.	Original Use:	residence 20. Present Use: residence			
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry			
24.	Foundation mate:	rial: concrete 25. Roof type/material: side gable			
26.	No. Bays: Fron	t 3 Side 2 27. Wall treatment: brown/multi brick			
28.	Plan shape: see	site map 29. Changes: Addition? Altered?			
30.	Exterior condit	ion: good 31: Open to public? no			
32.	Other Surveys in	n which included: Heritage/St. Louis survey, 1971			
low tend wall	house has triple in pairs flanking s to become the s have a top head	tion of important features: The frame, gabled dormer on a 3-over-1 double-hung sash windows, which appear again begin the segmentally arched door. The roof of the house exporch roof, supported by straight brick pillars. The porch der course and odd decorative rectangular stuccoed inserts survey #94, another Vollmar house. (cont'd. below)			

^{34.} History and Significance: A wooden door-type frame is inset at the porch entrance, its purpose unclear; it is too thin to be supportive and nothing is attached to it.

This house and the two houses to the east were listed on a single permit taken out by H. C. Vollmar in 1924. The 24 \times 26' houses were to have furnace heat and cost \$4,000 apiece. Vollmar was a local contractor who lived nearby at 6105



1.	No. 093	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 		
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101		
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,		
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files		
9.	Ownership:	8. On National Register or part of estab. district? No		
	Private	10. Visible from public road? Yes 11. Endangered? No		
12.	Original name:			
13.	Present name/owner's name:			
14.	Street address:	reet address: 6114 Columbia 15. Style: Bungalow		
16.	Date(s): 11/7/	1924 - building permit		
17.	Architect: bui	lder 18. Builder: Harry C. Vollmar		
19.	Original Use:	residence 20. Present Use: residence		
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable		
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: cinder block?		
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes		
30.	Exterior condit	ion: good 31: Open to public? no		
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971		
rang whet	oosed of rectanguing in color from	tion of important features: The walls of this house are lar masonry units more nearly square than regular bricks, med to rose/pink. Surveyor was unable to ascertain ick or cinder block. Gabled frame dormer has been covered batten siding. All front elevation windows are 3-over-1		

^{34.} History and Significance: supported by stepped pillars. Centered door is segmentally arched, as are side openings.

double-hung sash. House roof extends to become porch roof, (cont'd. below)

The permit for this house was listed along with survey #94 and #95 to the west on a single permit taken out by local builder H. C. Vollmar. The 24 x 26' houses were to cost \$4,000 apiece and have furnace heat. The other two houses on the permit are built of regular brick and there is no indication on the permit that any other material would be used



1.	No. 094	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102		
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101		
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,		
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files		
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No		
12.	Original name:			
13.	Present name/ow	ner's name:		
14.	Street address:	6116 Columbia 15. Style: Bungalow		
16.	Date(s): 11/7/	1924 - building permit		
17.	Architect: bui	lder 18. Builder: H. C. Vollmar		
19.	Original Use:	residence 20. Present Use: residence		
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable		
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: brown brick		
28.	Plan shape: see	site map 29. Changes: Addition? Altered?		
30.	Exterior condit	ion: good 31: Open to public? no		
32.	Other Surveys is	n which included: Heritage/St. Louis survey, 1971		
come add	se has three 3-ove the porch roof, support). The b	tion of important features: The gabled frame dormer on this er-1 double-hung sash windows. The roofline extends to be- supported by straight brick pillars (two wrought-iron posts rick porch is highlighted by painted rectangular stucco in- e of survey #92, also a Vollmar house. The centered doorway		

^{34.} History and Significance: sash windows. Side openings are segmentally arched. Replacement concrete steps.

This house is the second of three listed on a single permit taken out in 1924 by Harry C. Vollmar, a busy local builder. The houses were to cost \$4,000 each and have furnace heat; their size was listed as 24 x 26' each. Vollmar built many Clifton Heights houses during the 1920s; he lived at 6105 Simpson (survey

is segmentally arched and flanked by paired 3-over-1 double-hung (cont'd. below)



1.	No. 095	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 			
2.	City/County: City of St. Louis, MO				
5.	Date: 8/15/91	‡	•		
7.	Building? yes	City Hall; MO	Historical Soc.; Heritage/St. Louis files		
9.	Ownership:	8. On Nationa	al Register or part of estab. district? No		
	Private	10. Visible from public road? Yes 11. Endangered? N			
12.	Original name:				
13.	Present name/ow	ner's name:			
14.	Street address:	6120 Columbia	15. Style: Bungalow		
16.	Date(s): 11/7/	1924 - building	permit		
17.	Architect: bui	lder	18. Builder: H. C. Vollmar		
19.	Original Use:	residence 20	0. Present Use: residence		
21.	No. of stories:	1 1/2 22. Base	ement? yes 23. Wall construction: masonry		
24.	Foundation mate	rial: concrete	25. Roof type/material: side gable		
26.	No. Bays: Fron	t 3 Side 3	27. Wall treatment: red brick		
28.	Plan shape: see	site map 29	. Changes: Addition? Altered? yes		
30.	Exterior condition: good/fair 31: Open to public? no				
32.	Other Surveys i	n which included	: Heritage/St. Louis survey, 1971		
hung	se is covered wit sash windows ar	e repeated below	t features: The gabled frame dormer of this halt siding. Its triple 3-over-1 double- in pairs flanking the segmentally arched eaves and extends to form the roof of the		

full-width porch, supported by stepped brick pillars. The brick short porch walls are topped with a header course and stone caps at the (cont'd. below)

^{34.} History and Significance: opening. Double-rowlock segmentally arched side windows. Some rebuilding of the porch is in evidence.

Harry C. Vollmar took out the permit for survey #93-4-5 in 1924, listing a cost for each 24 x 26' house as \$4,000. They were to have furnace heat. Vollmar was a prolific local builder who had other St. Louis relatives in the contracting business. He was primarily active in Clifton Heights during the 1920s.



1.	No. 096	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/owner's name:				
14.	Street address:	s: 6124 Columbia 15. Style: Craftsman/Mission			
16.	Date(s): 10/14/1925 - building permit				
17.	Architect: bui	lder 18. Builder: Harry C. Vollmar			
19.	Original Use:	residence 20. Present Use: residence			
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonry			
24.	Foundation mate	rial: concrete 25. Roof type/material: flat			
26.	No. Bays: Fron	t 3 Side 6 27. Wall treatment: brown/multi brick			
28.	Plan shape: see site map 29. Changes: Addition? Altered? yes				
30.	Exterior condit	ion: good 31: Open to public? no			
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971			
33.	Further descrip	tion of important features: This apartment building is			

34. History and Significance: second story front windows. A terra cotta crest is inset below the parapet. Repair work is in evidence below the crest, and the original window below has been infilled with glass brick. Non-functional "balconies" at first story. Side openings are double-rowlock segmental arches. H. C. Vollmar took out the permit for this "tenement" in 1925 for \$10,000. The 36 x 56' building was to have hot water heat. Vollmar's Clifton Heights work

very similar to survey #82, 6016 Columbia, built a year later by Vollmar.

including round blind arches filled with herringbone brickwork above paired french doors, a raised center entrance pavilion, a soldier course water table

and the shaped, wrap-around soldier course lintels of the

was primarily single-family dwellings.

features a curvilinear brick parapet and rather elaborate brickwork throughout,

(cont'd. below)



1.	No. 210		 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101							
5.	Date: 8/15/91	1	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes	<u> </u>		 					
9.	Ownership: Private	8. On Nat				or part of road? Yes		Endangered	
12.	Original name:								
13.	Present name/ow	ner's name:							
14.	Street address:	6127 Columb	ia		15	5. Style:	Classi	cal Reviva	11
16.	Date(s): c. 19	10		· -				7	
17.	Architect: unk	nown 18. Builder: unknown							
19.	Original Use: r	esidence	20.	Preser	at l	Use: resid	ence		<u> </u>
21.	No. of stories:	2 22. 1	Baseme	ent? ye	es	23. Wall	constru	ction: mas	sonry
24.	Foundation mate	rial: stone	100000000000000000000000000000000000000	25.	Roc	of type/mate	erial:	hipped	
26.	No. Bays: Fron	t 2 Side 2	7	27.	Wa]	ll treatmen	t: buff	& red bri	ick
28.	Plan shape: see	site map	29.	Change	∋s:	Addition?	· · · · · · · · · · · · · · · · · · ·	Altered?	
30.	Exterior condit	ion: good		31:	Oř	pen to publ	ic? no		
32.	Other Surveys is	n which include	led:	Herita	ige/	/St. Louis	survey,	1971	
	Further descripte is buff/brown that arches	brick while th	he bod	ly of t	the	house is re	ed bric	k. Front	win-

roof, supported by thin square posts; its cornice is dentilled and the balustrade is of turned spindles (replacements?). Transomed door has paneling at sides. Stone sills. Hipped-roof dormer. Almost identical to survey #211.

^{34.} History and Significance: Inactive building permits for this city block not found.



1.	No. 097	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 		
2.	City/County: City of St. Louis, MO			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,		
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files		
9.	Ownership:	8. On National Register or part of estab. district? No		
	Private	10. Visible from public road? Yes 11. Endangered? No		
12.	Original name:			
13.	Present name/ow	ner's name:		
14.	Street address:	6128 Columbia 15. Style: Prairie		
16.	Date(s): 6/25/	1906 - building permit		
17.	Architect: Ross C. H. Hallock 18. Builder: George Busen & Son			
19.	Original Use: residence 20. Present Use: residence			
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation mate	rial: stone 25. Roof type/material: hipped		
26.	No. Bays: Front 3 Side 2 27. Wall treatment: red brick			
28.	Plan shape: see	site map 29. Changes: Addition? Altered?		
30.	Exterior condition: good 31: Open to public? no			
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971			

- 33. Further description of important features: The roof of this house has an extra-wide overhang across the front, returning at the sides. A hipped-roof dormer dominates above. The nearly full-width porch has 3 round wood columns and a plain wood balustrade. Windows are all 1-over-1 double-hung sash, including those of the second-story bay window above the porch. Side windows have double-rowlock segmental arches. Stone foundation is stuccoed. Transomed door.
- 34. History and Significance: J. B. Buss hired architect Ross C. H. Hallock to design this house in 1906. Buss is possibly John B. Buss, president of Reliance Pneumatic Tool Co., although he is not listed as having lived here. Hallock lived at 6317 Clifton Ave. and worked at 2715 Clifton. He is listed as an architect, although nothing more could be found on him. George Busen & Son were contractors located at 6934 Eyler Avenue. The permit lists the house at



1.	No. 211	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	1	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files			
7.	Building? yes					
9.	Ownership: Private		nal Register or part of estab. district? No from public road? Yes 11. Endangered? No			
12.	Original name:					
13.	Present name/ow	ner's name:				
14.	Street address:	6131 Columbia	15. Style: Classical Revival			
16.	Date(s): c. 19	10				
17.	Architect: unk	nown	18. Builder: unknown			
19.	Original Use: r	esidence 20	Present Use: residence			
21.	No. of stories:	2 22. Bas	sement? yes 23. Wall construction: masonry			
24.	Foundation mate	rial: stone	25. Roof type/material: hipped			
26.	No. Bays: Fron	t 2 Side 2	27. Wall treatment: red brick			
28.	Plan shape: see	site map 29	9. Changes: Addition? Altered? yes			
30.	Exterior condit	ion: good	31: Open to public? no			
32.	Other Surveys is	n which included	d: Heritage/St. Louis survey, 1971			
shed Fron	house has a hip roof supported	ped-roof dormer by round Doric o nd carving, tran	nt features: The pyramidally hipped roof of . Windows are all replacements. Porch has columns; wood balustrade; dentilled cornice. asom, sidelight at right. Facade is laid			

with red mortar, sides with regular mortar. Very similar in overall design to

house next door, survey #210.

^{34.} History and Significance: No inactive building permits found for this city block.



1.	No. 098	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	_		
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis file			
9.	Ownership: Private	8. On National Register or part of estab. district? 10. Visible from public road? Yes 11. Endangered?	No No		
12.	Original name:				
13.	Present name/ow	ner's name:			
14.	Street address:	6132 Columbia 15. Style: Craftsman			
16.	Date(s): 4/8/1	925 - building permit			
17.	Architect: bui	lder 18. Builder: Fred A. Anderson			
19.	Original Use:	residence 20. Present Use: residence			
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: mason	ry		
24.	Foundation mate	rial: stone 25. Roof type/material: hipped/tile			
26.	No. Bays: Fron	t 3 Side 5 27. Wall treatment: textured red bri	ck		
28.	Plan shape: see	site map 29. Changes: Addition? Altered?			
30.	Exterior condit	ion: good 31: Open to public? no			
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971			
ped etec pill	red clay tile rook porch roof has lars. The body onde are textured.	tion of important features: This house has a shallowly hof with exposed rafters and wood brackets. A heavy, brackexposed rafters and is supported by large, tapered brick the building is regular red brick while the porch and Front elevation windows are 6-over-1; those at the second intell course that were around and the second intellection with the second intellect	k-		

^{34.} History and Significance: extends across the front, bisected by inset terra cotta lozenges. Two multipane doors flank the triple center windows. Side openings have double-rowlock segmental arches. Carpenter Fred A. Anderson is listed as the owner, architect and builder of this

story have a soldier lintel course that wraps around and

"tenement." The 20 x 46' building was to have hot air heat and cost \$6,000.

Anderson lived at 5420 Nottingham and presumably built it as a rental property.

(cont'd. below)



1.	No. 099	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Ecx 176, Jefferson City, MO 65102		
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101		
5.	Date: 8/15/91	*	information: St. Louis Public Records, Historical Soc.: Heritage/St. Louis files	
7.	Building? yes			
9.	Ownership: Private		Register or part of estab. district? No om public road? Yes 11. Endangered? No	
12.	Original name:	<u></u>		
13.	Present name/owner's name:			
14.	Street address:	6136 Columbia	15. Style: Bungalow	
16.	Date(s): 6/19/	1923 - building p	ermit	
17.	Architect: bui	lder	18. Builder: Street & Pope	
19.	Original Use:	residence 20	. Present Use: residence	
21.	No. of stories:	1 1/2 22. Base	ment? yes 23. Wall construction: masonry	
24.	Foundation mate	rial: stone	25. Roof type/material: side gable	
26.	No. Bays: Fron	t 2 Side 3	27. Wall treatment: red brick	
28.	Plan shape: see	site map 29.	Changes: Addition? Altered?	
30.	Exterior condit	ion: good	31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971			
roof	triple 1-over-1 of the house ex	windows and is co tends to become t	features: The gabled dormer of this house vered with brick-look asphalt siding. The he roof of the full-width porch, supported short side walls of the porch have a	

(cont'd. below)

course of basketweave patterning near the bottom and are topped with a stone

Triple windows are 1-over-1, presumably replacements.

rail.

^{34.} History and Significance: Side openings have flat arches. Edward F. Wenneker, a salesman with the A. R. Schollmmeyer Real Estate Co., took out the permit for this house and the one next door (survey #100) in 1923. He lived at 6221 Simpson. Frederick Street was a carpenter living at 6040 Arthur; no builder/contractor/architect named Pope is listed in directories, and although several are named as carpenters, none are shown as associates of Street. The two 24 x 26' houses cost \$4,000 apiece and had furnace heat



1.	No. 212	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,				
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files				
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:	inal name:				
13.	Present name/owner's name:					
14.	Street address:	6137 Columbia	15. Style: Queen Anne			
16.	Date(s): c. 1900					
17.	Architect: unk	nown	18. Builder: unknown			
19.	Original Use: r	esidence 20	Present Use: residence			
21.	No. of stories:	2 22. Bas	ent? yes 23. Wall construction: masonry			
24.	Foundation mate	cial: stone	25. Roof type/material: complex			
26.	No. Bays: Fron	t 3 Side 3	27. Wall treatment: red brick			
28.	Plan shape: see	site map 2	Changes: Addition? Altered?			
30.	Exterior condit	ion: good	31: Open to public? no			
32.	Other Surveys is	which included	l: Heritage/St. Louis survey, 1971			
	house features	undulating-patt	at features: The hipped and gabled roof of erned shingles. A corner porch has a den- clumns and spindle balustrade; it is sur-			

molding above: segmental arch at 2nd story, round arch below. (cont'd. below)

mounted by a polygonal, flat-roofed "tower," covered with patterned shingles.

Front facade windows have gauged-brick hoods with pressed-brick dogtooth

^{34.} History and Significance: Band of notched checkerboard brickwork at 2nd story sill. Side windows have double rowlock segmental soldier arches; all windows are 1-over-1 with stone sills. Round-arched dormers at attic. House is quite similar to its neighbor, survey #213; no building permit was found.



1.	No. 100	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
2.	City/County: City of St. Louis, MO				
5.		6. Sources of information: St. Louis Public Records,			
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
9.	Ownership:	8. On National Register or part of estab. district? No			
12.	Private Original name:	10. Visible from public road? Yes 11. Endangered? No			
13.	Present name/owner's name:				
14.	Street address: 6140 Columbia 15. Style: Bungalow				
16.	Date(s): 6/19/1923 - building permit				
17.	Architect: bui	lder 18. Builder: Street & Pope			
19.	Original Use:	residence 20. Present Use: residence			
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry			
24.	Foundation mate	rial: obscured 25. Roof type/material: side gable			
26.	No. Bays: Fron	t 9 Side 3 27. Wall treatment: red brick			
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes			
30.	Exterior condition: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971			
	se is covered wit ble-hung sash win	tion of important features: The gabled frame dormer of this h undulating-patterned shingles; it has three 1-over-1 dows. The roof of the house extends to cover the full-width y have originally been open; it now has 8,8-paned windows			

across the front elevation and a multipaned door with sidelights. Side windows

are segmentally arched.

^{34.} History and Significance: This house and survey #99 to its east were on a single permit taken out by Edward F. Wenneker, a salesman with the A. R. Schollmeyer Real Estate Co. who lived at 6221 Simpson. The 24 x 26' houses were to cost \$4,000 apiece. Frederick Street was a carpenter who lived at 6040 Arthur. Who Pope was is a mystery; several are listed as carpenters and any one could have been Street's partner.



1.	No. 213	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,				
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files				
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address:	6141 Columbia 15. Style: Queen Anne				
16.	Date(s): c. 19	Date(s): c. 1900				
17.	Architect: unk	ect: unknown 18. Builder: unknown				
19.	Original Use: r	esidence 20. Present Use: residence				
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonr				
24.	Foundation mate	rial: stone 25. Roof type/material: complex				
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: brown brick				
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971				
	lso gabled. A c	tion of important features: The hipped roof of this house orner porch has spindle posts, a rectilinear fretwork cor- strade. Above, a flat-roofed polygonal "tower" is covered				

34. History and Significance: A stringcourse of buff brick is inset at the second-story sill line on the front elevation; the neighboring similar house (survey #212) has a notched band of brickwork there, and it is possible that this solid course replaces that type of design in this house. Side windows have double-rowlock segmental soldier arches; all have stone sills. A planter of (ceramic?) tile has been built in front of the porch. No building permit found

with clapboarding. Front elevation windows have gauged-brick arches with pressed-brick dogtooth molding above: segmental arch at 2nd story, round arch at

(cont'd. below)

1st. The latter has a semicircular divided fanlight.



1.	No. 214	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,				
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files				
9.	Ownership:	8. On National Register or part of estab. district? No				
	Private	10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address: 6147 Columbia 15. Style: Queen Anne					
16.	Date(s): c. 1905					
17.	Architect: unk	nown 18. Builder: unknown				
19.	Original Use: r	esidence 20. Present Use: residence				
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonry				
24.	Foundation mate	rial: stone 25. Roof type/material: complex				
26.	No. Bays: Fron	t 2 Side 2 27. Wall treatment: brown brick				
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971					
22	Front de la comina	tion of important fortunation my C of this is a second				

^{33.} Further description of important features: The roof of this house is both hipped and gabled, featuring a high-set gabled dormer. Side and upper windows are segmentally arched. A shed-roof porch has a small gable; turned spindles support it; sides are new latticework. House has been divided into multifamily, as evidenced by the two doors (see survey #215 for probable original configuration).

^{34.} History and Significance: This house and the one next door at 6151 Columbia are very similar, and were probably done by the same builder at the same time; no building permits found, but Heritage/St. Louis files show that A. L. Nicholson, secretary at Merry & Nicholson Printing Co., lived here in 1907.



1.	No. 101	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
9.	Ownership: Private	8. On National Register or part of estab. district? No			
		10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/ow	Present name/owner's name:			
14.	Street address:	6148-50 Columbia 15. Style: Craftsman			
16.	Date(s): 7/2/1928 -building permit				
17.	Architect: Car	rchitect: Carl E. Etz 18. Builder: Progress Building & Inv. C			
19.	Original Use:	Use: residence 20. Present Use: residence			
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonry			
24.	Foundation mate	rial: stone 25. Roof type/material: flat			
26.	No. Bays: Fron	t 15 Side 6 27. Wall treatment: buff brick			
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes			
30.	Exterior condit	ion: good 31: Open to public? no			
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971			
dow thre	es extensive use sills; the four ee of the parapet the building defi	tion of important features: This apartment building fea- of white terra cotta trim. It appears as coping and on win- curvilinear shaped parapets have terra cotta finials. Below s, round terra cotta arches and quoining running the height ne the entrance pavilions. Second-story windows in these ta lintels with keystones; above, fanciful (cont'd. below)			

^{34.} History and Significance: crests highlight the parapets. The Clifton side of the building (photo, right) has been infilled at the first story. The permit specifies "tenements and stores;" it is evident that the commercial portion has been given over to apartment space.

The permit was taken out by the Progress Building & Investment Co., of whom Arthur Fischman of 4054 Grand was the president. Architect Carl E. Etz was hired to design the \$15,000 building; nothing is known about him.



1.	No. 215	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 						
2.	City/County: City of St. Louis, MO							
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,						
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:							
13.	Present name/owner's name:							
14.	Street address: 6151 Columbia 15. Style: Queen Anne			5. Style: Queen Anne				
16.	Date(s): c. 1905							
17.	Architect: unknown			18. Builder: unknown				
19.	Original Use: r	Original Use: residence 20.			Present Use: residence			
21.	No. of stories:	2 22.	Basen	ment? ye	s	23. Wall construction: masonry		
24.	Foundation material: stone 25. Roof type/material: complex			of type/material: complex				
26.	No. Bays: Front 3 Side 2			27. Wall treatment: red brick				
28.	Plan shape: see	site map	29.	Change	s:	Addition? rear Altered? yes		
30.	Exterior condition: good			31:	31: Open to public? no			
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971							
to 1	se is very simila limit ornamentati	r to the hous on to the pro	e nex jecti	kt door ing gabl	(su ed	This hipped-and-gabled-roof urvey #214). The builder chose bay at left; it features sill -faced dark red brick (seems too		

close to standard brick size to be red stone). The gable and 2nd-story windows

(cont'd. below)

have segmental soldier arches and the 1st-story window

^{34.} History and Significance: is round-arched with a divided semicircular fanlight. Windows are 1-over-1 and all have stone sills. Side windows segmentally arched. Shed-roofed porch is supported by iron posts; base is concrete block; the whole porch appears to be an alteration.



1.	No. 216 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102								
2.	City/County: City of St. Louis, MO	4. Prepare	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	1	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes		······································						
9.	Ownership: Private		8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No						
12.	Original name: The Higginbotham Flats								
13.	Present name/owner's name:								
14.	Street address: 6155-57 Columbia; 6159-65 Clifton 5. Style: Class. Rev.								
16.	Date(s): 7/26/	1906 - buildin	ıg pe	rmit (Her:	itage/St. Louis)				
17.	Architect: W.	T. Clymer		18. Buile	der:				
19.	Original Use: r	esidence	20.	Present 1	Use: residence				
21.	No. of stories:	2 22. E	asem	ent? yes	23. Wall const	ruction: masonry			
24.	Foundation mate	rial: stone		25. Ro	of type/material	: flat*/slate			
26.	No. Bays: Fron	t 11 Side 4		27. Wall treatment: red brick					
28.	Plan shape: see	site map	29.	Changes:	Addition?	Altered?			
30.	Exterior condit	ion: good		31: O	pen to public?	no			
32.	Other Surveys i	n which includ	led:	Heritage	/St. Louis surve	y, 1971			

- 33. Further description of important features: This is a group of three attached multifamily flats all built at the same time in the same style. *The flat roofs have hipped, slate false fronts somewhat in the Second Empire style; they have round-arched multipane dormers; some finials remain. Lower story front windows have terra cotta jack arches; those above have flat arches; terra cotta sills. Facade line varies; some project more than others. (cont'd. below)
 - 4. History and Significance: Small porches supported by single or paired urned wood Doric columns; porches alternate gabled and flat roofs. Above, those ith flat roofs have bay windows with slate bases. Dentilled wood cornice. eritage/St. Louis was able to locate a building permit for this complex: J. H. igginbotham (res. 6158 Simpson), owner, hired local architect/builder W. T. lymer to build these flats for \$15,000 in 1906. Higginbotham was a local big-





1.	No. 102 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102							
2.	City/County: City of St. Louis, MO	City of St. Preservation, P. U. Box 1/6, Jefferson City, MU 65102 City of St. 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn.						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,						
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files						
9.	Ownership: Private							
12.	Original name:							
13.	Present name/owner's name: Clifton Point Building							
14.	Street address: 6200-02 Columbia 15. Style: commercial/Romanesque							
16.	Date(s): 9/4/1	903; 3/22/1906; 8/27/1907 - building permits						
17.	Architect: R.H.	allock; W.A. Cann 18. Builder: W. T. Clymer						
19.	Original Use: c	ommer./resid. 20. Present Use: commercial						
21.	No. of stories:	2 & 3 22. Basement? yes 23. Wall construction: masonry						
24.	Foundation mate	rial: stone 25. Roof type/material: flat						
26.	No. Bays: Fron	t 7 Side 16 27. Wall treatment: painted brick						
28.	Plan shape: see	site map 29. Changes: Addition? yes Altered? yes						
30.	Exterior condit	ion: good 31: Open to public? yes; limited						
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971						
33.	Further descrip	tion of important features: The 3-story corner section of						

1903 with a 3-story "stores, hall & flats" for \$12,000 built by Ross C. Hallock

this building has an angled entrance with a pressed brick round arch. Columnar pressed brick is inset at the corners to make the transition to flat brick. Meal cornices are located above the first and third stories. Third-story windows

are round-arched and connected by raised string courses and a stone sill course. Second-story windows are flat-arched. At the ground floor, (cont'd. below)

34. History and Significance: display windows have tile bases with inset checkerboard designs. Entrances to upper floors are paired with round pressed-brick arches. Small bracketed gable set at third story roofline facing Columbia. Cornerstone dated Oct. 3, 1903: Clifton Heights Lodge; no architect. This building was built in several stages, according to the permits, beginning in





1.	No. 121	No. 121 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102							
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101							
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records City Hall; MO Historical Soc.; Heritage/St. Louis fi							
7.	Building? yes								
9.	Ownership:	8. On National Register or part of estab. district?	No						
	Private	10. Visible from public road? Yes 11. Endangered	? No						
12.	Original name: Clifton Heights Presbyterian Church								
13.	Present name/owner's name: same								
14.	Street address:	6201 Columbia 15. Style: Gothic Revival	15. Style: Gothic Revival						
16.	Date(s): c. 18)1							
17.	Architect: R.	7. Dawson 18. Builder:							
19.	Original Use: c	nurch 20. Present Use: church							
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: fra	me						
24.	Foundation mate	rial: stone 25. Roof type/material: gabled							
26.	No. Bays: Fron	Side 27. Wall treatment: asbestos sidin	g						
28.	Plan shape: see	site map 29. Changes: Addition? yes Altered?							
30.	Exterior condition: good 31: Open to public? yes								
32.	Other Surveys i	which included: Heritage/St. Louis survey, 1971							
-	s window on the	tion of important features: A large, round-arched stail columbia Ave. (front) elevation is divided into multiple is flanked by two smaller round-arched stained glass	e						

has a concrete foundation.

dows. Gables have smaller round-arched windows. Entryway has a hipped roof and projects from the building; a bracketed hood shelters the door. A rear addition

^{34.} History and Significance: No building permits are available prior to c. 1950 for this city block. Information from Heritage/St. Louis indicates that interested people gathered in 1891 to found the Clifton Heights Presbyterian Church, and that local informants say that local builder/architect R. T. Dawson lesigned the church.



1.	No. 103	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No					
9.	-						
12.	Original name:						
13.	Present name/owner's name: Aalco Construction						
14.	Street address: 6206 Columbia 15. Style: commercial						
16.	Date(s): 8/12/1904 - building permit						
17.	Architect: builder 18. Builder: Trade Realty & Bldg. Co.						
19.	Original Use: c	ommer./resid. 20. Present Use: commercial/residence above					
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: concrete 25. Roof type/material: flat					
26.	No. Bays: Fron	t 2 Side 1 27. Wall treatment: red brick					
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes					
30.	Exterior condition: good 31: Open to public? yes; limited						
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971						

- cotta coping and features very small parapets. Two raised string courses above the second-story windows on the front elevation provide ornamentation to the otherwise plain facade. Header arches above 1-over-1 windows with stone sills. The ground floor front elevation has been altered from the original, now incorporating a wood-shake shed roof and vertical wood paneling.
- 34. History and Significance: The Trade Realty & Building Co. took out permits for this and the building (now razed) at 6208 Columbia at one time. They were to cost \$2,000 each and the dimensions were 22 x 33' each. F. J. Carwell is listed on the permit as the builder; he must have been the person from Trade R. & B. who was in charge of the projects.



1.	No. 110	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.								
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes	8. On National Register or part of estab. district? No						
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:	Original name:						
13.	Present name/ow	Present name/owner's name: presently for sale						
14.	Street address: 6210 Columbia 15. Style: Craftsman							
16.	Date(s): 8/21/	Date(s): 8/21/1929 - building permit						
17.	Architect: bui	lder 18. Builder: W. Donald						
19.	Original Use: r	esidence 20. Present Use: residence						
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: masonry							
24.	Foundation mate	rial: obscured 25. Roof type/material: front gable						
26.	No. Bays: Front 2 Side 2 27. Wall treatment: red & brown brick							
28.	Plan shape: see site map 29. Changes: Addition? Altered?							
30.	Exterior condit	ion: good 31: Open to public? no						
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971						
33.		tion of important features: A frame dormer with shed roof nds appears on either side of the gabled roof. The gabled						

ends of the house are frame. A gabled porch is supported by straight brick

pillars. The short porch walls are brick topped with a header course.

^{4.} History and Significance: W. Donald took out the permit to build this ouse in 1929 for \$3,500. He is shown as both the owner and the builder of he 24 x 28' house. There are several possible Donalds in the city directory; Donald also took out the permit for survey #109, two doors east on Columbia.

1.	No. 120	3. Mocation of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 6211 Columbia 15. Style: Queen Anne						
16.	Date(s): c. 19	05					
17.	Architect: unk	nown 18. Builder: unknown					
19.	Original Use: r	esidence 20. Present Use: residence					
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: stone 25. Roof type/material: gabled/hipped					
26.	No. Bays: Fron	t 1 Side 4 27. Wall treatment: asbestos siding					
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered?					
30.	Exterior condit	ion: fair/good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
33.	Further descrip	tion of important features: 6-over-9 double-hung sash win-					

dows in the front gable end; those below are tripartite 1-over-1. The side gable is hipped. A small porch is tucked into the corner formed by the ell; it has turned posts and no side walls. A rear, one-story frame addition is attached.

^{34.} History and Significance: No building permits prior to 1950 are available for this city block.



1.	No. 104 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102							
2.	City/County: City of St. Louis, MO							
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes	8. On National Register or part of estab. district? No						
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No						
12.								
13.	Present name/owner's name: Handyman Shop							
14.	Street address: 6212 Columbia 15. Style: commercial							
16.	Date(s): 2/2/1	928 - building permit						
17.	Architect: bui	lder 18. Builder: Yawdell Realty Co.						
19.	Original Use: c	ommer./resid. 20. Present Use: commercial/residence						
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonry						
24.	Foundation mate	rial: concrete 25. Roof type/material: flat						
26.	No. Bays: Fron	t 2 Side blind 27. Wall treatment: red/multi brick						
28.	Plan shape: see	site map 29. Changes: Addition? Altered?						
30.	Exterior condit	ion: good 31: Open to public? yes; limited						
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971						
The	red/brown multich parapeted roofli	tion of important features: The facade of this building is rome brick, while the body of the building is red brick. The has stone coping, and square stone insets highlight brick cade above the first story. Two soldier lintel courses						

cross the facade, one at each story. Windows above are 6-over-1 double-hung First-story display windows appear to be very little changed.

sash.

History and Significance: A. H. Stallard took out the permit for this building, which was designed and constructed by the Yawdell Realty Co. for \$4,000 in 1928. The 25 x 60' building was to have hot air heat and the permit officially called it a "store and tenement." Interestingly, the building is listed as vacant, except for the upstairs tenant, in 1930 - perhaps a reflection on the economy.



1.	No. 119	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership:	8. On National Register or part of estab. district? No					
, •	Private	10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 6215 Columbia 15. Style: Bungaloid/Open Gable						
16.	Date(s): c. 19	25					
17.	Architect: unk	nown 18. Builder: unknown					
19.	Original Use: r	esidence 20. Present Use: residence					
21.	No. of stories:	22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: stuccoed 25. Roof type/material: front gable					
26.	No. Bays: Fron	t 2 Side 4 27. Wall treatment: vinyl siding					
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
13.	-	tion of important features: A gabled porch roof echoes the t; it is supported by wrought-iron posts set into concrete					

oured over concrete blocks. The original porch supports were almost certainly ore substantial. A two-window bay projects on the east side. This house is imilar in design to others in the area being built during the mid- to late-

⁹²⁰s, although the design was usually executed in brick.

4. Wistory and Significance: No building permits before a 1950 in this city.

^{4.} History and Significance: No building permits before c. 1950 in this city lock have been microfilmed, and so are unavailable.



1.	No. 105	No. 105 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102							
2.	City/County: City of St. Louis, MO	4. Prepa	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310						
5.	Date: 8/15/91	1						blic Red	
7.	Building? yes		City Hall; MO Historical Soc.; Heritage/St. Louis files						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No							
12.	Original name:	Original name:							
13.	Present name/owner's name:								
14.	Street address:	nbia	15. Style: Queen Anne						
16.	Date(s): c. 18	95	**************************************						
17.	Architect: unk	nown		18. Bi	ilder:	unkno	wn		
19.	Original Use: r	esidence	20.	Prese	t Use:	resid	ence		
21.	No. of stories:	2 22.	Basem	ent? ye	s 23	. Wall	constr	uction:	brick/fr
24.	Foundation mate	rial: ston	e	25.	Roof t	pe/mat	erial:	hippe	đ
26.	No. Bays: From	t 3 Side	1	27.	Wall to	reatmen	t: pai	nted br	ick/frame
28.	Plan shape: see	site map	29.	Change	s: Ado	lition?)	Alter	ed? yes
30.	Exterior condit		31: Open to public? no						
32.	Other Surveys i	n which inc	luded:	Herita	ge/St.	Louis	survey	, 1971	
	Further descrip the first story r part of this h	of this ho	use; ab	ove, a	gable	interru	pts th	e roofl	ine. The

mental arch. This house was a virtual twin to its neighbor, survey #106, before

The doorway is transomed; beside it, a small, stone-silled window has a seg-

It was denuded of its porch.

^{4.} History and Significance: Pre-1900 building permits for this city block ail to specify addresses, and none seem to describe this house or its neighbor. owever, the unidentified permits are from the mid- to late-1890s; it would seem ikely that this house dates from somewhere within that time frame. Heritage/t. Louis files record that physician James Ferguson, an elder in the Clifton eights Presbyterian Church, lived here in 1902.



1.	No. 106	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,						
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No						
9.	Ownership: Private	Ownership:						
12.	Original name:							
13.	Present name/owner's name:							
14.	Street address: 6218 Columbia 15. Style: Queen Anne							
16.	Date(s): c. 1895							
17.	Architect: unknown 18. Builder: unknown							
19.	Original Use: r	esidence 20. Present Use: residence						
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: brick/fr						
24.	Foundation mate	rial: stone 25. Roof type/material: hipped						
26.	No. Bays: Fron	t 3 Side 2 27. Wall treatment: brick/frame						
28.	Plan shape: see	site map 29. Changes: Addition? Altered?						
30.	Exterior condit	ion: good 31: Open to public? no						
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971							

windows. Below, a projecting bay window features delicate dentilling. A porch shelters the transomed doorway; round wood columns support its roof. A small, segmentally arched window next to the door has a stone sill. The second story

is sheathed in asbestos siding.

^{34.} History and Significance: The pre-1900 building permits for this city block do not specify addresses. Descriptions are sketchy on the permits, and none can be positively identified with this house or its neighbor. However, the unmatched permits date from the mid- to late-1890s, and it is likely that this house is from that era.



5. Date: 8/15/91 6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files 9. Ownership: Private 10. Visible from public road? Yes 11. Endangered? No 12. Original name: 13. Present name/owner's name: 14. Street address: 6219 Columbia 15. Style: Bungaloid 16. Date(s): c. 1925 17. Architect: unknown 18. Builder: unknown 19. Original Use: residence 20. Present Use: residence 21. No. of stories: 1 22. Basement? yes 23. Wall construction: frame 24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no										
2. City/County: City of St. Louis, MO 5. Date: 8/15/91 6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No 9. Ownership: Private 10. Visible from public road? Yes 11. Endangered? No 12. Original name: 13. Present name/owner's name: 14. Street address: 6219 Columbia 15. Style: Bungaloid 16. Date(s): c. 1925 17. Architect: unknown 18. Builder: unknown 19. Original Use: residence 20. Present Use: residence 21. No. of stories: 1 22. Basement? yes 23. Wall construction: frame 24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no	1.	No. 118	•	-						
City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No 12. Original name: 13. Present name/owner's name: 14. Street address: 6219 Columbia 15. Style: Bungaloid 16. Date(s): c. 1925 17. Architect: unknown 18. Builder: unknown 19. Original Use: residence 20. Present Use: residence 21. No. of stories: 1 22. Basement? yes 23. Wall construction: frame 24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no 12. Other Surveys in which included: Heritage/St. Louis survey, 1971	2.	City of St.	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn.							
7. Building? yes 9. Ownership: Private 10. Visible from public road? Yes 11. Endangered? No 12. Original name: 13. Present name/owner's name: 14. Street address: 6219 Columbia 15. Style: Bungaloid 16. Date(s): c. 1925 17. Architect: unknown 19. Original Use: residence 20. Present Use: residence 21. No. of stories: 1 22. Basement? yes 23. Wall construction: frame 24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no 12. Other Surveys in which included: Heritage/St. Louis survey, 1971	5.	Date: 8/15/91	!	•						
9. Ownership: Private 10. Visible from public road? Yes 11. Endangered? No 12. Original name: 13. Present name/owner's name: 14. Street address: 6219 Columbia 15. Style: Bungaloid 16. Date(s): c. 1925 17. Architect: unknown 18. Builder: unknown 19. Original Use: residence 20. Present Use: residence 21. No. of stories: 1 22. Basement? yes 23. Wall construction: frame 24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no 12. Other Surveys in which included: Heritage/St. Louis survey, 1971	7.	Building? yes	1							
13. Present name/owner's name: 14. Street address: 6219 Columbia 15. Style: Bungaloid 16. Date(s): c. 1925 17. Architect: unknown 18. Builder: unknown 19. Original Use: residence 20. Present Use: residence 21. No. of stories: 1 22. Basement? yes 23. Wall construction: frame 24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no	9.	~								
14. Street address: 6219 Columbia 15. Style: Bungaloid 16. Date(s): c. 1925 17. Architect: unknown 18. Builder: unknown 19. Original Use: residence 20. Present Use: residence 21. No. of stories: 1 22. Basement? yes 23. Wall construction: frame 24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no 32. Other Surveys in which included: Heritage/St. Louis survey, 1971	12.	Original name:	<u> </u>							
16. Date(s): c. 1925 17. Architect: unknown 18. Builder: unknown 19. Original Use: residence 20. Present Use: residence 21. No. of stories: 1 22. Basement? yes 23. Wall construction: frame 24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no 32. Other Surveys in which included: Heritage/St. Louis survey, 1971	13.	Present name/owner's name:								
17. Architect: unknown 19. Original Use: residence 20. Present Use: residence 21. No. of stories: 1 22. Basement? yes 23. Wall construction: frame 24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no 32. Other Surveys in which included: Heritage/St. Louis survey, 1971	14.	Street address:	ss: 6219 Columbia 15. Style: Bungaloid							
19. Original Use: residence 20. Present Use: residence 21. No. of stories: 1 22. Basement? yes 23. Wall construction: frame 24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no 32. Other Surveys in which included: Heritage/St. Louis survey, 1971	16.	Date(s): c. 19	25							
21. No. of stories: 1 22. Basement? yes 23. Wall construction: frame 24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no 32. Other Surveys in which included: Heritage/St. Louis survey, 1971	17.	Architect: unk	nown		18. Bu	suilder: unknown				
24. Foundation material: concrete 25. Roof type/material: front gable 26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no 32. Other Surveys in which included: Heritage/St. Louis survey, 1971	19.	Original Use: r	esidence	20.	Prese	ent Use: residence				
26. No. Bays: Front 2 Side 4 27. Wall treatment: aluminum siding 28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no 32. Other Surveys in which included: Heritage/St. Louis survey, 1971	21.	No. of stories:	1 22.	Base	ment? y	es 23. Wall construction: frame				
28. Plan shape: see site map 29. Changes: Addition? Altered? yes 30. Exterior condition: good 31: Open to public? no 32. Other Surveys in which included: Heritage/St. Louis survey, 1971	24.	Foundation mate	rial: concre	te	25.	Roof type/material: front gable				
30. Exterior condition: good 31: Open to public? no 32. Other Surveys in which included: Heritage/St. Louis survey, 1971	26.	No. Bays: Fron	t 2 Side 4		27.	Wall treatment: aluminum siding				
2. Other Surveys in which included: Heritage/St. Louis survey, 1971	28.	Plan shape: see	site map	29.	Change	ges: Addition? Altered? yes				
	30.	Exterior condit	ion: good		31:	Open to public? no				
3. Further description of important features: House has original, undulating-	12.	Other Surveys i	n which inclu	ded:	Herita	age/St. Louis survey, 1971				
	3.	Further descrip	tion of impor	tant	featur	es: House has original, undulating				

he most important feature of this house as it appears today is the flared skirt ormed by the aluminum siding around the bottom. It is not known whether this erely covers the original styling or if it is a style of its (cont'd. below)

atterned roofing. Front gable echoed in porch roof, supported by heavy, taperng stuccoed pillars. Porch has no side walls and appears to have been redone.

^{4.} History and Significance: own. It certainly is unique in Clifton Heights! pre-c. 1950 building permits have been microfilmed.



1.	No. 117	:		-	es: Missouri Box 176, Je			
2.	City/County: City of St. Louis, MO	4. Prepar	Preservation, P. O. Box 176, Jefferson City, MO 65102 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	•	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes				ر در بروسیان دادر در مواهده این مود و سر <u>و استان و بود</u> در مواهد این داد سازد استان و این داد سازد استان			No
9.	Ownership: Private	ership:					Endangered?	
12.	Original name:							
13.	Present name/owner's name:							
14.	Street address: 6225 Columbia 15. Style:							
16.	Date(s): c. 19	00	······································					
17.	Architect: unk	nown	Part of the Control o	18. Bui	lder: unknow	wn		
19.	Original Use: r	esidence	20.	Present	Use: reside	ence		
21.	No. of stories:	2 22.	Basem	ent? yes	23. Wall	constru	ction: fram	e
24.	Foundation mate	rial: stone	······	25. R	loof type/mate	erial:	gabled ell	 -
26.	No. Bays: Fron	t 4 Side		27. W	all treatmen	t: asbe	stos siding	
28.	Plan shape: see	site map	29.	Changes	: Addition?	yes	Altered? y	es
30.	Exterior condit	ion: fair/god	od	31:	Open to publ:	ic? no		
32.	Other Surveys i	n which incl	. 646	Heritan	re/St. Louis	survey	1971	

Windows are

of the ell, where an entrance is boxed in, and on the east side, where a onestory, flat-roofed addition projects. The resulting roofline in the ell is a

bit unwieldy. The one-story portion has a concrete foundation.

3-over-1 double-hung sash, paired on the front elevation.

^{34.} History and Significance: Building permits for this city block before : 1950 are unavailable. Heritage/St. Louis files indicate that William W. Spear, bookkeeper at H. Meyers & Sons, lived here in 1901-02. The Spears were sembers of the Fry Methodist Church, where apparently Mr. Spear sometimes played ornet.



1.	No. 107	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership:	8. On National Register or part of estab. district? No					
	Private	10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 6226 Columbia 15. Style: American Foursqua						
16.	Date(s): 3/21/1899 - apparent building permit						
17.	Architect: bui	lder 18. Builder: Ross C. Hallock					
19.	Original Use: r	esidence 20. Present Use: residence					
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: stone 25. Roof type/material: hipped					
26.	No. Bays: Fron	t 2 Side 2 27. Wall treatment: painted brick					
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered? yes					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
33.	Further description of important features: Dormers on this pyramidally-						

^{33.} Further description of important features: Dormers on this pyramidally-nipped roof house also have hipped roofs. Windows are replacements. A nearly full-width porch of concrete over concrete block with wood posts is apparently replacement. An upper front elevation window was probably originally more paylike in its projection; it is now sided. Door has sidelights. Side windows re segmentally arched. Rear two-story frame addition.

^{4.} History and Significance: The pre-1900 permits for this house do not notude addresses, but the process of elimination makes it very likely that the ermit for this house was taken out in 1899 by L. Hallock, who hired local rehitect/builder Ross C. Hallock (presumably related) to build this house for 1,200.



y/County: y of St. is, MO e: 8/15/91 lding? yes ership: vate	4. Prepar of St. Lou 6. Source City Hall;	ed by is, 9	c: Cynthi 017 Locus informat	ia Hill Longw st, 7th Floor	isch, Landma , St. Louis,	rks Assn.			
lding? yes	City Hall;			tion: St. Lo		Preservation, P. O. Box 176, Jefferson City, MO 65102 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
ership:		MO II	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
-	i o. Un Nat								
valt	8. On National Register or part of estab. district? No. 10. Visible from public road? Yes 11. Endangered? No.								
riginal name:									
Present name/owner's name:									
Street address: 6230-32 Columbia 15. Style: Craftsman									
Date(s): 3/3/1928 - building permit									
Architect: builder			18. Builder: John F. Haug						
Original Use: apartments 20			. Present Use: apartments						
No. of stories: 2 22. Basement? yes 23. Wall construction: mason				: masonry					
Foundation material: stone 25. Roof type/material: front gable				t gable					
No. Bays: Front 6 Side 6 27. Wall treatment: brown/multi bri				ti brick					
Plan shape: see site map 29. Changes: Addition? Altered?					red?				
Exterior condition: good 31: Open to public? no									
erior condit	Other Surveys in which included: Heritage/St. Louis survey, 1971								
n s	or condit	or condition: good	or condition: good	or condition: good 31:	or condition: good 31: Open to publ	or condition: good 31: Open to public? no			

by square stone or terra cotta inserts. A larger, rectangular insert is located at the gable above two small stained glass windows. (cont'd. below)

34. History and Significance: The gabled porch is supported by straight brick pillars; the porch shelters the four entrance doors. Flat arches on sides.

Patternmaker Edwin Hunkler of 5067 Arlington hired contractor John F. Haug to

design and build this 35 x 48' "tenement" in 1928 for \$8,000.

chrome brick while the body of the building is red brick. A soldier lintel at the second story is intersected at the corners of the paired, 3-over-1 windows



missouri OFFICE OF HISTORIC FRESERVATION FOREITHCOURAL/HISTORIC INVENTORY SURVEY FORM

1.	No. 109	3. Location of Negatives: Missouri Office of Historic Preservation, F. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91		information: St. Louis Public Records, istorical Soc.; Heritage/St. Louis files				
7.	Building? yes						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:	Original name:					
13.	Present name/owner's name:						
14.	Street address: 6234 Columbia 15. Style: Craftsman						
16.	Date(s): 5/7/1927 - building permit						
i7.	Architect: bui	lder	18. Builder: J. Boyder?				
19.	Original Use: a	partments 20.	Present Use: apartments				
21.	No. of stories:	2 22. Basem	ent? yes 23. Wall construction: masonry				
24.	Foundation mate	rial: stone	25. Roof type/material: flat				
26.	No. Bays: Fron	t 3 Side 4	27. Wall treatment: brown brick				
18.	Plan shape: see	site map 29.	Changes: Addition? Altered?				
0.	Exterior condit	ion: good	31: Open to public? no				
2.	Other Surveys i	n which included:	Heritage/St. Louis survey, 1971				
	e terra cotta co	ping and is highli	features: A parapeted roofline features ghted just below by inset terra cotta diadd brick sills. Paired, centered windows				

History and Significance: W. Donald took out the \$6,000 permit to build s 24 x 46' "tenement" with hot air heat in 1927. There are several possible Donalds in city directories. The permit itself lists "J. Boyla" as the lder, but the Daily Record fails to give one. No Boyla appears in the city ectories. However, John Boyder, an "oven builder," did the 1925 addition to bakery at 6210 Columbia and is the only name/occupation even remotely likely

both stories have 3-over-1 double-hung sash. Doors at either side are

e foundation is covered with stucco. Flat arches on side openings.

vered with newer aluminum awnings; they have only a very low stoop; no porch.





1.	No. 116	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 651						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	!				ion: St. Louis Public Records,		
7.	Building? yes	8. On Nationa			Historical Soc.; Heritage/St. Louis files 1 Register or part of estab. district? No om public road? Yes 11. Endangered? No			
9.	Ownership: Private							
12.	Original name:							
13.	Present name/own	sent name/owner's name:						
14.	Street address: 6239 Columbia 15. Sty			15. Style: Queen Anne				
16.	Date(s): c. 18	1895						
17.	Architect: unknown				18. Builder: unknown			
19.	Original Use: r	esidence 20.			Present Use: residence			
21.	No. of stories:	2	22.	Basen	ment? yes	23. Wall construction: frame		
24.	Foundation mate	Foundation material: stone			25. Roof type/material: complex			
26.	No. Bays: Front 3 Side 4			27. Wall treatment: asphalt siding				
28.	Plan shape: see	Plan shape: see site map 29.			Changes	: Addition? yes Altered?		
30.	Exterior condition: good				31: (Open to public? no		
32.	Other Surveys in which included: I				Heritage	e/St. Louis survey, 1971		
33. uit	Further descrip e irregular, fea		_			The roofline of this house is overhangs, hipping and a dormer.		

I steep gable above the shallow porch has a gothic window. The end of the front

Below, a flat-roofed hood with fanlike wood brackets (cont'd. below)

'acing gable at the left is "hipped" - see photo - above a pair of 1-over-1 indows; these have a hipped-roof hood that is supported by screenlike wood

rackets.

^{4.} History and Significance: shields the paired windows at the first story. flat-roofed projecting bay on the east side has an additional entrance. A ne-story frame addition is attached to the rear. nactive (pre-1950) building permits for this city block are not available.



1.	No. 115	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall: MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership:	8. On National Register or part of estab. district? No					
	Private	10. Visible from	public road? Yes 11. Endangered? No				
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address:	6241 Columbia	15. Style: Open Gable				
16.	Date(s): c. 19	20					
17.	Architect: unknown 18. Builder: unknown						
19.	Original Use: r	esidence 20.	Present Use: residence				
21.	No. of stories:	1 1/2 22. Baseme	nt? yes 23. Wall construction: frame				
24.	Foundation mate	rial: stone	25. Roof type/material: front gable				
26.	No. Bays: Fron	t 2 Side 3	27. Wall treatment: asphalt siding				
!8.	Plan shape: see	site map 29.	Changes: Addition? Altered? yes				
0.	Exterior condition: fair/good 31: Open to public? no						
2.	Other Surveys i	n which included:	Heritage/St. Louis survey, 1971				
	ner side of the g	abled roof on this	eatures: A shed-roof dormer extends from house. Eaves overhang and have exposed front window is 9-over-1 double-hung				

ish. Front porch is supported by wood posts; porch appears to have been

building permit.

tered, and steps are not original. Asphalt siding applied in 1957, according

[.] History and Significance: Building permits issued before c. 1950 are available for this city block.



1.	No. 111	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/ow	ner's name: Sound Equipment					
14.	Street address:	6242 Columbia 15. Style: commercial					
16.	Date(s): c. 19	28					
17.	Architect: unk	nown 18. Builder: unknown					
19.	Original Use: c	ommer./resid. 20. Present Use: commercial (/residential?)					
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: concrete 25. Roof type/material: flat					
26.	No. Bays: Fron	t 3 Side 4 27. Wall treatment: red/multi brick					
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes					
30.	Exterior condit	ion: good 31: Open to public? yes; limited					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
	a tiny parapet a	tion of important features: The roofline of this building nd is "stepped" down at the sides; terra cotta coping. on the front elevation have a soldier lintel course. The					

windows are 3-over-1 double-hung sash. Side windows have flat arches. Brick

a narrow aluminum awning. Inset terra cotta squares at top, front elevation.

The first story display windows have had some alteration and now have

^{34.} History and Significance: Although the building permits for this city block are relatively complete, they fail to provide one for this building. It is very similar to others on the block dating from c. 1928. Confectioner Harry Shelton occupied the building in 1930.



		•					
1.	No. 114	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	<u>-</u>	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91						
7.	Building? yes		City Hall; MO Historical Soc.; Heritage/St. Louis files				
9.	Ownership:	8. On Natio	onal Regis	ter or part of estab. district? No			
	Private	10. Visible from public road? Yes 11. Endangered? No					
2.	Original name:						
13.	Present name/own	ner's name:					
14.	Street address:	6245 Columbia	15. Style: Queen Anne				
16.	Date(s): c. 19	00					
17.	Architect: unk	nown	18. B	uilder: unknown			
19.	Original Use: r	es idenc e :	20. Prese	nt Use: residence			
21.	No. of stories:	2 22. Ba	asement? y	es 23. Wall construction: frame			
!4.	Foundation mate	rial: stuccoed	d 25.	Roof type/material: complex			
6.	No. Bays: Fron	t 3 Side 3	27.	Wall treatment: siding			
8.	Plan shape: see	site map	29. Chang	es: Addition? rear Altered?			
0.	Exterior condit	ion: fair/good	31:	Open to public? no			
2.	Other Surveys in which included: Heritage/St. Louis survey, 1971						
es lo	materials are st of an undulating ngs of undetermin	ill in place or g pattern, whi ned material.	n this hou le the wal A 1-story	es: Evidently, the original build- se. The roof is covered with shin- ls are covered with overlapping multisided bay projects at the either side, the one on the east			

[.] History and Significance: have 1-over-1 double-hung sash. The front gable defined by a narrow eave that crosses it below the small attic window. One-pry rear frame addition.

ving a gable. The porch has round wood pillars. Windows (cont'd. below)

pre-1950 building permits for this city block are not available.



1.

No. 113

3. Location of Negatives: Missouri Office of Historic

		Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	4. Prepare	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310:					
5.	Date: 8/15/91	1						
7.	Building? yes	City Hail;	City Hall; MO Historical Soc.; Heritage/St. Louis files				res	
9.	Ownership:	8. On Nati	iona:	l Regist	cer or part o	f estab	district?	No
٠,٠	Private	10. Visible from public road? Yes 11. Endangered?				? No		
12.	Original name:							
13.	Present name/owner's name:							
14.	Street address:	ess: 6247 Columbia			15. Style:	Queen	Anne	
16.	Date(s): c. 1920							
17.	Architect: unk	nown		18. Bı	uilder: unkr	own		-
19.	Original Use: residence 20.			Prese	nt Use: resi	dence/m	ultifamily	
21.	No. of stories:	2 1/2 22. I	Basei	ment? ye	es 23. Wall	constr	ruction: fra	me
24.	Foundation mate	rial: stone	again ag phile ann an t-oirean ann an	25.	Roof type/ma	terial:	multigabl	ed
26.	No. Bays: Fron	t 3 Side 4		27.	Wall treatme	ent: alu	minum sidin	g
28.	Plan shape: see	site map	29.	Change	es: Addition	? rear	Altered?	yes
30.	Exterior condit	ion: good		31: Open to public? no				
32.	Other Surveys i	n which include	ded:	Herita	age/St. Louis	survey	, 1971	
very belo	Further descrip sash. A 2-stor thin square woo w. Two transome y frame addition	y bay projects d posts and it d front doors	on that	the eas	st side. The	e porch d perma	is supportensions is supportensions.	d by hing

^{34.} History and Significance: All the inactive building permits for this city block are unavailable, so things built prior to 1950 are for the most part speculation. The multi-family use of this building makes a somewhat later date a bit likelier.



1.	No. 112	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership: Private 8. On National Register or part of estab. district? Notes that the stab is the st						
2.	Original name:						
3.	Present name/ow	er's name:					
4.	Street address:	6259 Columbia 15. Style: Queen Anne					
6.	Date(s): c. 19	5					
7.	Architect: unk	own 18. Builder: unknown					
9.	Original Use: r	sidence 20. Present Use: residence					
1.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame					
4.	Foundation mate	ial: stone 25. Roof type/material: hipped					
6.	No. Bays: Fron	2 Side 2 27. Wall treatment: vinyl siding					
8.	Plan shape: see	site map 29. Changes: Addition? Altered? yes					
0.	Exterior condit	on: good 31: Open to public? no					
32.	Other Surveys i	which included: Heritage/St. Louis survey, 1971					
13.	Further descrip	ion of important features: The detailing of this buildin ogenized with alterations and siding. However, the orig-					

ent windows. 2-story side projecting bay window.

nal intent appears to have been of a picturesque/Queen Anne bent. The porch as been partially infilled to provide extra living space. What remains is

upported by thin square wood posts; turned wood balustrade. 1-over-1 replace-

Roof is

(cont'd. below)

^{4.} History and Significance: hipped at several levels and angles.
5 inactive (pre-1950, in this case) building permits were microfilmed for this ity block. The house appears to date to the early part of the century.



1.	No. 189		3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepar	ed by	: Cynthia	a Hill Longw	isch, I	Landmarks As Louis, MO 6	sn.
5.	Date: 8/15/91	1	•					
7.	Building? yes		City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership:	8. On Nat	ional	Register	or part of	estab.	. district?	No
	Private	10. Visible from public road? Yes 11. Endangered? No						No
12.	Original name:							
13.	Present name/ow	ner's name:						
14.	Street address:	6001 Eitman	l		15. Style:	Tudor	Queen Anne?	
16.	Date(s): c. 19	10						
17.	Architect: unk	nown		18. Buil	lder: unkno	wn		
19.	Original Use: r	esidence	20.	Present	Use: resid	ence		
21.	No. of stories:	2 22.	Basen	ent? yes	23. Wall	constru	uction: maso	nry
24.	Foundation mate	rial: stone		25. Ro	oof type/mat	erial:	complex	
26.	No. Bays: Fron	t 2 Side 4	<u> </u>	27. Wa	all treatmen	t: stud	cco/half tim	- ber
28.	Plan shape: see	site map	29.	Changes	: Addition?	yes	Altered? y	es
30.	Exterior condit	ion: good		31: (Open to publ	ic? no	0	
32.	Other Surveys i	n which inclu	ıded:	Heritage	e/St. Louis	survey,	, 1971	
33.	Further descrip	tion of impor		features	This house	e evid	ently hegan	1 i f.

^{33.} Further description of important features: This house evidently began life as a Queen Anne, with a multilevel hipped and gabled roof that includes dormers of different sizes. The remnant of the original porch roofline is visible behind the large porch gable. At some point, stucco and rectilinear "half-timbering" was applied to the exterior. A projecting front bay became quasi-medieval. A large rear deck and 1-story side addition are also present....

^{34.} History and Significance: No pre-1926 building permits for this city block are available.



	_						
1.	No. 206	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/own	ner's name:					
14.	Street address: 6002 Eitman 15. Style: Gothic Revival						
16.	Date(s): c. 184	40 (Heritage/St. Louis)					
17.	Architect: unk	nown 18. Builder: unknown					
19.	Original Use: re	esidence 20. Present Use: residence					
21.	No. of stories:	1 & 2 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: obscured 25. Roof type/material: side gable					
26.	No. Bays: Fron	t 5 Side 6 27. Wall treatment: asbestos siding					
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered? yes					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
33.	•	tion of important features: A steeply-pitched gable inter- line of this side-gabled house. A hipped-roof porch is					

supported by turned wood Doric columns. Windows at 2nd story front are paired and smaller than the others. Transomed door. A 1 1/2 story section at the far south end of the house is attached to the main portion by a long, thin section that has an open porch along the east side. 6-over-6 windows on rear section.

^{34.} History and Significance: See over.

Item #34: This house was identified by Heritage/St. Louis as the oldest house in Clifton Heights. At the time of their research (1970-71), the owner of the house was Katherine Rhoads Harkness. (The wife of an architect, she was 111 at that time, but had a very sharp memory and keen interest in local buildings; her correspondence with Heritage/St. Louis gives no indication of negative effects of her age: no loss of intellect/memory of any kind is evident.) granddaughter of William Henry Rhoads and daughter of James Rhoads. one of the founding members of the Clifton Heights Presbyterian Church. William Henry Rhoads was first listed at this address in 1898.

Family lore estimates that the original house was built c. 1840; there is also a story that the foundation was obtained from "slave cabins on the property." Mrs. Harkness reported that her uncle, the youngest son and only surviving child (in 1970-71) of William H. Rhoads, said that he could remember playing in the old and dilapidated slave quarters as a child before it became necessary to tear them down. He could not remember any stonework in them. She felt that the mention of such quarters must mean that the place was a part of some type of "plantation," a term that is perhaps somewhat misused in reference to this farm.

Heritage/St. Louis files also say: "First part built by a doctor, who was Supt. of Female Hospital which used to be on Arsenal where Sublette Park is now. A man named Flint owned it next. Wm. Henry Rhoads moved a house that had been on Columbia turned it around so the house now faces Eitman." This information was evidently gleaned from Mrs. Harkness. She says.

"According to the account given to me by my family there was a two-story frame house on the Eitman property [6001-07 Columbia]. This was the house that was moved by my grandfather, William Henry Rhoads, about 1898 from the Eitman lot on Columbia to the 6002 Eitman Ave. address. A two room one-and-a-half story house which had served as a detached kitchen and laundry was also moved and joined to the main house to become one unit. This is the house that is now my home."

The 1883 Hopkins map included in this report does show one building in the area, and it is facing Columbia. It may have been the house Mr. Rhoads moved. If any slave cabins existed at that time, they must have been 1) too insignificant to record and 2) not in the immediate vicinity of the "plantation's" house.

The house and its additions give up few exterior clues as to their age. The house is essentially a generic I-House with a gable and classical pillars; the modest rear additions, almost completely obscured both summer and winter by trees and plants and its hilltop location, appear to have little in the way of stylistic detailing, typical of much middle-class rural architecture.



1.	No. 190	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 			
2.	City/County: City of St. Louis, MO				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files			
7.	Building? yes				
9.	Ownership:	8. On National Register or part of estab. district? No			
· ·	Private	10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/ow	ner's name:			
14.	Street address: 6007 Eitman 15. Style: Bungaloid				
16.	Date(s): c. 19	20			
17.	Architect: unknown 18. Builder: unknown				
19.	Original Use: r	esidence 20. Present Use: residence			
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: brick/f			
24.	Foundation mate	rial: concrete 25. Roof type/material: complex			
26.	No. Bays: Fron	t 4 Side 3 27. Wall treatment: red brick/frame			
28.	Plan shape: see	site map 29. Changes: Addition? ? Altered? yes			
30.	Exterior condit	ion: good 31: Open to public? no			
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971			
33.	Further descrip	tion of important features: At first glance, this house			

^{33.} Further description of important features: At first glance, this house seems to be a bungalow with a strange addition. However, the materials are the same and the transition places so smooth that it appears that it could have been built all at the same time. The right side has a front gable, while the left is hipped. A porch across the right side is supported by tapering brick pillars; it has brick short side walls. A shed-roof dormer is located (cont'd. below)

^{34.} History and Significance: in the left section. Below, a frame bay window with exposed rafter ends may be an alteration. Most of the windows are 1-over-1; except for the bay window, all first-floor windows and all side windows have segmental arches.

No pre-1926 (inactive) building permits are available for this city block.



1.	No. 205	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510							
2.	City/County: City of St. Louis, MO	•							
5.	Date: 8/15/91	!	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes	_						·	
9.	Ownership: Private	8. On National Register or part of estab. district? 10. Visible from public road? Yes 11. Endangered?							
12.	Original name:								
13.	Present name/own	ner's name:							
14.	4. Street address: 6010 Eitman 15. Style: C				Classi	cal Rev	ival		
16.	Date(s): c. 18	95-1900							
17.	Architect: unk	nown		18. Bu	ilder:	unknov	v n		
19.	Original Use: re	esidence	20.	Preser	ıt Use:	reside	ence		
21.	No. of stories:	2 22.	Basen	ment? ye	s 23.	Wall o	constru	ction:	masonry
24.	Foundation mate	rial: not v	isible	25.	Roof typ	e/mate	erial:	side g	able
26.	No. Bays: Fron	t 3 Side	3	27.	Wall tre	atment	: pain	ted bri	ck
!8.	Plan shape: see	site map	29.	Change	s: Addi	tion?		Altere	d?
0.	Exterior condit	ion: good		31:	Open to	publi	ic? no		
2.	Other Surveys in	n which incl	uded:	Herita	ıge/St. I	ouis s	survey,	1971	
3.	Further descrip	tion of impo	rtant	feature	s: Wind	lows ar	re segm	entally	arched

th pressed-brick hoods at second story front. Full-width porch supported by x round wood Doric columns. Transomed door. Molded cornice at roofline turns. Windows are 1-over-1.

[.] History and Significance: Building permits before 1926 are unavailable : this city block.



1.	No. 191	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 				
2.	City/County: City of St. Louis, MO					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,				
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files				
9.	Ownership:	8. On National Register or part of estab. district? No				
٠,٠	Private	10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:	Original name:				
13.	Present name/own	ner's name:				
14.	Street address:	6011 Eitman 15. Style: Craftsman				
16.	Date(s): c. 19	20				
17.	Architect: unk	nown 18. Builder: unknown				
19.	Original Use: r	esidence 20. Present Use: residence				
21.	No. of stories:	2 1/2 22. Basement? yes 23. Wall construction: frame				
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable				
26.	No. Bays: Fron	t 2 Side 2 27. Wall treatment: asbestos siding				
28.	Plan shape: see	site map 29. Changes: Addition? Altered?				
30.	Exterior condit	ion: fair/good 31: Open to public? no				
32.	Other Surveys in	n which included: Heritage/St. Louis survey, 1971				

^{33.} Further description of important features: If this house had a hipped roof, it would be a foursquare. Instead, the side-gabled roof has wide over-hangs and a dormer with paired 1-over-1 windows. A full-width porch has a hipped roof and tapering, wood pillars and no side walls. All windows are 1-over-1 except first story front: 2-over-2.

^{34.} History and Significance: No inactive (pre-1926) building permits are available for this city block.



1.	No. 204	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,				
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files				
9.	Ownership:	8. On National Register or part of estab. district? No				
	Private	10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:					
13.	Present name/ow	ner's name:				
14.	Street address: 6016 Eitman 15. Style: Col. Rev./Craftsman					
16.	Date(s): 12/9/	1927 - building permit				
17.	Architect: bui	lder 18. Builder: Harry C. Vollmar				
19.	Original Use: re	esidence 20. Present Use: residence				
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame				
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable				
26.	No. Bays: Fron	t 6 Side 2 27. Wall treatment: aluminum siding				
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971				

^{33.} Further description of important features: This side-gabled house has 6-over-1 double-hung sash windows, nearly all paired (except for the bay window, which is an alteration). A gabled hood over the door has long brackets; the door has multipane sidelights. A one-story side addition is original.

^{34.} History and Significance: Owner T. G. Eichman hired local builder Harry C. Vollmar to build three houses (survey #202-03-04) in 1927. The 24 x 30' dwellings were to cost \$3,000 each and have hot air heat. Eichman did not live in the houses. Vollmar was a prolific local builder, especially during the 1920s. He lived nearby at 6105 Simpson.



1.	No. 192	į.	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepar	ed by	y: Cynth	hia Hill Longwisch, Landmarks Assn. ust, 7th Floor, St. Louis, MO 6310		
5.	Date: 8/15/91		6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files				
7.	Building? yes						
9.	Ownership: Private	8. On National Register or part of estab. district? 10. Visible from public road? Yes 11. Endangered?					
12.	Original name:	nal name:					
13.	Present name/ow	ner's name:					
14.	Street address: 6017 Eitman 15. Style: Open Gable				15. Style: Open Gable		
16.	Date(s): c. 19	10					
17.	Architect: unknown			18. Bu	uilder: unknown		
19.	Original Use: r	esidence	20.	Preser	nt Use: residence		
21.	No. of stories:	1 1/2 22.	Baser	ment? ye	es 23. Wall construction: frame		
24.	Foundation mate	rial: stucco	ed	25.	Roof type/material: front gable		
26.	No. Bays: Fron	t 2 Side 2		27.	Wall treatment: vinyl siding		
28.	Plan shape: see	site map	29.	Change	es: Addition? rear Altered? yes		
30.	Exterior condit	ion: good		31:	Open to public? no		
32.	Other Surveys i	n which inclu	ded:	Herita	age/St. Louis survey, 1971		
33.		tion of impor			es: This house probably had some		

nodest Queen Anne detailing before remodeling struck. It is very similar to its neighbors, survey #193 & #194, and all may have been built at the same time. I shed-roof dormer with two windows is on the east side. A hipped-roof porch is supported by non-original iron posts. Side windows have been altered. A shed-roof rear addition is present on all three and may have been original.

^{4.} History and Significance: No building permits issued before 1926 are vailable for this city block.



1.	No. 193	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership:	8. On National Register or part of estab. district? No					
	Private	10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:	ginal name:					
13.	Present name/owner's name:						
14.	15. Style: Open Gable						
16.	Date(s): c. 19	10					
17.	Architect: unk	nown 18. Builder: unknown					
19.	Original Use: r	esidence 20. Present Use: residence					
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: stone 25. Roof type/material: front gable					
26.	No. Bays: Fron	t 2 Side 2 27. Wall treatment: aluminum siding					
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered? yes					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
from port	vey #192 & #194, at gable has pair ced by paneled wo	tion of important features: This house is very similar to on either side and may have been done at the same time. A ed replacement windows; below, a hipped porch roof is supod pillars. Porch's spindle balustrade is not original. ion is flat-roofed; probably original to house except roof					

^{34.} History and Significance: No building permits issued before 1926 for this city block were microfilmed.

was originally sloping (see #192 & #194).



1.	No. 194	3. Location of Negatives: Missouri Office of Historic	
2.	City/County: City of St. Louis, MO	Preservation, P. O. Box 176, Jefferson City, MO 65102 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address: 6027 Eitman 15. Style: Open Gable		
16.	Date(s): c. 1910		
17.	Architect: unk	nown 18. Builder: unknown	
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: frame	
24.	Foundation material: stone 25. Roof type/material: front gable		
26.	No. Bays: Front 2 Side 3 27. Wall treatment: aluminum siding		
28.	Plan shape: see site map 29. Changes: Addition? rear Altered? yes		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971	
	vey #192 & #193 a	tion of important features: This house is very similar to nd all may have the same builder/date. A hipped dormer has window. Two 1-over-1 windows in gable end. Enclosed porch	

original. Original detailing probably very modest Queen Anne.

probably started out open. Rear 1-story addition has shed roof; it is probably

^{34.} History and Significance: No building permits issued before 1926 are available for this city block.



1.	No. 195	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes		
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address:	dress: 6033 Eitman 15. Style: Queen Anne	
16.	Date(s): c. 1900		
17.	Architect: unknown 18. Builder: unknown		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame	
24.	Foundation mate	rial: stone 25. Roof type/material: complex	
26.	No. Bays: Front 3 Side 3 27. Wall treatment: aluminum siding		
28.	Plan shape: see site map 29. Changes: Addition? rear Altered? yes		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971	
	ed, with a gable	tion of important features: The main roof of this house is and dormer to add interest. The dormer is small and pedi- le projects slightly from body of house. Front porch has	

shed roof supported by paneled wood posts. Stone foundation is stuccoed.

story rear addition.

^{34.} History and Significance: The building permits issued before 1926 for this city block are unavailable.



1.	No. 196	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63103	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership:	8. On National Register or part of estab. district? No	
	Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address: 6035 Eitman 15. Style: Craftsman		
16.	Date(s): c. 1920		
17.	Architect: unknown 18. Builder: unknown		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: frame		
24.	Foundation material: stone 25. Roof type/material: gabled		
26.	No. Bays: Front 3 Side 2 27. Wall treatment: vinyl siding		
28.	Plan shape: see site map 29. Changes: Addition? Altered? yes		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
33.	Further description of important features: The front-facing gabled of this		

house has paired 3-over-1 double-hung sash windows. Below, a shed-roof porch is supported by tapered, square wood pillars; it has no side walls. The doorway has Craftsman paning. At the right side, a "dormer" rises - really a part of the house intersected by the front gable. At left, both shed-roof dormer intersecting the eave and the window below are replacements.

^{34.} History and Significance: No pre-1926 building permits for this city block are available.



1.	No. 036	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address: 6005 Elizabeth 15. Style: Col.Revival/Craftsma		
16.	Date(s): c. 1927		
17.	Architect: unknown 18. Builder: H. C. Vollmar?		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame	
24.	Foundation material: concrete 25. Roof type/material: mock gambre		
26.	No. Bays: Front 3 Side 2 27. Wall treatment: wood clapboarding		
28.	Plan shape: see site map 29. Changes: Addition? Altered?		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
33.	Further descrip	tion of important features: *Interesting roofline treatment	

- features a standard side gable intersected with gambrel-shaped eaves. The effect is one of a gambrel roof with full-width dormers, both front and back. Paired windows. Centered entrance is highlighted by a gabled hood supported by wood brackets. A one-story, flat-roofed room, apparently original, extends to the east; it has an upper railing and second-floor door access.
- 34. History and Significance: While all the building permits, both active and inactive, for this city block were unavailable, this house is virtually identical to survey #37, diagonally across the street. That house was built in 1927 by H. C. Vollmar, a prolific builder of houses in the immediate vicinity. Odds are very good that he built both houses. Mrs. Annie Murray was living here in 1930 but not in 1925.



1.	No. 035	!	of Negatives: Missouri Office of Historic Ion, P. O. Box 176, Jefferson City, MO 65102
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	*	information: St. Louis Public Records, Historical Soc.; Heritage/St. Louis files
7.	Building? yes		
9.	Ownership: Private	8. On Nationa	al Register or part of estab. district? No
		10. Visible fr	com public road? Yes 11. Endangered? No
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address: 6011 Elizabeth 15. Style: Bungalow		
16.	Date(s): c. 1926-29		
17.	Architect: unknown		18. Builder: unknown
19.	Original Use:	residence 20). Present Use: residence
21.	No. of stories:	1 1/2 22. Base	ement? yes 23. Wall construction: masonry
24.	Foundation mate	rial: stuccoed	25. Roof type/material: side gable
26.	No. Bays: Front Side 3 27. Wall treatment: red/orange brick		
28.	Plan shape: see site map 29. Changes: Addition? Altered? yes		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys i	n which included:	: Heritage/St. Louis survey, 1971
over	three windows; o	verhanging eaves now enclosed. U	features: Center dormer is gabled and with exposed rafter ends. Roof extends Unlike the other houses in this group, the width of the house; rather, an extra front

room on the west side is original. The original porch was open and took up the

remainder of the front; it is now enclosed with brick and screens.

^{34.} History and Significance: See survey #24.



1.	No. 034	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510		
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101		
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files		
7.	Building? yes			
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No		
12.	Original name:	Original name:		
13.	Present name/owner's name:			
14.	Street address:	Street address: 6013 Elizabeth 15. Style: Bungalow		
16.	Date(s): c. 1926-29			
17.	Architect: unknown 18. Builder: unknown			
19.	Original Use:	residence 20. Present Use: residence		
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry		
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable		
26.	No. Bays: Fron	t 3 Side 1 27. Wall treatment: textured brick		
28.	Plan shape: see site map 29. Changes: Addition? Altered?			
30.	Exterior condition: good 31: Open to public? no			
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971		
and has	has triple windown overhanging eaves	tion of important features: Center gabled dormer is sided ws and overhanging eaves. Roofline extends over porch and s. Porch roof supported by wrought-iron pillars; wrought-ed, 3-over-3 windows flank center doorway.		

34. History and Significance: See survey #24.



1.	No. 033	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files				
7.	Building? yes					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:					
13.	Present name/ow	ner's name:				
14.	Street address: 6015 Elizabeth 15. Style: Bungalow					
16.	Date(s): c. 1926-29					
17.	Architect: unknown 18. Builder: unknown					
19.	Original Use:	residence 20. Present Use: residence				
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: frame				
24.	Foundation mate	rial: stuccoed 25. Roof type/material: side gable				
26.	No. Bays: Front 3 Side 1 27. Wall treatment: asbestos siding					
28.	Plan shape: see site map 29. Changes: Addition? Altered?					
30.	Exterior condition: fair/good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971				
pose	lows and overhang	tion of important features: Gabled front dormer has triple ing eaves. Roofline extends over porch and features extoverhanging eaves. Tapered porch pillars; solid porch				

^{34.} History and Significance: See survey #24.



1.	No. 032	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510 				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310				
5.	Date: 8/15/91	•	of information: St. Louis Public Records,			
7.	Building? yes	The second secon	MO Historical Soc.; Heritage/St. Louis files			
9.	Ownership:	8. On Natio	onal Register or part of estab. district? No			
	Private	10. Visible	from public road? Yes 11. Endangered? No			
12.	Original name:					
13.	Present name/ow	ner's name:				
14.	Street address:	6019 Elizabeth 15. Style: Bungalow				
16.	Date(s): c. 19	26-29				
17.	Architect: unk	nown	18. Builder: unknown			
19.	Original Use:	residence	20. Present Use: residence			
21.	No. of stories:	1 1/2 22. Ba	asement? yes 23. Wall construction: frame			
24.	Foundation mate	rial: stuccoed	l 25. Roof type/material: side gable			
26.	No. Bays: Fron		27. Wall treatment: vinyl siding			
28.		site map 2	29. Changes: Addition? Altered? yes			
30.	Exterior condit	Exterior condition: good 31: Open to public? no				
	-		ed: Heritage/St. Louis survey, 1971			
33. alte	eration to this h tripled (replace	tion of importa ouse. Its larg ment) windows. he house roof.	ant features: Wider-width siding is the main ge front dormer features a hipped gable with Tapering columns support porch roof, which Solid porch side walls. Overhanging eaves. center doorway.			

34. History and Significance: See survey #24.



1.	No. 031	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65103					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63103					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:	The state of the s					
13.	Present name/ow	wner's name:					
14.	Street address:	6023 Elizabeth 15. Style: Bungalow					
16.	Date(s): c. 19	326-29					
17.	Architect: unk	nown 18. Builder: unknown					
19.	Original Use:	residence 20. Present Use: residence					
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: stuccoed 25. Roof type/material: side gable					
26.	No. Bays: Fron	t 3 Side 1 27. Wall treatment: vinyl siding					
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
hous eave rail	the front porch; se. Large gabled es, as does the h	tion of important features: Work appears to have been done concrete base and brick pillars appear to be newer than dormer has triple, 3-over-1 pane windows and overhanging ouse. House roof extends to cover porch. Porch has iron solid side walls. Paired, 3-over-1 windows flank the center					

^{34.} History and Significance: See survey #24.



1.	No. 171	-		-			e of Historic n City, MO 65102
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	<u> </u>					blic Records, t. Louis files
7.	Building? yes						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No				Endangered? No	
12.	Original name:						
13.	Present name/ow	ner's name:					
14.	Street address:	6024 Eliz	abeth		15. Style:	Queen	Anne
16.	Date(s): c. 1895						
17.	Architect: unknown 18. Builder: unknown						
19.	Original Use: r	esidence	20.	Preser	t Use: resi	dence	
21.	No. of stories:	2 22.	Basem	ent? ye	s 23. Wall	constr	uction: frame
24.	Foundation mate	rial: conc	rete	25.	Roof type/ma	terial:	complex
26.	No. Bays: Fron	t 4 Side	2	27.	Wall treatme	nt: vin	yl siding
28.	Plan shape: see	site map	29.	Change	s: Addition	?	Altered? yes
30.	Exterior condition: good 31: Open to public? no					.0	
32.	Other Surveys i	n which inc	luded:	Herita	ge/St. Louis	survey	, 1971
	Further descripmid with gables.	Windows a	ppear t	o be re	placements:	1-over-	1. A full-width

light/window and an angled bay window. At the west side, a gabled projection

has both front- and side-facing windows.

^{34.} History and Significance: No pre-1925 building permits available for this city block. Heritage/St. Louis files note that W. H. Davis, a clerk, lived in this house in 1898 (apparently gleaned from Episcopal church files).



1.	No. 030	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,				
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No				
9.	Ownership:	8. On National Register or part of estab. district? No				
	Private	10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:					
13.	Present name/ow	ner's name:				
14.	Street address:	6025 Elizabeth 15. Style: Bungalow				
16.	Date(s): c. 19	c. 1926-29				
17.	Architect: unk	nknown 18. Builder: unknown				
19.	Original Use:	residence 20. Present Use: residence				
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: frame				
24.	Foundation mate	rial: stuccoed 25. Roof type/material: side gable				
26.	No. Bays: Fron	t 3 Side 1 27. Wall treatment: vinyl siding				
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971				
wind	ration. Large fows. Roof of ho	tion of important features: Wider-width siding is primary ront dormer has overhanging eaves and tripled (replacement) use extends to cover porch. Porch has tapering columns and aired (replacement) windows flank center doorway.				

^{34.} History and Significance: See survey #24.



1.	No. 170	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files			
7.	Building? yes	8. On National Register or part of estab. district? No			
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/ow	ner's name:			
14.	Street address:	address: 6028 Elizabeth 15. Style: Craftsman/Open Gable			
16.	Date(s): c. 19	920–25			
17.	Architect: unk	nown 18. Builder: unknown			
19.	Original Use: r	esidence 20. Present Use: residence			
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: frame			
24.	Foundation mate	rial: stuccoed 25. Roof type/material: front gable			
26.	No. Bays: Fron	t 2 Side 4 27. Wall treatment: siding*			
28.	Plan shape: see	site map 29. Changes: Addition? yes Altered?			
30.	Exterior condit	ion: good 31: Open to public? no			
32.	Other Surveys in	n which included: Heritage/St. Louis survey, 1971			

sash. Small porch is supported by thin (metal pipe?) posts. A brick garage extends from the east side, making use of the slope in grade so that it is essentially incorporated into the basement. *A 1967 building permit says "apply plastic glass siding to frame dwelling."

^{34.} History and Significance: No building permits issued before late 1925 are available. Circa date is based on similar Craftsman styling on dated buildings in the area.



1.	No. 169	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks of St. Louis, 917 Locust, 7th Floor, St. Louis, MO	Assn.		
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Recordity Hall; MO Historical Soc.; Heritage/St. Louis			
7.	Building? yes				
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/ow	r's name:			
14.	Street address: 6032 Elizbeth 15. Style: modified Shotgun				
16.	Date(s): c. 1905-10; addition 1932				
17.	Architect: unk	wn 18. Builder: unknown			
19.	Original Use: r	idence 20. Present Use: residence			
21.	No. of stories:	22. Basement? yes 23. Wall construction: f	rame		
24.	Foundation mate	al: stone 25. Roof type/material: gabled	ell		
26.	No. Bays: Fron	3 (2)Side 3 (1) 27. Wall treatment: aluminum sid	ing		
18.	Plan shape: see site map 29. Changes: Addition? rear Altered?				
10.	Exterior condit	n: good 31: Open to public? no			
2.	Other Surveys i	which included: Heritage/St. Louis survey, 1971			
3. -ba		on of important features: This house was originally bays above in parentheses). A porch on the front			

he house is supported by thin wood posts. Windows are 2-over-2 double-hung

ash. A rear addition extends to the east and south.

l. History and Significance: No building permits issued before late 1925 are railable for this city block, so no date is known. James Weigle took out a sermit to build an addition to this dwelling in 1932 for \$400.



City/County: City of St. Couis, MO Date: 8/15/91 Building? yes	4. Prepare of St. Lou 6. Source City Hall;	ed by is, 9:	: Cynthia 17 Locust	Box 176, Jest Hill Longwitt, 7th Floor	isch, La	andmarks Ass	
Building? yes Dwnership:	City Hall;		informati	on. Ct Io	· · · · · ·		
Ownership:	_	110 11.	istorical			lic Records	
- ;		• 1					
Private			-	road? Yes		Endangered?	No No
Original name:							
Present name/own	ner's name:						
Street address: 6033 Elizabeth 15. Style: Bungalow							
Date(s): c. 1926-29							
Architect: unknown			18. Buil	der: unknow	∀ n		
Original Use: residence 2			Present	Use: resid	lence		
No. of stories:	1 1/2 22.	Basem	ent? yes	23. Wall	construc	ction: frame	e
Foundation mater	rial: stucco	ed	25. Ro	oof type/mate	erial:	side gable	
No. Bays: Front	t 3 Side 2	,	27. Wa	all treatmen	t: asbes	stos siding	
Plan shape: see	site map	29.	Changes:	Addition?	<u> </u>	Altered?	
Exterior condition: good 31: Open to public? no							
Other Surveys in	which include	ded:	Heritage	e/St. Louis	survey,	1971	
	Present name/own Street address: Date(s): c. 192 Architect: unkn Driginal Use: n To. of stories: Toundation mater To. Bays: Front Plan shape: see Exterior condition Other Surveys in	Present name/owner's name: Street address: 6033 Elizab Oate(s): c. 1926-29 Architect: unknown Original Use: residence To. of stories: 1 1/2 22. Foundation material: stucco To. Bays: Front 3 Side 2 Olan shape: see site map Exterior condition: good Other Surveys in which inclu	Present name/owner's name: Street address: 6033 Elizabeth Date(s): c. 1926-29 Architect: unknown Driginal Use: residence 20. To. of stories: 1 1/2 22. Basem Coundation material: stuccoed To. Bays: Front 3 Side 2 Chan shape: see site map 29. Exterior condition: good Other Surveys in which included:	Present name/owner's name: Street address: 6033 Elizabeth 1 Date(s): c. 1926-29 Architect: unknown 18. Buil Driginal Use: residence 20. Present So. of stories: 1 1/2 22. Basement? yes Foundation material: stuccoed 25. Ro So. Bays: Front 3 Side 2 27. Wa Clan shape: see site map 29. Changes: Exterior condition: good 31: Contact of the Surveys in which included: Heritage	Present name/owner's name: Street address: 6033 Elizabeth 15. Style: Street address: 6033 Elizabeth 15. Style: Street address: 6033 Elizabeth 15. Style: State(s): c. 1926-29 Architect: unknown 18. Builder: unknown Priginal Use: residence 20. Present Use: residence 20. of stories: 1 1/2 22. Basement? yes 23. Wall of stories: 1 1/2 22. Basement? yes 23. Wall of stories: 1 1/2 24. Basement? yes 25. Roof type/material. Stories: 1 1/2 26. Basement? yes 27. Wall treatment 27. Wall treatment 29. Changes: Addition? Staterior condition: good 31: Open to publisher Surveys in which included: Heritage/St. Louis 25.	Present name/owner's name: Street address: 6033 Elizabeth 15. Style: Bungalo Street address: 6033 Elizabeth 15. Style: Bungalo State(s): c. 1926-29 Architect: unknown 18. Builder: unknown Original Use: residence 20. Present Use: residence So. of stories: 1 1/2 22. Basement? yes 23. Wall construct Soundation material: stuccoed 25. Roof type/material: So. Bays: Front 3 Side 2 27. Wall treatment: asbest Plan shape: see site map 29. Changes: Addition? Staterior condition: good 31: Open to public? no	Present name/owner's name: Street address: 6033 Elizabeth 15. Style: Bungalow Pate(s): c. 1926-29 Architect: unknown 18. Builder: unknown Priginal Use: residence 20. Present Use: residence To. of stories: 1 1/2 22. Basement? yes 23. Wall construction: frame foundation material: stuccoed 25. Roof type/material: side gable To. Bays: Front 3 Side 2 27. Wall treatment: asbestos siding Plan shape: see site map 29. Changes: Addition? Altered? Exterior condition: good 31: Open to public? no

flank center door.

^{34.} History and Significance: See survey #24.



1.	No. 028	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files			
7.	Building? yes				
9.	Ownership: Private	8. On National Register or part of estab. district? No. 10. Visible from public road? Yes 11. Endangered? No.			
12.	Original name:				
13.	Present name/ow	ner's name:			
14.	Street address: 6035 Elizabeth 15. Style: Bungalow				
16.	Date(s): c. 1926-29				
17.	Architect: unknown 18. Builder: unknown				
19.	Original Use:	residence 20. Present Use: residence			
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: frame			
24.	Foundation mate	rial: stuccoed 25. Roof type/material: side gable			
26.	No. Bays: Fron	t 3 Side 1 27. Wall treatment: vinyl siding			
28.	Plan shape: see site map 29. Changes: Addition? Altered? ye				
30.	Exterior condition: good 31: Open to public? no				
	Other Surveys in which included: Heritage/St. Louis survey, 1971				

to cover porch, supported by wrought-iron posts. Porch does not have solid sides like most in this group, instead having iron railings. Paired windows flank center doorway; windows are 1-over-1 replacements.

Dormer has triple windows and overhanging eaves, as does house. Roof extends

^{34.} History and Significance: See survey #24.



1.	No. 168		 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 651 				
2.	City/County: City of St. Louis, MO			•	_	isch, Landmarks A , St. Louis, MO	ssn. 63101
5.	Date: 8/15/91					uis Public Record	-
7.	Building? yes					tage/St. Louis fi estab. district?	
9.	Ownership: Private				road? Yes	11. Endangered	
2.	Original name:					<u> </u>	
3.	Present name/own	ner's name	•				
4.	Street address: 6036 Elizbeth			1	5. Style:	Queen Anne	
6.	Date(s): c. 1900						
7.	Architect: unknown			18. Buil	der: unkno	wn	
9.	Original Use: r	esidence	20.	Present	Use: resid	ence	
۱.	No. of stories:	2 22	. Basei	ment? yes	23. Wall	construction: fra	me
4.	Foundation mate	rial: sto	ne	25. Ro	of type/mat	erial: gabled	
6.	No. Bays: Front 3 Side 3			27. Wa	ll treatmen	t: (vinyl?) sidin	ıđ
8.	Plan shape: see site map 29.			Changes:	Addition?	Altered?	yes
0.	Exterior condition: good			31: 0	pen to publ	ic? no	
	Other Surveys in which included:				/St. Louis	4.054	

he first story slightly, the transitional area resembles a tambour door, curing around the rounded inside top of the bay window (photo); this motif is reseated at the bottom of the bay window. An open porch has a paneled cornice. To jecting bays on both side elevations. A 1971 Heritage/St. Louis photo shows nat the shingled area between floors on the front bay was (cont'd. below)

History and Significance: originally covered with imbrication; this is rtainly an unfortunate and unnecessary alteration. The porch railing in that oto is paneled to more or less match the cornice; while it probably was not iginal, it was more appropriate than the present treated-wood deck railing. building permits prior to c. 1925 are available for this city block.



1. No. 027	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102
2. City/Cou City of Louis, M	nty: St. 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn.
5. Date: 8/	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files
7. Building	? yes
9. Ownershi Private	p: 10. Visible from public road? Yes 11. Endangered? No
12. Original	name:
13. Present	name/owner's name:
14. Street a	ddress: 6039 Elizabeth 15. Style: Bungalow
16. Date(s):	c. 1926-29
17. Architec	t: unknown 18. Builder: unknown
19. Original	Use: residence 20. Present Use: residence
21. No. of s	tories: 1 1/2 22. Basement? yes 23. Wall construction: frame
24. Foundati	on material: stuccoed 25. Roof type/material: side gable
26. No. Bays	: Front 3 Side 2 27. Wall treatment: vinyl siding
28. Plan sha	pe: see site map 29. Changes: Addition? Altered? yes
30. Exterior	condition: good 31: Open to public? no
32. Other Su	rveys in which included: Heritage/St. Louis survey, 1971
appears to be centered dorm House roof ex	description of important features: The wider-width vinyl siding the only significant change from the original design. Large, her has overhanging eaves and triple windows with 3-over-1 panes. Stends to include full-width porch. Paired, 3-over-1 double-hung adows flank the center door.

^{34.} History and Significance: See survey #24.



1.	No. 026	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,				
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files				
9.	Ownership: Private	8. On National Register or part of estab. district? No. 10. Visible from public road? Yes 11. Endangered? No.				
12.	Original name:					
13.	Present name/ow	ner's name:				
14.	Street address:	6041 Elizabeth 15. Style: Bungalow				
16.	Date(s): c. 19	26–29				
17.	Architect: unk	nown 18. Builder: unknown				
19.	Original Use:	residence 20. Present Use: residence				
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry				
24.	Foundation mate	rial: stuccoed 25. Roof type/material: side gable				
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: textured brick				
28.	Plan shape: see	site map 29. Changes: Addition? Altered?				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971				
also exte	e frame dormer has found on the freends full width o	tion of important features: Very similar to survey #24-35. as overhanging eaves and triple, 3-over-1 panes, which are ont elevation. Roofline extends to form porch roof. Porch f the house and is supported by brick columns. Solid brick ired windows flank center doorway.				

^{34.} History and Significance: See survey #24.



Location of Negatives: Missouri Office of Historic

3.

History and Significance: See survey #24.

No. 025

1.

34.

1.	Preservation, P. O. Box 176, Jefferson City, MO 6510				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
	O	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No			
9.	Ownership: Private				
12.	Original name:				
13.	Present name/owner's name:				
14.	Street address:	: 6045 Elizabeth 15. Style: Bungalow			
16.	Date(s): c. 1926-29				
17.	Architect: unknown 18. Builder: unknown				
19.	Original Use: residence 20. Present Use: residence				
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry				
24.	Foundation material: stuccoed 25. Roof type/material: side gable				
26.	No. Bays: Front 3 Side 2 27. Wall treatment: red brick				
28.	Plan shape: see site map 29. Changes: Addition? Altered?				
30.	Exterior condition: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971			
exte of p hung	ele windows and o ends forward to co forch are solid a wood sash windo	tion of important features: Large front dormer features verhanging eaves, as does the rest of the house. House roof over porch across the width of the house. Short brick walls nd topped with a header course. 3-over-1, paired, double-ws flank the center doorway. Like many houses in the immed-oundation has been stuccoed to obscure the material.			



1.	No. 024	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files			
7.	Building? yes				
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/owner's name:				
14.	Street address: 6047 Elizabeth 15. Style: Bungalow				
16.	Date(s): c. 1926-29				
17.	Architect: unknown 18. Builder: unknown				
19.	Original Use: residence 20. Present Use: residence				
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: frame				
24.	Foundation material: stuccoed 25. Roof type/material: side gable				
26.	No. Bays: Front 3 Side 3 27. Wall treatment: asphalt shingles				
28.	Plan shape: see site map 29. Changes: Addition? Altered? yes				
30.	Exterior condition: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971			
	been reduced in	tion of important features: The windows of the large dormer size and the dormer sided. The roofline extends to form orted by tapering columns. Front windows are paired and			

have simple wood frames. This is one of 12 very similar houses in a row (survey #24 - 35), probably all built at nearly the same time and probably by the same

builder - H. C. Vollmar is a likely candidate (see survey #38 - 73).

^{34.} History and Significance: Building permits more recent than 1912 are not available for this city block. The reverse directory of 1930 shows the full complement of houses on Elizabeth from Knox to Sulphur; however, none of the residents are listed in the 1925 city directory (which does not have a reverse). This leads to the postulation that these 12 houses were built between those dates.



1.	No. 023	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 			
2.	City/County: City of St.	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn			
	Louis, MO	of St. Loui	is, 91	i7 Locust	t, 7th Floor, St. Louis, MO 6310
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files			
7.	Building? yes	8. On National Register or part of estab. district? No			
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/owner's name:				
14.	Street address: 6051 Elizabeth 15. Style: Composite				
16.	Date(s): 8/9/1909 - building permit				
17.	Architect: builder 18. Builder: George Aiman				
19.	Original Use: residence 20. Present Use: residence				
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: frame				
24.	Foundation material: stone 25. Roof type/material: gabled/pyrami				
26.	No. Bays: Front 2 Side 3 27. Wall treatment: aluminum siding				
28.	Plan shape: see site map 29. Changes: Addition? ? Altered? yes				
30.	Exterior condition: good 31: Open to public? no				
32.	Other Surveys i	n which include	led:	Heritage	e/St. Louis survey, 1971
roof	en with this houseline has a small	e when the alu gable in from	uminum	m siding d an odd	: It appears that liberties were was applied. A truncated pyrami, multi-level roofline over the entrance, appears to be either an

addition or a much-altered original feature.

^{34.} History and Significance: Walter J. Lewis, a real estate broker, commissioned contractor George Aiman to build this house for \$2,000 in 1909.



		<u> </u>		
1.	No. 022	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102		
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101		
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files		
7.	Building? yes			
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No		
12.	Original name:			
13.	Present name/owner's name:			
14.	Street address:	reet address: 6055 Elizabeth 15. Style: Colonial Revival		
16.	Date(s): 1/25/1911 - building permit			
17.	Architect: unknown 18. Builder: John L. Williams			
19.	Original Use: residence 20. Present Use: residence			
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: frame			
24.	Foundation material: stone 25. Roof type/material: gambrel/asph			
26.	No. Bays: Front 3 Side 1 27. Wall treatment: siding & brick			
28.	Plan shape: see site map 29. Changes: Addition? Altered? porc			
30.	Exterior condit	ion: fair/good	31: Open to public? no	
32.	Other Surveys i	n which included	l: Heritage/St. Louis survey, 1971	
body sibl	house extends a of the house is y of metal, desi	narrow brick ad frame, covered gned to resemble	at features: Across the front elevation of dition, probably an infilled porch. The with an unusual, orange-colored siding, pose brick - which it closely does. The roof and east side elevations; the front	

^{34.} History and Significance: located on the west side. A bay window projects from the first story of the west side.

gable has a palladian-type window. A hipped-roof dormer is (cont'd. below)

Frank Templin, a secretary for the St. Louis Bindery Co. on S. 9th, hired contractor John L. Williams to build this house in 1911 for \$2,400. The Daily Record for this date was not filmed, so we have no architect's name.



1.	No. 021	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files			
7.	Building? yes				
9.	· · · · · · · · · · · · · · · · · · ·				
12.	Original name:				
13.	Present name/owner's name:				
14.	Street address: 6101 Elizabeth 15. Style: Open Gable/Bungaloi				
16.	Date(s): 7/18/1923 - building permit				
17.	Architect: none 18. Builder: John M. Brockett				
19.	Original Use: residence 20. Present Use: residence				
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: masonry				
24.	Foundation material: stone 25. Roof type/material: front gable				
26.	No. Bays: Front 3 Side 2 27. Wall treatment: brown brick				
28.	Plan shape: see site map 29. Changes: Addition? Altered?				
30.	Exterior condition: good 31: Open to public? no				
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971				
33.	Further descrip	tion of important features: A heavy, brick-pillared porch			

extends across the front of this house. All openings except first story front windows (which are flat arches) are segmentally arched. Brick sills. Soldier

course just above foundation. Rear frame porch.

^{34.} History and Significance: Rose Brockett, a clerk, appears on the building permit as the owner; she lived across the street at 6120 Elizabeth, as did builder John Brockett in 1924. In 1925, however, he lived at 6101 while she remained at 6102; they may have been brother and sister. By 1930, Theo Cook lived here and both Brocketts were out of the area.



1.	No. 020	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	e: 8/15/91 6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis file				
7.	Building? yes					
9.	8. On National Register or part of estab. die 9. Ownership: Private 10. Visible from public road? Yes 11. End					
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address: 6103 Elizabeth 15. Style: Open Gable/Tudor					
16.	Date(s): c. 1926-29					
17.	Architect: unknown 18. Builder: unknown					
19.	Original Use:	residence 20. Present Use: residence				
21.	No. of stories: 1 22. Basement? yes 23. Wall construction: mason					
24.	Foundation material: stone 25. Roof type/material: front gab					
26.	No. Bays: Front 2 Side 4 27. Wall treatment: multichrome bric					
28.	Plan shape: see site map 29. Changes: Addition? Altered??					
30.	Exterior condition: good 31: Open to public? no					
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971					

of this house appears to be a possibly late-1950s alteration. Narrow, coursed stone has been applied to the lower front elevation. The round-arched front door features double rowlock brick and provides a hint at an attempt at Tudor detailing. Side windows have flat arches. At the top of the gable, a small wood crest appears, along with a pointed-arched attic vent.

^{34.} History and Significance: The active building permits (1924 and later) for this city block are unavailable. Bank teller Raymond Boniface is listed at this address in 1930, but not in 1925; it appears that he had it built between 1925 and 1929.



1.	No. 167	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510. 			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files			
7.	Building? yes	8. On National Register or part of estab. district? No			
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/owner's name:				
14.	Street address: 6110 Elizabeth 15. Style: Queen Anne				
16.	Date(s): c. 19	00			
17.	Architect: unk	nown 18. Builder: unknown			
19.	Original Use: r	esidence 20. Present Use: residence			
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame			
24.	Foundation mate	rial: stone 25. Roof type/material: complex			
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: asphalt siding			
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes			
30.	Exterior condit	ion: fair/good 31: Open to public? no			
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971			
32. 33.		tion of important features: Somewhat similar in design			

house next door (survey #166). The projecting front gable has cut-outs at the first story to form a straight-sided bay window. Porch in northwest corner is enclosed, possibly original or similar to it. 2-story (east) side bay window. 1-over-1 double-hung sash.

^{34.} History and Significance: Inactive building permits are missing for this city block; Heritage/St. Louis files show Charles Goodale, clerk at Pac. Exp. Co. and member of Fry Methodist Church, lived here in 1901.



1.	No. 019	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. 4. Prepared by: Cynthia Hill Longwisch, Landmarks Ass Louis, MO of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files				
7.	Building? yes					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address: 6111 Elizabeth 15. Style: Craftsman					
16.	Date(s): 11/26	/1923 - building permit				
17.	Architect: Hen	ry Schaumberg, Jr 18. Builder: Fred Engelhardt				
19.	Original Use:	residence 20. Present Use: residence				
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: masonry				
24.	Foundation mate	rial: stone 25. Roof type/material: front gable				
26.	No. Bays: Fron	t 3 Side 4 27. Wall treatment: textured brick				
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered?				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971				
33.	Further descrip	tion of important features: Multichrome textured brick was				

- 33. Further description of important features: Multichrome textured brick was used for this house, which features soldier arches and stone lintels on the Eront elevation and similar lintels or jack arches on the side elevations. Winlows are paired; upper story front windows are highlighted by inset stonework. I brick-pillared open porch extends across much of the front elevation. Eaves leature wide overhangs. Windows are 6-over-1 double-hung wood sash.
- 4. History and Significance: Helen Hartwig hired architect Henry Schaumberg, r. and stonecutter/builder Fred Engelhardt to build this house for \$3,500 in 923. Hartwig does not appear in subsequent directories. Owner Dan Simpson ad the 1-story rear sunroom added in 1949 for \$800.



No. 166

1.

3. Location of Negatives: Missouri Office of Historic

Preservation, P. O. Box 176, Jefferson City, MO 65102

2.	City/County:	4 6 6 1					
4.	City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91					on: St. Louis Public Records, Soc.; Heritage/St. Louis files	
7.	Building? yes						
9.	Ownership:	8. On Nati	iona]	Regist	er	or part of estab. district? No	
	Private	10. Visible	e fro	om publi	.c r	road? Yes 11. Endangered? No	
12.	Original name:						
13.	Present name/ow	ner's name:					
14.	Street address:	6116 Elizabe	eth		15	5. Style: Queen Anne	
16.	Date(s): c. 19	00					
17.	Architect: unk	nown		18. Bu	ıild	der: unknown	
19.	Original Use: r	esidence	20.	Presen	ıt U	Use: residence	
21.	No. of stories:	2 22. I	Baser	ment? ye	s	23. Wall construction: frame	
24.	Foundation mate	rial: stone		25.	Roc	of type/material: complex	
26.	No. Bays: Fron	t 2 Side 2		27.	Wal	ll treatment: (vinyl?) siding	
28.	Plan shape: see	site map	29.	Change	:5:	Addition? Altered? yes	
30.	Exterior condit	ion: good		31:	31: Open to public? no		
32.	Other Surveys i	n which includ	led:	Herita	ıge/	/St. Louis survey, 1971	
doub out righ	shingles of this tless gone with corners at the f at, a shallow she	house remain the modernizat irst story to d-roof dormer	inta tion form	act, but process a stra as out c	s. A nigh	The undulating patterned roof- ome of the original detailing is A projecting front gable has cut- ht-sided bay window. To the r a long slope above an enclosed ws are 1-over-1. (cont'd. below)	
2.4	77.2 - 1						

34. History and Significance: At the west side, two successively smaller shedlike, windowless bays project; these are apparently original. On the east side, a two-story bay window projects, featuring a nearly conical roof (visible in

The inactive (pre-1925) building permits for this city block are unavailable,

photo for survey #167, at right).

precluding definite dating.



1.	No. 165	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 631				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files				
7.	Building? yes	8. On National Register or part of estab. district? N				
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? N				
12.	Original name:	Original name:				
13.	Present name/owner's name:					
14.	Street address: 6126 Elizabeth 15. Style:					
16.	Date(s): c. 19	00				
17.	Architect: unk	nown 18. Builder: unknown				
19.	Original Use: r	esidence 20. Present Use: residence				
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame				
24.	Foundation mate	rial: stone 25. Roof type/material: hipped				
26.	No. Bays: Fron	t 3 Side 2 27. Wall treatment: aluminum siding				
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes				
30.	Exterior condit	ion: good 31: Open to public? no				
	Other Surveys in which included: Heritage/St. Louis survey, 1971					

almost certainly an open, Queen Anne design before aluminization occurred. Paired windows on front elevation; all are 1-over-1 double-hung sash. Rear

wood deck at second story.

^{34.} History and Significance: No inactive building permits (pre-1925) are available for this city block. Heritage/St. Louis files show S. Serl, clerk, living here in 1901. He and his wife Kate were members of the Fry Methodist Church.



1.	No. 164	3. Location of Negatives: Missouri Office of Historic					
		Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership:	8. On National Register or part of estab. district? No					
	Private	10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address:	6128 Elizabeth 15. Style: Queen Anne					
16.	Date(s): c. 18	90					
17.	Architect: unk	nown 18. Builder: unknown					
19.	Original Use: r	esidence 20. Present Use: residence					
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: stuccoed 25. Roof type/material: complex					
26.	No. Bays: Fron	t 2 Side 2 27. Wall treatment: (vinyl?) siding					
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					

- 33. Further description of important features: The hipped and gabled roof of this house is covered with undulating patterned shingles. The paired windows on the front elevation are 2-over-2 double-hung sash. A gabled porch roof is supported by non-original wrought-iron pillars; iron railing. Projecting side gable. 2-story rear frame porch. Probably much of the original detailing of this house was lost in the siding/modernization process.
- 34. History and Significance: Inactive building permits for this city block are unavailable. Mrs. Marian Alley Traughber, in a 1971 letter to Heritage/St. Louis, says that she moved into this house as a child in 1907-08. She says that at that time it was "a very old house in run-down condition. My father installed a bathroom, cemented the basement floor, and put in a furnace. ...the whole lot to the west was our lawn." "Very old" is of course a relative term and a difficult one to assess considering her child's viewpoint



1.	No. 018 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102							
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes	8. On National Register or part of estab. district? No						
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:							
13.	Present name/owner's name:							
14.	Street address:	6131 Elizabeth 15. Style: Open Gable						
16.	Date(s): c. 19	20						
17.	Architect: unk	nown 18. Builder: unknown						
19.	Original Use:	residence 20. Present Use: residence						
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: br/frame						
24.	Foundation mate	rial: stone 25. Roof type/material: front gable						
26.	No. Bays: From	t 3 Side 1 27. Wall treatment: brown & red brick						
28.	Plan shape: see	site map 29. Changes: Addition? Altered?						
30.	Exterior condit	ion: good 31: Open to public? no						
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971						
	rame, covered wi	tion of important features: The front gable of this house th siding. The lower story features a buff/grey brick inder of the house brown brick; a double-row string course						

of red brick crosses the front of the house at sill level, somewhat higher on the sides and rear. Windows have flat arches. A concrete front porch the width

of the house has a shed roof supported by decorative iron posts.

^{34.} History and Significance: Building permits are unavailable for this city block prior to the 1940s. Later permits indicate that the front porch was poured in 1971.



1.	No. 163 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	y/County: y of St. 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn.					
5.	Date: 8/15/91	i e				Public Records, e/St. Louis files	
7.	Building? yes					<u> </u>	
9.	Ownership:	8. On Nati	onal	Register —-	or part of est	tab. district? No	
	Private	10. Visible	from	n public :	road? Yes 1	l. Endangered? No	
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 6136 Elizabeth			1	5. Style: Bu	ngalow	
16.	Date(s): c. 19	 25	_				
17.	Architect: unk	nown	1	18. Buil	der: unknown		
19.	Original Use: r	esidence	20.	Present	Use: residence	9	
21.	No. of stories:	1 1/2 22. B	Baseme	ent? yes	23. Wall cons	struction: frame	
24.	Foundation mate	rial: stuccoe	ed	25. Ro	of type/materia	al: side gable	
26.	No. Bays: Fron	t 2 Side 2		27. Wa	ll treatment: a	asbestos siding	
28.	Plan shape: see	site map	29.	Changes:	Addition?	Altered?	
30.	Exterior condit	ion: good		31: 0	pen to public?	no	
32.	Other Surveys i	n which includ	led:	Heritage	/St. Louis sur	vey, 1971	
	_	ver-1 double-h	ung :	sash wind	ows, repeated 1	bled dormer of this below at the front idth porch, sup-	

ported by tapered pillars sheathed in siding. A shed-roof dormer is on the rear

elevation. The house is built on a steep grade with much of the foundation

exposed. A concrete block retaining wall flanks the driveway.

^{34.} History and Significance: Building permits issued prior to late 1925 are unavailable for this city block. Other nearby houses similar to this with known building permits date to c. 1920-27. William A. Moore, of Moore Co. (auto accessories) lived here in 1930, but elsewhere in 1925, making a late 1924 or early 1925 date fairly likely.



1. N	io. 017	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
C	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310						
5. I	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7. I	Building? yes							
9. 0	Ownership:	8. On National Register or part of estab. district? No						
I	Private	10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:							
13. I	Present name/owner's name:							
14. 5	Street address:	6137 Elizabeth 15. Style: vernacular/Italianato						
16. I	Date(s): c. 19	10						
17.	Architect: unk	nown 18. Builder: unknown						
19. (Original Use:	residence 20. Present Use: residence						
21. N	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry						
24. I	Foundation mate	rial: stone 25. Roof type/material: gabled/asphal						
26. N	No. Bays: Fron	t 3 Side 1 27. Wall treatment: painted brick/frame						
28. I	Plan shape: see	site map 29. Changes: Addition? 2nd fl.Altered?						
30. I	Exterior condit	ion: good 31: Open to public? no						
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971						
sister pletel elevat course	r to survey #14 ly different loc tion feature ga e. A stone str	tion of important features: This house was originally a -16. A gabled frame "second story" gives the house a comok from the others. Two round-arched windows on the front uged brick and stone and a dogtooth pressed-brick string ing course at sill level highlights the front elevation. mentally arched. A corbeled and (cont'd. below)						

^{34.} History and Significance: dentilled brick cornice crosses the front elevation. An open porch is supported by a brick pillar at the corner.

No building permits are available before c. 1940s for this city block.



1.	No. 016	1	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared h						
5.	Date: 8/15/91	<u>}</u>	f information: St. Louis Public Records, Historical Soc.; Heritage/St. Louis files					
7.	Building? yes							
9.	Ownership:	8. On Nationa	al Register or part of estab. district? No					
	Private	10. Visible fr	rom public road? Yes 11. Endangered? No					
12.	Original name:							
13.	Present name/owner's name:							
14.	Street address:	6139 Elizabeth	15. Style: vernacular/Italianate					
16.	Date(s): 4/28/	1896 - building p	permit					
17.	Architect: bui	lder	18. Builder: Frein Building Company					
19.	Original Use:	residence 20). Present Use: residence					
21.	No. of stories:	1 22. Base	ement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: stone	25. Roof type/material: flat					
26.	No. Bays: Fron	t 3 Side	27. Wall treatment: red brick					
28.	Plan shape: see	site map 29.	. Changes: Addition? Altered? porch					
30.	Exterior condit	ion: good	31: Open to public? no					
32.	Other Surveys i	n which included	: Heritage/St. Louis survey, 1971					
	** 13							

^{33.} Further description of important features: Single front elevation window is round-arched with soldier arch and string course molding. Corbeled brick cornice features brick dentilling. Porch has been infilled with frame construction. Terra cotta coping.

^{34.} History and Significance: [The building permits for this house and for survey #14 were found filed with those of another city block.] Marie A. Petzold had the Frein Building Co. to build this house in 1896 for \$800. The company was located at 1113 Chestnut and the firm's president later built 6145 Elizabeth (#14) for himself.



1.	No. 015	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records City Hall; MO Historical Soc.; Heritage/St. Louis fil	-				
7.	Building? yes						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address:	6141 Elizabeth 15. Style: vernacular/Italia	nate				
16.	Date(s): c. 19	00					
17.	Architect: unk	nown 18. Builder: unknown					
19.	Original Use:	residence 20. Present Use: residence					
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: maso	nry				
24.	Foundation mate	rial: stone 25. Roof type/material: flat					
26.	No. Bays: Fron	t 3 Side 1 27. Wall treatment: red brick					
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered?					
30.	Exterior condit	ion: fair/good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					

^{33.} Further description of important features: Dentilled, corbeled brick cornice. Round-arched windows in front elevation are highlighted by gauged-brick and stone arches topped by a course of dogtooth pressed brick. Stone sills. Transom over door. Terra cotta coping. Rear frame porch addition dates to 1961.

^{34.} History and Significance: No building permits are available for this city block before c. 1940s, except for two found misfiled; these happen to be immediately on either side of this house and are very similar, hence the circa date.



1.	No. 014						
2.	City/County: City of St. Louis, MO	Preservation, P. O. Box 176, Jefferson City, MO 65102 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 6145 Elizabeth 15. Style: vernacular/Italian						
16.	Date(s): 7/10/	1899 - building permit					
17.	Architect: bui	lder 18. Builder: Frein Building Company					
19.	Original Use:	residence 20. Present Use: residence					
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: stone 25. Roof type/material: flat					
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: red brick					
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971						

brick dentilling. An ell of the floorplan has been infilled with a small brick

porch. Terra cotta coping.

^{34.} History and Significance: [The building permit for this house and for survey #16 were found filed with those of another city block.] W. J. Frein, president of the Frein Building Co., took out the permit for this house at a cost of \$900 in 1899. Frein is listed as living at this address in the 1900 city directory; this seems unusual, considering the modest size of the building, but perhaps Frein's company was of equally modest size.



1.	No. 140	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91				tion: St. Lo al Soc.; Her			
7.	Building? yes							
9.	Ownership: Private				er or part of c road? Yes		district? Indangered?	No No
12.	. Original name:							
13.	Present name/owner's name:							
14.	Street address:	6166 Eli	zabeth		15. Style:	Colonia	ıl Revival	
16.	Date(s): c. 19	25						
17.	Architect: unk	nown		18. Bu	ilder: unkno	own		
19.	Original Use: r	esidence	20.	Presen	t Use: resid	lence		
21.	No. of stories:	2 22	. Baser	ment? ye	s 23. Wall	construc	ction: frame	•
24.	Foundation mate	rial: con	crete	25.	Roof type/mat	erial:	side gable	
26.	No. Bays: Fron	t 4 Sid	e 3	27.	Wall treatmen	nt: alumi	num siding	
28.	Plan shape: see	site map	29.	Change	s: Addition	?	Altered? ye	25
30.	Exterior condit	ion: good		31:	Open to pub	lic? no		
32.	Other Surveys in	n which in	cluded:	Herita	ge/St. Louis	survey,	1971	
	Further descripte may have false tood brackets. A	muntins.	A gable	ed frame	hood over th	ne door i	s supported	

The house is built on a steep grade with a portion of the basement extending forward in the driveway to provide both a garage and an unroofed, patiolike

porch.

^{34.} History and Significance: The active building permits for this city block begin c. 1926 and go to the present. Those filed before 1926 were not microfilmed and are lost to the public at this time. National Bank of Commerce clerk Ralph Schmitt lived in this house in 1930, but was not here in 1925; this information and the correlation of similar, dated houses lead to the circa date.



1.	No. 013	1	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101							
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files							
7.	Building? yes								
9.	Ownership:	8. On Nat	ional	Registe	r or part of	estab. district? No			
	Private	10. Visible from public road? Yes 11. Endangered? No							
12.	Original name:	_							
13.	Present name/owner's name:								
14.	Street address: 6205 Elizabeth 15. Style: Composite								
16.	Date(s): c. 18	90							
17.	Architect: unknown 18. Builder: unknown								
19.	Original Use:	20.	Presen	Present Use: residence					
21.	No. of stories:	2 22.	Basem	ent? yes	23. Wall	construction: frame			
24.	Foundation mate	rial: stone		25. R	oof type/mat	erial: gabled/pyramic			
26.	No. Bays: Fron	t 3 Side 3	}	27. W	all treatmen	t: vinyl siding			
28.	Plan shape: see site map 29. Changes: Addition? Altered?					Altered? yes			
30.). Exterior condition: good 31: Open to public? no					ic? no			
32.	2. Other Surveys in which included: Heritage/St. Louis surv					survey, 1971			
33.	Further description of important features: The truncated pyramidal roof-								

- 33. Further description of important features: The truncated pyramidal roof-line is interrupted by various gables on this house. Possibly closer to Queen Anne in original styling, this house unfortunately has had several windows covered up with siding. A corner porch, although new, appears to retain its basic original design, albeit lacking embellishments. An oval-glass door remains. This house is an unfortunate victim of modernization.
- 34. History and Significance: No building permits were available for this city block. Heritage/St. Louis files state that "during [the] period of 1892-1907 various Episcopalian religious functions baptisms marriages funerals took place at this address. The Rev. Collins lived at 6275 Famous in 1898 not listed in 1892 or 1895. Perhaps his predecessor or successor lived here."



							
1.	No. 012	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership: Private	8. On National Register or part of estab. district? No. Visible from public road? Yes 11. Endangered? No. Visible from public road?					
12.	Original name:	e:					
13.	Present name/owner's name:						
14.	Street address: 6209 Elizbeth 15. Style: Queen Anne						
16.	Date(s): c. 1905						
17.	Architect: unk	nown		18. Builder: unknown			
19.	Original Use: residence 20.			. Present Use: residence			
21.	No. of stories:	2 22.	Baser	ment? yes 23. Wall construction: frame			
24.	Foundation mate	rial: stone		25. Roof type/material: gabled/pyramid			
26.	No. Bays: Fron	t 3 Side 5		27. Wall treatment: vinyl siding			
28.	Plan shape: see site map 29.			Changes: Addition? Altered? yes			
30.	Exterior condition: good			31: Open to public? no			
32.	Other Surveys i	n which inclu	ded:	Heritage/St. Louis survey, 1971			
33.	Further descrip	tion of impor	tant	features: A polygonal tower with conical			

roof emerges at the corner from the porch roof. The porch fascia features imbricated wood shingles; turned posts below may be replacements. Door has a transom. Windows have all been replaced. Roofline is irregular, with a pyramidal roof interrupted by gables.

^{34.} History and Significance: No building permits were available for this house. It does not appear in a 1901 listing of neighborhood homeowners.



1.	No. 011	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership:	8. On Na	tional	Register	or part of est	ab. district? No	
	Private	10. Visib	le fro	m public	road? Yes 11	. Endangered? No	
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 6215 Elizabeth 15. Style: Composite						
16.	Date(s): c. 1905						
17.	Architect: unknown 18. Builder: unknown						
19.	. Original Use: residence 20. Present Use: residence					:e	
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: frame					truction: frame	
24.	Foundation material: stone 25. Roof type/material: gabled/pyrami						
26.	No. Bays: Front 3 Side 5 27. Wall treatment: vinyl siding						
28.	Plan shape: see site map 29. Changes: Addition? Altered? yes						
30.	Exterior condition: good 31: Open to public? no						
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971						
	Further descriptions side bay is cut one windows app	out at the	first	story con	ners for angled		

infilled to create a room.

^{34.} History and Significance: No building permits are available for this city block. The house does not appear on a 1901 list of area homeowners.




1.	No. 010	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes							
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:							
13.	Present name/owner's name:							
14.	Street address: 6219 Elizabeth 15. Style: Composite							
16.	Date(s): c. 1905							
17.	Architect: unknown 18. Builder: unknown							
19.	Original Use: residence 20. Present Use: residence							
21.	No. of stories:	2 22.	Baseme	ent? yes	23. Wall	construct	ion: frame	
24.	Foundation mate	rial: stone		25. Ro	of type/mat	erial: g	abled/pyramid	
26.	No. Bays: Front 3 Side 2 27. Wall treatment: asbestos siding						os siding	
28.	Plan shape: see	site map	29.	Changes:	Addition?	A	ltered? yes	
30.	Exterior condition: good 31: Open to public? no							
32.	Other Surveys is	n which inclu	ıded:	Heritage	/St. Louis	survey, 1	971	
now on t	Further descript to extensive shruinfilled with glands the east side has tron railing. The	ubbery) featu ass brick. W triple frenc	ires an Nindows ch door	unornam tend to s (possi	ented pedimo be paired. bly infilli	ent and s A one-s ng a gara	idelights tory addition ge bay) and	

^{34.} History and Significance: or part of the original plans. A central, truncated pyramid roof features multiple gables.

not clear if these were garages, later additions, (cont'd. below)

No building permits were available for this house; it does not appear on a list of local homeowners from 1901, however.

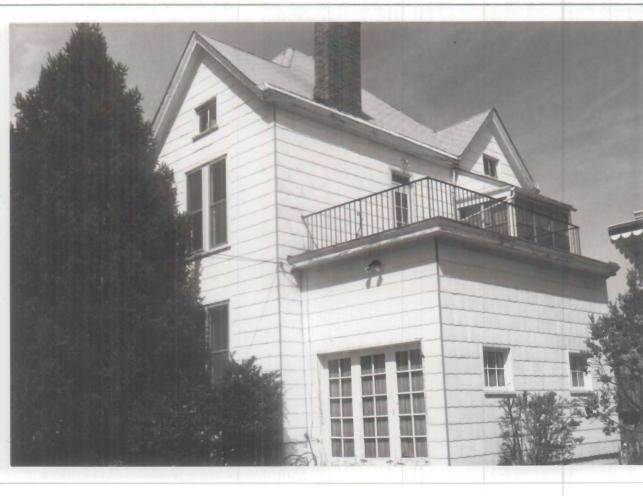

!										
. •	No. 009	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510								
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 631(
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files								
7.	Building? yes						Nc.			
9.	Ownership: Private	8. On National Register or part of estab. district? No. 10. Visible from public road? Yes 11. Endangered? No.								
12.	Original name:	<u> </u>	······································							
13.	Present name/ow	ner's	name:							
14.	Street address: 6223 Elizabeth 15. Style: Composite									
16.	Date(s): c. 1905									
17.	Architect: unknown				18. B	uild	ler: unknow	wn.		
19.	Original Use: residence 20.				. Pres	Present Use: residence				
21.	No. of stories: 2 22. Basem				ment? y	ent? yes 23. Wall construction: frame				
24.	Foundation material: stone			25. Roof type/material: gabled asphal						
26.	No. Bays: Front 3 Side 2				27.	27. Wall treatment: asbestos siding				
28.	Plan shape: see	site	map	29.	Change	es:	Addition?		Altered?	-
30.	Exterior condition: good				31:	31: Open to public? no				
32.	Other Surveys i	n whic	h inclu	ded:	Herit	age,	St. Louis	survey	, 1971	
33.	Further descrip front bay with o		_							

jecting side bay. Front windows are paired; most are one-over-one double-hung

sash. Eave provides a slight overhang above entrance.

^{34.} History and Significance: No building permits were available for this city block; however, a list of area residents from 1901 fails to list this house.



1.	No. 008	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102							
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101							
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,							
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files							
9.	Ownership:	8. On National Register or part of estab. district? No							
-	Private	10. Visible from public road? Yes 11. Endangered? No							
12.	Original name:								
13.	Present name/owner's name:								
14.	Street address: 6229 Elizabeth 15. Style: Queen Anne								
16.	Date(s): c. 1895								
17.	Architect: unknown 18. Builder: unknown								
19.	Original Use:	residence 20. Present Use: residence							
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: fr/brich							
24.	Foundation mate	rial: stone 25. Roof type/material: pyramid/gabled							
26.	No. Bays: Front 3 Side 3 27. Wall treatment: brick/asbestos								
28.	Plan shape: see site map 29. Changes: Addition? Altered?								
30.	Exterior condition: good 31: Open to public? no								
32.	Other Surveys in	n which included: Heritage/St. Louis survey, 1971							
33.	Further description of important features: Square corner tower is pyramid-								

ally roofed and rests on corner porch. Porch features imbricated wood shingles. Roof is truncated pyramid with gables and dormers. Upper story is frame, covered with asphalt siding; lower story is brick, with segmentally arched openings, the window in the projecting bay having pressed brick hood molding. Stone sills at first story. Front door has transom.

^{34.} History and Significance: A Fry Memorial Methodist Church member, William Hazenstaub, occupied this house in 1895, according to Heritage/St. Louis files. Mrs. Hazenstaub continued to live here after her husband's death, moving to 4359 Chouteau in 1908. No building permit is available. House is similar to survey 16, 6239 Elizabeth.



1.	No. 007	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files						
7.	Building? yes							
9.	Ownership:	8. On National Register or part of estab. district? No						
	Private	10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:							
13.	Present name/ow	ner's name:						
14.	Street address:	6233 Elizabeth 15. Style: Crossplan						
16.	Date(s): c. 19	00						
17.	Architect: unk	nown 18. Builder: unknown						
19.	Original Use:	residence 20. Present Use: residence						
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame						
24.	Foundation mate	rial: stone 25. Roof type/material: cross gable*						
26.	No. Bays: Fron	t 3 Side 2 27. Wall treatment: asbestos siding						
28.	Plan shape: see	site map 29. Changes: Addition? Altered?						
30.	Exterior condit	ion: good 31: Open to public? no						
32.	Other Survevs i	n which included: Heritage/St. Louis survey, 1971						

^{33.} Further description of important features: *The roofline of this house features a truncated pyramid in the center of the cross gables. Windows appear to be replacements and are 1-over-1 double-hung sash, often in pairs. A small concrete pad without roof serves as a porch; there is no evidence that there ever was a full porch. Front door features a transom. One window on the primary elevation is boarded.

^{34.} History and Significance: Although no building permit is available for this house, Heritage/St. Louis files record that Fry Methodist Church members Addison and Florence Hermans lived here in 1901.



1.	No. 006	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102							
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101							
5.	Date: 8/15/91	•	f information: St. Louis Public Records,						
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files							
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No							
12.	Original name:	<u> </u>	•						
13.	Present name/ow	ner's name:	er's name:						
14.	Street address:	6239 Elizabeth 15. Style: Queen Anne							
16.	Date(s): c. 18	95							
17.	Architect: unk	nown	18. Builder: unknown						
19.	Original Use:	residence 2	0. Present Use: residence						
21.	No. of stories:	2 1/2 22. Base	ement? yes 23. Wall construction: fr/brick						
24.	Foundation mate	rial: stone	25. Roof type/material: pyramid/gabled						
26.	No. Bays: Fron	t 3 Side 2	27. Wall treatment: clapboards & brick						
28.	Plan shape: see	site map 29	. Changes: Addition? Altered? yes						
30.	Exterior condit	ion: good	31: Open to public? no						
			: Heritage/St. Louis survey, 1971						

ization, albeit unintentional. The corner tower sports a single-paned storm window over a 1-over-1 double-hung sash; its vertical siding gives it a curious,

rocketlike look. Below, the corner porch features imbricated wood shingles.

Pre-1930 building permits were unavailable.

original use as a duplex.

The first story is of brick, and features segmental soldier (cont'd. below)

34. History and Significance: arches and hood molding on the windows, with stone sills. Narrow horizontal clapboarding or siding covers the second story, flaring out as it meets the brick. Front doors are doubled, indicating an



1.	No. 005	!		_				e of Historic n City, MO 65	
2.	City/County: City of St. Louis, MO	-	_	_		-		Landmarks Ass Louis, MO 63	
5.	Date: 8/15/91	1						olic Records,	
7.	Building? yes								 No
9.	Ownership: Private					pad? Yes	11.	Endangered?	
12.	Original name:						i		
13.	Present name/ow	ner's name:							
14.	Street address:	6243 Elizab	eth		15.	. Style:	Queen	Anne	
16.	Date(s): c. 19	00							
17.	Architect: unk	nown	the state of the s	18. B	uilde	er: unkno	wn		
19.	Original Use:	residence	20.	Pres	ent (Jse: resi	dence		
21.	No. of stories:	2 1/2 22.	Basen	ment? y	es	23. Wall	constru	uction: frame	!
24.	Foundation mate	rial: stone		25.	Roof	f type/mat	erial:	trunc. pyra	mid
26.	No. Bays: Fron	t 3 Side 3		27.	Wall	l treatmen	t: asb	estos siding	_
28.	Plan shape: see	site map	29.	Chang	es:	Addition?		Altered?	
30.	Exterior condit	ion: fair/goo	d	31:	Ope	en to publ	ic? no	o	
32.	Other Surveys i	n which inclu	ded:	Herita	age/S	St. Louis	survey	, 1971	
33.	Further descrip	tion of impor	tant	featur	es:	A round c	orner t	tower with	_

vindow. Majority of the windows are one-over-one double-hung sash.

conical roof highlights the corner porch. Front gable features a round-arched

^{4.} History and Significance: Pre-1930 building permits were unavailable or this city block.



				_						
1.	No. 200 3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510									
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101								
5.	Date: 8/15/91	6. Cit							blic Records t. Louis fil	
7.	Building? yes									
9.	Ownership:	8.	8. On National Register or part of estab. district? No						NO.	
	Private	10.	Visibl	e fro	om publ	ic 1	road? Yes	11.	Endangered?	No
12.	Original name:	name:								
13.	Present name/ow	ner's	name:							
14.	Street address:	2328	Esther			15	5. Style:	Queen	Anne	
16.	Date(s): c. 19	10				<u> </u>				
17.	Architect: unk	nown			18. B	uild	der: unkno	wn		
19.	Original Use: r	esiden	ce	20.	Prese	nt (Jse: resid	ence		
21.	No. of stories:	2	22.	Baser	ment? y	es	23. Wall	constr	uction: fram	e
24.	Foundation mate	rial:	obscur	ed	25.	Roc	of type/mat	erial:	complex	
26.	No. Bays: Fron	t 3	Side 2		27.	Wal	ll treatmen	t: non-	-wood siding	
28.	Plan shape: see	site	map	29.	Chang	es:	Addition?	,	Altered?	
30.	Exterior condit	ion: fa	air/goo	d	31:	Oı	pen to publ	ic? no	0	
32.	Other Surveys i	n which	h inclu	ded:	Herit	age,	/St. Louis	survey	, 1971	
			·							

^{33.} Further description of important features: Although this house has had good recent maintenance, the walls do not appear true to the naked eye, especially at the right side. The house has a combination hipped and gabled roof. Windows are 6-over-6 replacements. A small shed-roof porch is tucked into the corner of the ell; its balustrade and railing appear to be new.

^{34.} History and Significance: No pre-1926 building permits are available for this city block.



ity/County: ity of St. ouis, MO ate: 8/15/91 uilding? yes	4. Prepared of St. Louis 6. Sources City Hall; M	by: Cyr , 917 Lo	thia cust	Box 176, Jefferson City, MO 6510 Hill Longwisch, Landmarks Assn., 7th Floor, St. Louis, MO 6310 on: St. Louis Public Records,
uilding? yes	City Hall; N			on: St Iouig Public Records
		10 111201		Soc.; Heritage/St. Louis files
wnershin.		nal Regi		or part of estab. district? No
rivate				
riginal name:				
resent name/own	ner's name:			
treet address:	2331 Esther		1	5. Style: Bungalow
ate(s): 11/25,	/1925 - buildir	ng permit		
rchitect: buil	lder	18.	Buile	der: Guarantee Construction Co.
riginal Use: re	esidence	20. Pres	ent I	Use: residence
o. of stories:	1 1/2 22. Ba	asement?	yes	23. Wall construction: masonry
oundation mater	rial: concrete	25	Ro	of type/material: side gable
o. Bays: Front	Side 3	27	Wa	ll treatment: multichrome brick
lan shape: see	site map	29. Char	rges:	Addition? Altered?
xterior conditi	ion: good	31	L: O]	pen to public? no
ther Surveys in	n which include	ed: Heri	tage	/St. Louis survey, 1971
	riginal name: resent name/own treet address: ate(s): 11/25, rchitect: buil riginal Use: re o. of stories: oundation mater o. Bays: Front lan shape: see xterior condit: ther Surveys in	riginal name: resent name/owner's name: treet address: 2331 Esther ate(s): 11/25/1925 - building rchitect: builder riginal Use: residence o. of stories: 1 1/2 22. Bactoundation material: concrete o. Bays: Front 3 Side 3 lan shape: see site map xterior condition: good ther Surveys in which include urther description of importations.	riginal name: resent name/owner's name: treet address: 2331 Esther ate(s): 11/25/1925 - building permit rchitect: builder 18. riginal Use: residence 20. Pres o. of stories: 1 1/2 22. Basement? oundation material: concrete 25. o. Bays: Front 3 Side 3 27. lan shape: see site map 29. Char xterior condition: good 31 ther Surveys in which included: Heri urther description of important featur	riginal name: resent name/owner's name: treet address: 2331 Esther 1 ate(s): 11/25/1925 - building permit rchitect: builder 18. Buil riginal Use: residence 20. Present o. of stories: 1 1/2 22. Basement? yes oundation material: concrete 25. Ro o. Bays: Front 3 Side 3 27. Wa lan shape: see site map 29. Changes: xterior condition: good 31: 0

³⁻over-1 double-hung sash windows. The roofline extends to become the porch roof, supported by straight brick pillars. Porch short side walls are brick topped with a header course. Front 3-over-1 windows flank centered door. Side windows have double rowlock segmental arches. Upper 1/2 story is frame.

^{34.} History and Significance: Leander H. Cramer took out the permit for this 25×34 ' house in 1925. The Guarantee Const. Co. built it for \$4,000. Cramer was listed in the 1927 city directory as a checker at the American Car & Foundry; he moved here from his residence Clifton & Southwest.



1.	No. 173	1		•		Office of Historic				
2.	City/County: City of St. Louis, MO	4. Prepare	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101							
5.	Date: 8/15/91	1				is Public Records, age/St. Louis files				
7.	Building? yes									
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No								
12.	Original name:									
13.	Present name/ow	ner's name:								
14.	Street address:	2341 Esther		1	5. Style:	Colonial Revival				
16.	Date(s): 5/21/	1926 - buildir	ng per	rmit						
17.	Architect: bui	lder]	18. Buil	der: Harry	C. Vollmar				
19.	Original Use: r	esidence	20.	Present	Use: reside	ence				
21.	No. of stories:	2 22. 1	Baseme	ent? yes	23. Wall o	construction: frame				
24.	Foundation mate	rial: stuccoe	ed	25. Ro	of type/mate	erial: side gable				
26.	No. Bays: Fron	t 3 Side 3		27. Wa	ll treatment	: wood clapboarding				
28.	Plan shape: see	site map	29.	Changes:	Addition?	yes Altered?				
30.	Exterior condit	ion: good	· · · · · · · · · · · · · · · · · · ·	31: C	pen to publi	.c? no				
32.	Other Surveys i	n which include	ded:	Heritage	/St. Louis s	survey, 1971				
bank is l	e below they are of four. A bra	6-over-6, all cketed hood sh e front. At t	l douk helter the si	ole-hung rs the do ide, a fl	sash. Lower	lows are 6-over-1, windows are in a A permastone plant he-story addition				

^{34.} History and Significance: The permit for this house was taken out by Harry C. Vollmar, a prolific Clifton Heights builder, in 1926. The \$3,000 house was to be 24 x 30' with hot air heat. Vollmar built more than 40 of the houses in this survey; he lived next door at 6105 Simpson.



1. No.	199	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102						
Cit	y/County: y of St. is, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5. Dat	e: 8/15/91				on: St. Louis Public Records,			
7. Bui	lding? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files						
	ership:				or part of estab. district? No			
Pri	vate	10. Visib	le fro	m public :	road? Yes 11. Endangered? No			
12. Ori	ginal name:							
13. Pre	sent name/own	er's name:						
14. Str	eet address:	2348 Esther	r	1	5. Style: Col. Rev./Craftsman			
16. Dat	e(s): 2/3/19	26 - buildi:	ng per	mit				
17. Arc	hitect: build	der	***************************************	18. Buile	der: Harry C. Vollmar			
19. Ori	ginal Use: re	sidence	20.	Present	Use: residence			
21. No.	of stories:	2 22.	Basem	ent? yes	23. Wall construction: frame			
24. Fou	ndation mater	ial: stucco	ped	25. Ro	oof type/material: mock gambrel*			
26. No.	Bays: Front	4 Side	2	27. Wa	all treatment: clapboarding			
28. Pla	n shape: see	site map	29.	Changes:	Addition? Altered?			
30. Ext	erior conditi	on: good	<u></u> _	31: 0	pen to public? no			
32. Oth	er Surveys in	which incl	uded:	Heritage	e/St. Louis survey, 1971			
gabled 2 dormer.	-story with a Centered ent:	n inset eave rance has a	e made round	to resembler to resemble.	*This house is really a side- able a gambrel with a full-width bracketed hood. Paired 3-over-1 ound in all Vollmar's gambrels			

has had window alterations and lacks the characteristic railing and 2nd story

doorway.

^{34.} History and Significance: The building permit for this house was taken out in 1926 by local builder Harry C. Vollmar. There was evidently some other plan originally in mind for this building, because the permit mentions a tar & gravel roof, a 36 x 56' size (larger than this house), and called it a "tenement." Other details seem right, though, including the \$3,000 cost. Vollmar was in the habit of taking out several permits at once; perhaps the typict



y/County: y of St. is, MO ee: 8/15/91	4. Prepare of St. Loui	ed by:	: Cynthia 17 Locust	Hill Longw	isch, L	andmarks Assn.						
lding? yes	•		informati			Preservation, P. O. Box 176, Jefferson City, MO 65102 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
	0101	MO H				lic Records,						
	8. On Nati	City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No										
ership: .vate	10. Visible from public road? Yes 11. Endangered? No											
ginal name:	·	<u> </u>										
esent name/ow	ner's name:											
eet address:	2123 Gregg I	Place	1	5. Style:	Crafts	man						
e(s): c. 19	30		•									
hitect: unk	nown	ALIMA AND AND AND AND AND AND AND AND AND AN	18. Buil	der: unknow	wn							
ginal Use:	residence	20.	Present	Use: resid	dence							
of stories:	1 1/2 22. F	Baseme	ent? yes	23. Wall	constru	ction: frame						
ındation mate	rial: concret	te	25. Ro	of type/mat	erial:	gabled/asphalt						
Bays: Fron	t 3 Side 4		27. Wa	ll treatmen	t: viny	l siding						
ın shape: see	site map	29.	Changes:	Addition?	rear	Altered? yes						
erior condit	ion: good		31: 0	pen to publ	ic? no)						
	n which includ	led:	Heritage	/St. Louis	survey,	1971						
	r condit	r condition: good	r condition: good	r condition: good 31: 0	r condition: good 31: Open to publ	r condition: good 31: Open to public? no						

appear to be replacements.

^{34.} History and Significance: Active building permits for this block begin c. 1932 and fail to list this building; inactive permits are not available. House is the northernmost of this survey; it is located at the junction of two streets truncated as a result of nearby I-44.



1.	No. 198			-	s: Missouri Office of Historic Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101							
5.	Date: 8/15/91	•			on: St. Louis Public Records, Soc.; Heritage/St. Louis files				
7.	Building? yes								
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No							
12.	Original name:	<u> </u>	. The second desirable galley desirable galley						
13.	Present name/ow	ner's name:							
14.	Street address:	2406 Simps	on	1	5. Style: Craftsman				
16.	Date(s): c. 19	20							
17.	Architect: unk	nown	LU TO A BOOK OF THE LOT	18. Buil	der: unknown				
19.	Original Use: r	esidence	20.	Present	Use: residence				
21.	No. of stories:	2 22.	Basem	ent? yes	23. Wall construction: frame				
24.	Foundation mate	rial: stucc	oed	25. Ro	oof type/material: hipped				
26.	No. Bays: Fron	t 3 Side	2	27. Wa	all treatment: wood clapboarding				
28.	Plan shape: see	site map	29.	Changes:	Addition? Altered? yes				
30.	Exterior condit	ion: good	<u>.</u>	31: 0	pen to public? no				
32.	Other Surveys is	n which incl	uded:	Heritage	e/St. Louis survey, 1971				
fron	house has wide t elevation; 3-o	eaves. Pair ver-1 joined	ed 3-o	ver-1 dou 2-over-1	The pyramidally-hipped roof of able-hung sash on the 2nd story windows in center of 1st story. I-roof bay at 1st story, left.				

Rear frame porch.

^{34.} History and Significance: No building permits prior to c. 1926 are available for this city block. Orin H. Jones lived in this house at least from 1925-30. He was a sales manager for a realty company.



1.	No. 197	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 						
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,						
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files						
9.	Ownership:	8. On National Register or part of estab. district? No						
	Private	10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:							
13.	Present name/ow	ner's name:						
14.	Street address:	2420 Simpson 15. Style: Colonial Revival						
16.	Date(s): 7/16/	1926 - building permit						
17.	Architect: bui	lder 18. Builder: Harry C. Vollmar						
19.	Original Use: r	esidence 20. Present Use: residence						
21.	No. of stories:	1 & 2 22. Basement? yes 23. Wall construction: frame						
24.	Foundation mate	rial: concrete 25. Roof type/material: side gable						
26.	No. Bays: Fron	t 5 Side 2 27. Wall treatment: vinyl siding						
28.	Plan shape: see	site map 29. Changes: Addition? yes Altered? yes						
30.	Exterior condit	ion: good 31: Open to public? no						
32.	Other Surveys i	which included: Heritage/St. Louis survey, 1971						
addi	n as a side gable tion. That addi	tion of important features: The original part of this house, 3-bay, probably with a one-story, flat-roofed (left) side tion was given a second story and a hipped roof and then it on with a flat roof. Entrance is obscured by a non-original						

"gabled telephone booth" porch. Windows are 6-over-1 double-hung sash.

^{34.} History and Significance: The building permit issued for this house was filed with those of City Block 4795. It was taken out in 1926 by Harry C. Vollmar, a prolific local builder who lived at 6105 Simpson nearby. The cost for the original 24×30 ' house was to be \$4,000, and it was to have hot air heat. Vollmar was active in Clifton Heights all during the 1920s.



City/County: City of St.	<u> </u>							
Louis, MO	Preservation, P. O. Box 176, Jefferson City, MO 65102 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101							
Date: 8/15/91								
Building? yes								
Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No							
Original name:	riginal name:							
Present name/own	ner's name:		·					
Street address:	eet address: 6105 Simpson 15. Style: Colonial Revival							
Date(s): c. 192	20-25							
Architect: buil	lder?		18. Buil	der: Harry C. Vollmar?				
Original Use: re	esidence	20.	Present	Use: residence				
No. of stories:	2 22.	Base	ment? yes	23. Wall construction:	frame			
Foundation mater	rial: ston	ıe	25. Ro	of type/material: mock	gambrel*			
No. Bays: Front	t 4 Side	: 3	27. Wa	ll treatment: wood clapb	oarding			
Plan shape: see	site map	29.	Changes:	Addition? Alter	ed?			
Exterior condit	ion: good	1	31: 0	pen to public? no				
Other Surveys is	n which inc	·luded:	Heritage	/St. Louis survey, 1971				
	Building? yes Ownership: Private Original name: Present name/own Street address: Date(s): c. 192 Architect: buil Original Use: re No. of stories: Foundation mater No. Bays: Front Plan shape: see Exterior condit: Other Surveys in	Building? yes 8. On N Ownership: Private 10. Visi Original name: Present name/owner's name: Street address: 6105 Simp Date(s): c. 1920-25 Architect: builder? Original Use: residence No. of stories: 2 Foundation material: ston No. Bays: Front 4 Side Plan shape: see site map Exterior condition: good Other Surveys in which ince	Building? yes 8. On Nationa Ownership: Private 10. Visible fro Original name: Present name/owner's name: Street address: 6105 Simpson Date(s): c. 1920-25 Architect: builder? Original Use: residence No. of stories: 2 22. Base Foundation material: stone No. Bays: Front 4 Side 3 Plan shape: see site map 29. Exterior condition: good Other Surveys in which included:	City Hall; MO Historical 8. On National Register Ownership: Private 10. Visible from public Original name: Present name/owner's name: Street address: 6105 Simpson 1 Date(s): c. 1920-25 Architect: builder? Original Use: residence No. of stories: 2 22. Basement? yes Foundation material: stone No. Bays: Front 4 Side 3 27. Wa Plan shape: see site map 29. Changes: Exterior condition: good 31: O Other Surveys in which included: Heritage	City Hall; MO Historical Soc.; Heritage/St. Loui Building? yes 8. On National Register or part of estab. distr 10. Visible from public road? Yes 11. Endang Original name: Present name/owner's name: Street address: 6105 Simpson 15. Style: Colonial Rev Date(s): c. 1920-25 Architect: builder? 18. Builder: Harry C. Vollmar? Original Use: residence 20. Present Use: residence No. of stories: 2 22. Basement? yes 23. Wall construction: Foundation material: stone 25. Roof type/material: mock No. Bays: Front 4 Side 3 27. Wall treatment: wood claph Plan shape: see site map 29. Changes: Addition? Alter Exterior condition: good 31: Open to public? no			

distinguish the door. Windows are 3-over-1 double-hung sash; they appear in

groups of 3 flanking and above the door. A one-story flat-

(cont'd. below)

^{34.} History and Significance: roofed side projection has a top railing. A drive-in rear (lower level) garage is a feature allowed by the slope of the grade. Extensive use of stone in landscaping: walks and low garden walls. No building permits issued before late 1925 are available. Builder Harry C. Vollmar lived in this house in 1925; it is very similar to a number of houses he built in the area. It is very likely that he or he and his brother, also a builder, built this house.



		•						
1.	No. 180					Office of Historic fferson City, MO 65		
2.	City/County: City of St. Louis, MO		4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	i .				uis Public Records,		
7.	Building? yes					tage/St. Louis file:		
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No						
12.	Original name:							
13.	Present name/ow	ner's name:						
14.	Street address:	6117 Simpso	on .	1	5. Style:	Italianate		
16.	Date(s): c. 18	90						
17.	Architect: unk	nown		18. Buil	der: unkno	wn		
19.	Original Use: r	esidence	20.	Present	Use: resid	ence		
21.	No. of stories:	2 22.	Basem	ent? yes	23. Wall	construction: frame		
24.	Foundation mate	rial: stone		25. Ro	oof type/mat	erial: flat		
26.	No. Bays: Fron	t 5 Side 2	2	27. Wa	ıll treatmen	t: clapboarding		
28.	Plan shape: see	site map	29.	Changes:	Addition?	Altered?		
30.	Exterior condit	ion: good		31: 0	Open to publ	ic? no		
32.	Other Surveys i	n which inclu	ıded:	Heritage	St. Louis	survey, 1971		
retu by f The	led just below on urns at the sides luted columns.	the front el for a short Windows are p t left is and	levati dista paired gled a	on by a lance. The lor triplet the fir	large, brack wrap-aroun led, 1-over- est story to	e has a flat roof, eted cornice that d porch is supported 1 double-hung sash. form a bay window. (cont'd. belo		

^{34.} History and Significance: centered in a recess and the other somewhat forward. They have separate lights. Heritage/St. Louis files list Mrs. M. Lucy, Ashbel and Maud S. Fields, Fry Methodist Church members, and carpenter Frederick Fields (presumably a sinner) as living here in 1901. Their notation for 1920 was that husband and wife boarders also lived here. It is possible that the house was intentionally built to house separate families; boarding others was a common source of income for single women. No building permit.



1.	No. 181	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 				
2.	City/County: City of St. Louis, MO					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,				
7.	Building? yes	8. On National Register or part of estab. district? No				
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address: 6121 Simpson 15. Style: Bungalow					
16.	Date(s): c. 1915-20					
17.	Architect: builder 18. Builder: John Wilcox Higginbotham					
19.	Original Use: residence 20. Present Use: residence					
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: frame					
24.	Foundation material: stone 25. Roof type/material: side gable					
26.	No. Bays: Fron	t 3 Side 2 27. Wall treatment: asbestos siding				
28.	Plan shape: see	site map 29. Changes: Addition? side Altered? yes				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971					

^{3.} Further description of important features: The dormer of this house features 3 brackets and exposed rafter ends; its four windows are longer than they ppear, having a recess in front of the dormer. The roof extends to form the ull-width porch roof. The porch, supported by frame pillars, has been enclosed of form a sunroom. A one-story frame addition is at the west side.

History and Significance: Inactive (pre-1925) building permits are not ailable for this city block. Heritage/St. Louis files state that John Wilcox gginbotham, son of important Clifton Heights personage John H. Higginbotham, rried Garnet Cann, daughter of William Cann (architect of Fry Church) and ilt this house across the park from his father's house (survey #219). A date r their marriage and the house construction are not given; they are listed as



1.	No. 182	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
2.	City/County: City of St. Louis, MO						
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership: Private	8. On National Register or part of estab. district? No. 10. Visible from public road? Yes 11. Endangered? No.					
12.	Original name:						
13.	Present name/ow	name/owner's name:					
14.	Street address:	6125 Simpson 15. Style: Queen Anne					
16.	Date(s): c. 19	Date(s): c. 1900					
17.	Architect: unk	nown 18. Builder: unknown					
19.	Original Use: r	esidence 20. Present Use: residence					
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: frame						
24.	Foundation mate	rial: stone 25. Roof type/material: complex					
26.	No. Bays: From	27. Wall treatment: aluminum siding					
28.	Plan shape: see site map 29. Changes: Addition? ? Altered? yes						
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	which included: Heritage/St. Louis survey, 1971					
roof the	f of this house he front elevation	tion of important features: The pyramidally hipped main as small steep gables; the heavy cornice is interrupted at for one such gable. Windows are 1-over-1 and seem to be briner porch is enclosed to form a sunroom. At the rear, an					

^{34.} History and Significance: No pre-1925 building permits are available for this city block. Fred C. Boutell lived here at least 1920-30

odd, shed-roofed section (addition or original?) is cantilevered over the side, with brackets beneath. Detailing of this house was probably lost when sided.



1.	No. 223	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:	name:					
13.	Present name/owner's name:						
14.	Street address: 6128 Simpson 5. Style: Queen Anne						
16.	Date(s): c. 18	Date(s): c. 1890-1900					
17.	Architect: Walter J. Lewis? 18. Builder: unknown						
19.	Original Use: r	esidence 20. Present Use: residence					
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: stone? 25. Roof type/material: complex					
26.	No. Bays: Fron	t 4 Side 3 27. Wall treatment: (wood) clapboarding					
28.	Plan shape: see site map 29. Changes: Addition? Altered?						
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
33.	-	tion of important features: The roofline of this house is					

hipped and gabled; the northwest corner of the house is cut out at the 1st story to provide for an angled corner window. A one-story, flat-roofed bay window is located on the west side. Rear, 1-sty. addition. A porch is located in the corner of the ell, at left in photo.

^{34.} History and Significance: Information in the Heritage/St. Louis files list Walter J. Lewis as the original architect of the house next door (survey #222). Although that house was extensively remodeled, it still bears a fairly close resemblance in basic shapes to this house; it seems very likely that Lewis did both.



1.	No. 183	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	8. On National Register or part of estab. district? No					
9.	Ownership:	8. On Nat	10nal	. Kegist	er or part of	estab. district	t? No
	Private					11. Endanger	ed? No
12.	Original name:	riginal name:					
13.	Present name/owner's name:						
14.	. Street address: 6131 Simpson 15. Style: Queen Anne						
16.	Date(s): c. 18	95					
17.	Architect: unknown			18. Bu	18. Builder: unknown		
19.	Original Use: residence 20.			Present Use: residence			
21.	. No. of stories: 2 1/2 22. Basement? yes 2			s 23. Wall	construction: f	rame	
24.	Foundation mate	Foundation material: stone		25. Roof type/material: complex			
26.	No. Bays: Front 3 Side 5		27. Wall treatment: wood clapboarding				
28.	Plan shape: see	site map	29.	Change	s: Addition?	yes Altered	?
30.	Exterior condition: good			31: Open to public? no			
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971						
22	7 11 7						

- 33. Further description of important features: The dominant feature of this house is its curved, true wrap-around porch. Round wood pillars support it; a balustrade of turned spindles is surmounted by a molded wood handrail; above is an iron railing with short wood posts. Second-story door allows access. The cornice breaks for gabled projections, the pediments imbricated; below the cornice, fretwork, fanlike brackets and finials decorate the (cont'd. below)
- 34. History and Significance: 2nd story of the bays. Windows are 1-over-1, for the most part, except for squares (in stairwell?) surrounded by small rectangles of stained glass. Hipped-roof dormer. One-story addition at northeast corner has small 2-over-1 windows may be \$1500 1902 addition mentioned in Heritage/St. Louis files. Geo. Whitson, clerk, Railway Mail Service, owned it in 1898. Used as 2-family dwelling in early 'teens family of survey #184 lived here while their house was being built next door. --Heritage/St. Louis



1.	No. 222	· · · · · · · · · · · · · · · · · · ·				
2.	City/County: City of St. Louis, MO	Preservation, P. O. Box 176, Jefferson City, MO 65102 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	· · · · · · · · · · · · · · · · · · ·	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files				
7.	Building? yes					
9.	Ownership: Private	8. On National Register or part of estab. district? In the stab of				
12.	Original name:	riginal name:				
13.	Present name/owner's name:					
14.	Street address: 6138 Simpson 5. Style: Craftsman					
16.	Date(s): c. 1895-1900; remodeled c. 1920 (Heritage/St. Louis)					
17.	Architect: W. J. Lewis? 18. Builder:					
19.	Original Use: residence 20. Present Use: residence					
21.	No. of stories: 2 1/2 22. Basement? yes 23. Wall construction: frame					
24.	Foundation mate	rial: stone 25. Roof type/material: gabled				
26.	No. Bays: Fron	t 3 Side 5 27. Wall treatment: aluminum siding				
28.	Plan shape: see	site map 29. Changes: Addition? Altered?				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971				
A na	ide of this house arrow, shingled h lows and door bel	tion of important features: A stone chimney dominates the , which features a large front gable and three side gables. cod extends across the width of the front to shield the cow; it has thick exposed rafters. Windows are multipane carved surround with fluted pilasters and stained glass				

^{34.} History and Significance: Heritage/St. Louis files list Mary Vollmar, wife of Frederick, living here in 1920. Other H./St. L. files list this house as being designed by local architect Walter J. Lewis and remodeled by "son-in-law Henry [sic - should be Harry] Vollmar." Whose son-in-law? What date? Lewis is known to have been active in the late 1890s; Vollmar was active mostly in the 1920s. The original house must have had more of a Queen Anne look much like the

sidelights that match glass in the narrow, side bay window (original glass?).



1.	No. 221	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes						
9.	Ownership:	8. Oı	mationa ————	egist	er or part of	estab. district: No	
	Private						
12.	Original name:						
13.	Present name/owner's name:						
14.	1. Street address: 6142 Simpson 5. Styl			5. Style:	Queen Anne		
16.	Date(s): c. 1895 (Heritage/St. Louis)						
17.	Architect: unknown 1			18. Bu	18. Builder: unknown		
19.	Original Use: residence 20.			Presen	Present Use: residence		
21.	No. of stories: 2 22. Basem		ment? ye	s 23. Wall	construction: frame		
24.	Foundation material: stone		25. Roof type/material: complex				
26.	No. Bays: Front 4 Side 4			27.	27. Wall treatment: (wood?) clapboard		
28.	3. Plan shape: see site map 29. Changes:			s: Addition?	rear Altered?		
30.	Exterior condition: good			31:	31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971						

^{33.} Further description of important features: A large, polygonal, conical-roofed tower dominates the facade of this house. It juts up through a long, sloping side-gabled section. Beside it, a small corner porch features basket-handle arches. Windows are 1-over-1 (replacements?). Transomed front door. 1-sty rear addition.

^{34.} History and Significance: According to Heritage/St. Louis files, Edward J. Ingamells, bookkeeper with Ely & Walker, lived here in 1896. He belonged to the Episcopal Church. By 1912, Peter Theobald, a secretary with T. P. Chapman Paper Co., lived here (through c. 1920).



1.	No. 220	!		_				e of Histo n City, M O	
2.	City/County: City of St. Louis, MO	4. Prepare	_	-		-			
5.	Date: 8/15/91	6. Source City Hall;			ation:			olic Recor	
7.	Building? yes							district	
9.	Ownership: Private	2			ic road?		11.	Endangere	
12.	Original name:	<u> </u>			·····		·		
13.	Present name/ow	ner's name:							
14.	Street address:	6142 Simpso	n		5. St	yle:	Queen /	Anne	
16.	Date(s): c. 19	05						·····	
17.	Architect: unk	nown		18. B	uilder:	unkno	wn	· · · · · · · · · · · · · · · · · · ·	
19.	Original Use: r	esidence	20.	Prese	nt Use:	resid	ence		···
21.	No. of stories:	2 1/2 22.	Basem	ent? y	es 23.	Wall	constr	uction: fr	ame
24.	Foundation mate	rial: stone		25.	Roof ty	pe/mat	erial:	gabled	
26.	No. Bays: Fron	t 3 Side	2	27.	Wall tr	eatmen	t: woo	d clapboar	ding
28.	Plan shape: see	site map	29.	Chang	es: Add	lition?		Altered?	
30.	Exterior condit	ion: good		31:	Open t	o publ	ic? n	•	
32.	Other Surveys i	n which inclu	ded:	Herita	age/St.	Louis	survey	, 1971	
33.	Further descrip	tion of impor slightly; bel	tant ow ar	featur e pair	es: The	e peak ver-2 d	of the	front gab	W

shed-roof full-width porch supported by iron (replacement) posts. Narrow and exceptionally long windows at 1st story have 3 stacked panes. Stained glass fanlight may not be original. Projecting side gable intersected by cornice.

^{34.} History and Significance: Jennie Moller, a teacher, and Jessie Moller, a clerk at W.U. Fel. Co. lived here in 1907. --Heritage/St. Louis



1.	No. 219			-		Office of Historic Eferson City, MO 6510
2.	City/County: City of St. Louis, MO	-	_	_	_	isch, Landmarks Assn. , St. Louis, MO 6310
5.	Date: 8/15/91					uis Public Records, tage/St. Louis files
7.	Building? yes					
9.	Ownership:	8. On Nat	tonal	Register	or part or	estab. district? No
	Private	10. Visibl	e fro	m public	road? Yes	11. Endangered? No
12.	Original name:					
13.	Present name/ow	ner's name:				
14.	Street address:	6154 Simpso	n	5	. Style: (Col. Rev./Craftsman
16.	Date(s): 5/29/	1922 - buildi	ng pe	rmit (Her	itage/St. Lo	ouis)
17.	Architect: Cha	rles Wilcox		18. Buil	der:	
19.	Original Use: r	esidence	20.	Present	Use: resido	ence
21.	No. of stories:	2 22.	Basem	ent? yes	23. Wall	construction: frame
24.	Foundation mate	rial: stucco	ed	25. Ro	of type/mate	erial: hipped
26.	No. Bays: Fron	t 3 Side 5		27. Wa	ll treatment	t: clapboarding
28.	Plan shape: see	site map	29.	Changes:	Addition?	rear Altered?
30.	Exterior condit	ion: good		31: 0	pen to publi	ic? no
32.	Other Surveys i	n which inclu	ded:	Heritage	/St. Louis :	survey, 1971

- 33. Further description of important features: Broad overhanging eaves. 6-over-1 double-hung sash windows, paired on front 2nd story. Quadruple multipane window flank front door. Above entrance, a bay window projects; below it, a bracketed hood shelters the doorway. At the west side, a polygonal, flat-roofed bay window projects. Successful attempt was made to integrate new rear addition with style of rest of the house.
- 34. History and Significance: John Wilcox Higginbotham, younger son of John Henry Higginbotham, hired architect Charles Wilcox to build this house in 1922 for \$5,000. He and his wife, the former Garnet Cann (daughter of W. A. Cann, architect of Fry Methodist Church), lived here until the St. Louis Hills development opened; Higginbotham was associated with Cyrus, Crane, Willmore Realty Co., who developed that area. He built a house for his family there. --Heri-



1. No. 218	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510
2. City/Cour City of S Louis, MC	nty: St. 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn.
5. Date: 8/1	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files
7. Building?	
9. Ownership Private	
12. Original	name:
13. Present r	name/owner's name:
14. Street ad	ddress: 6158 Simpson 5. Style: Queen Anne
16. Date(s):	1889 (Heritage/St. Louis)
17. Architect	: builder 18. Builder: R. Dawson
19. Original	Use: residence 20. Present Use: residence
21. No. of st	tories: 2 1/2 22. Basement? yes 23. Wall construction: frame
24. Foundation	on material: obscured 25. Roof type/material: complex
26. No. Bays:	: Front 2 Side 5 27. Wall treatment: aluminum siding
28. Plan shar	pe: see site map 29. Changes: Addition? Altered?
30. Exterior	condition: good 31: Open to public? no
32. Other Sur	rveys in which included: Heritage/St. Louis survey, 1971
gabled roof.	description of important features: This house has a hipped and A curved wrap-around porch is the highlight of the house, with columns, elaborate, scalloped handrails, spindle balustrade and

(cont'd. below)

paneled bottom posts. One of the windows under the porch roof has a Greek Revival pediment; another is round. At right behind the porch, a bay window

projects from the second story; it features a bracketed

^{34.} History and Significance: cornice and tapers to a point at the bottom. Windows are 1-over-1. Heavy cornice. House is on hill overlooking park. John Henry Higginbotham, wife and 5 children lived here in 1889. He was a member and steward of the Fry Methodist Church and a well-known major promoter of Clifton Heights. c. 1920, William B. Higginbotham returned from NY to live here after the deaths of his parents. His oldest daughter then lived here until her death c. 1969-70; her husband continued to live here.



1.	No. 217	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files
7.	Building? yes	8. On National Register or part of estab. district? No
9.	Ownership:	o. On Macronal Register of part of estab. district: No
·	Private	10. Visible from public road? Yes 11. Endangered? No
12.	Original name:	
13.	Present name/ow	ner's name:
14.	Street address:	6172 Simpson 5. Style: Queen Anne
16.	Date(s): c. 18	35–90
17.	Architect: unk	nown 18. Builder: unknown
19.	Original Use: r	esidence 20. Present Use: residence
21.	No. of stories:	2 1/2 22. Basement? yes 23. Wall construction: frame?
24.	Foundation mate	rial: stuccoed 25. Roof type/material: complex
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: stuccoed
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes
30.	Exterior condit	ion: good 31: Open to public? no
32.	Other Surveys i	which included: Heritage/St. Louis survey, 1971

^{33.} Further description of important features: The exterior wall surfaces of this house are all stuccoed, and appear to be that way in a 1970-71 photo. The touse has a hipped and gabled roof. A large, double-deck porch on the northest elevation is an alteration; a more traditional, rectangular porch crossed he facade in the photo; it appears to have had a rather odd, mansardlike upper eck. The house is in a prime location overlooking the park.

^{4.} History and Significance: Heritage/St. Louis files: Alpha T. Stevens is irst listed in the city directory at this address in 1890. He was a correst andent for the Mansur & Tebbetts Implement Co. Stevens was a member, steward trustee of Fry Methodist Church and played the alto horn. Stevens owned the use at least through 1920; he is not listed at all in the 1925 city directory.



1.	No. 144	t contract the contract to the		-		Office of Historic ferson City, MO 65102
2.	City/County: City of St. Louis, MO	4. Prep	ared by	: Cynthi	a Hill Longwi	sch, Landmarks Assn. St. Louis, MO 63101
5.	Date: 8/15/91	1				is Public Records, age/St. Louis files
7.	Building? yes					
9.	Ownership: Private				road? Yes	estab. district? No 11. Endangered? No
12.	Original name:	<u> </u>				
13.	Present name/ow	ner's name:				
14.	Street address:	6205 Simp	son		15. Style:	Colonial Revival
16.	Date(s): c. 19	10				
17.	Architect: own	er?	n derigitation	18. Bui	lder: John E	. Mitchell, owner
19.	Original Use: r	esidence	20.	Present	Use: reside	nce
21.	No. of stories:	2 22.	Basem	ent? yes	23. Wall c	onstruction: br/frame
24.	Foundation mate	rial: ston	ie	25. F	loof type/mate	rial: cross gambrel
26.	No. Bays: Fron	t 4 Side	: 3	27. W	Wall treatment	: painted br./siding
28.	Plan shape: see	site map	29.	Changes	3: Addition?	Altered?
30.	Exterior condit	ion: good		31:	Open to publi	c? no
32.	Other Surveys i	n which inc	luded:	Heritag	re/St. Louis s	urvey, 1971
33. mark	Further descrip ted by a 2nd-stor center of an ope a stone jack arch	tion of imp y sunroom s n, turned-s es and sill	ortant supporte tone-ba	features d by squared lustrade	s: The entran mare corinthia ed patio. Win gambrel provid	ce of this house is dows are 1-over-1

^{34.} History and Significance: iron railings. The first story is painted brick while the second is sheathed in asbestos siding. Some of the windows are stained glass, but are probably not original to the house.

(cont'd. below)

south and a flat-roofed projection on the north, both with

John E. Mitchell, who was married to Ellen Higginbotham (of one of the oldest & most prominent Clifton Heights families), built this house in 1910, according to Heritage/St. Louis files. Mitchell was the president of Alsop Process in 1915 and later president of John Mitchell Co., shoe machinery manufacturers.



1.	No. 145			-				e of Historia n City, MO 6	
2.	City/County: City of St. Louis, MO	4. Prep	ared by	: Cyntl	nia H	Hill Longw	isch, I	Landmarks As	
5.	Date: 8/15/91	(olic Records	
7.	Building? yes							district?	No
9.	Ownership: Private			om publi	_		11.	Endangered?	
12.	Original name:	<u> </u>							
13.	Present name/ow	ner's name:			_				
14.	Street address:	6223 Simp	son		15	. Style:	Queen	Anne	
16.	Date(s): c. 18	95							
17.	Architect: unk	nown	,	18. B	ii lde	er: unkno	MU		
19.	Original Use: r	esidence	20.	Prese	nt U	se: resid	ence		
21.	No. of stories:	2 22.	Basen	nent? y	25	23. Wall	constru	uction: fram	e
24.	Foundation mate	rial: ston	e	25.	Roo	f type/mat	erial:	complex	
26.	No. Bays: Fron	t 3 Side	5	27.	Wal	l treatmen	t: clap	pboarding	
28.	Plan shape: see	site map	29.	Change	es:	Addition?		Altered?	
30.	Exterior condit	ion: good		31:	0 p e	en to publ	ic? no	 o	
32.	Other Surveys i	n which inc	luded:	Herita	age/	St. Louis	survey	, 1971	
_	Further descripure front section roof here might	, topped wi	th a tr	runcate	l py	ramid roof	with a	a gabled dor	mer.

terrupted for the dormer; it has 3 small windows, imbrication & a sunburst. A frame porch is inset at the right corner; it has round wood pillars. Between the stories, a wide band of imbricated wood shingling encircles (cont'd. below)

^{34.} History and Significance: the house. At the back of the house, a projecting gabled bay is cut out at the corners to provide a 2-story bay window, topped with scrolled wood brackets. Windows are 1-over-1; double door is transomed. No building permits prior to 1926 are available for this city block. Edward F. H. Wenneker, manager of the Wenneker-Morris Candy Co., is listed at this house in 1898. He was also a Trustee of Fry Methodist Church. His wife continued to own the property at least until 1920. —Heritage/St. Louis files



1.	No. 146	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files
7.	Building? yes	8. On National Register or part of estab. district? No
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No
12.	Original name:	
13.	Present name/own	ner's name:
14.	Street address:	6241 Simpson 15. Style: Bungalow/Queen Anne
16.	Date(s): c. 19	00 & c. 1925
17.	Architect: unk	nown 18. Builder: unknown
19.	Original Use: re	esidence 20. Present Use: residence
21.	No. of stories:	1 & 2 22. Basement? yes 23. Wall construction: frame
24.	Foundation mate	rial: concrete 25. Roof type/material: hipped
26.	No. Bays: Fron	t 2 Side 2 27. Wall treatment: asbestos siding
28.	Plan shape: see	site map 29. Changes: Addition? yes Altered? yes
30.	Exterior condit	ion: fair/good 31: Open to public? no
32.	Other Surveys is	n which included: Heritage/St. Louis survey, 1971
33. is d		tion of important features: Without building permits, it speculate what has happened with the building of this

^{33.} Further description of important features: Without building permits, it is difficult to even speculate what has happened with the building of this house. The taller, rear portion is of a slight Queen Anne bent, with cut-out corners to form a bay window. On the front is a hipped-roof, dormered section with a heavy full-width porch supported by brick pillars. The foundation of the front part is concrete scored to resemble brick. A Bungleanne?

^{34.} History and Significance: No inactive building permits (pre-1926) are available for this city block. Heritage/St. Louis made no attempt to record information on this house. Conductor Howard N. Johnston lived here at least from 1925-30.



1.	No. 147			•			of Historic City, MO 65102
2.	City/County: City of St. Louis, MO		d by:	Cynthia	Hill Longw	isch, L	andmarks Assn.
5.	Date: 8/15/91	1					olic Records,
7.	Building? yes				or part of		Louis files district? No
9.	Ownership: Private		<u> </u>	public:			Endangered? No
12.	Original name:						
13.	Present name/ow	ner's name:					
14.	Street address:	6245 Simpson		1.	5. Style:	Queen	Anne
16.	Date(s): c. 18	95 - 1900					
17.	Architect: unk	nown	1	8. Buile	der: unknow	wn	
19.	Original Use: r	esidence 2	20.	Present	Use: resid	ence	
21.	No. of stories:	2 22. Ba	ene.	ent? yes	23. Wall	constru	ction: frame
24.	Foundation mate	rial: stone		25. Ro	of type/mate	erial:	hipped
26.	No. Bays: Fron	t 2 Side 2		27. Wa	ll treatmen	t: clap	board/shingles
28.	Plan shape: see	site map	29.	Changes:	Addition?	?	Altered? yes
30.	Exterior condit	ion: good		31: 0	pen to publ	ic? no)
32.	Other Surveys i	n which include	 ed :	Heritage	/St. Louis	survey	1971

- hipped at several places, possibly as rear additions were added. Paire windows at the front upper story "break through" the roofline with a little gable. A smaller, rectangular window with a slight Greek Revival pedimented enframement is located to the left at the 2nd story; its twin is around the corner. A wraparound porch has turned spindles above and as a balustrade; (cont'd. below)
- 34. History and Significance: this porch, while in keeping with the character of the house, was added between 1970 when Heritage/St. Louis photographed it and 1991. In 1970 it was totallly devoid of a porch and an apparent imprint of one seems to be only at the corner beneath the two rectangular windows. The upper story of this house is covered with imbricated wood shingling; clapboards below. Fred Pritzer, a member of Fry Methodist Church and an editor by trade, lived in this house in 1901 but was not listed here in 1902. —Heritage/St. Louis files



1.	No. 148	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63103
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files
7.	Building? yes	8. On National Register or part of estab. district? No
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No
12.	Original name:	·
13.	Present name/ow	ner's name:
14.	Street address:	6249 Simpson 15. Style: Colonial Revival
16.	Date(s): c. 19	00
17.	Architect: unk	nown 18. Builder: unknown
19.	Original Use: r	esidence 20. Present Use: residence
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: frame
24.	Foundation mate	rial: obscured 25. Roof type/material: complex
26.	No. Bays: Fron	t 3 Side 3 27. Wall treatment: asbestos siding
28.	Plan shape: see	site map 29. Changes: Addition? Altered?
30.	Exterior condit	ion: good 31: Open to public? no
		n which included: Heritage/St. Louis survey, 1971

¹⁻over-1. The doorway is located near the corner and features a large broken pediment with sidelights and fanlight divided by engaged pilasters. The door itself has two vertical panes. A basement garage extends from the southwest side to form a patio, possible due to the steep grade.

34. History and Significance: No inactive building permits are available for

this city block (anything before c. 1926), so definite dating is not possible. According to Heritage/St. Louis records, in 1901, Mrs. Kate Evans, widow of Theodore and Fry Methodist Church member, lived here; they also say that the Rev. Isaac B. Richardson also lived here. Perhaps Mrs. Evans was a housekeeper.



1.	No. 149	3. Location of Negatives: Missouri Office of His Preservation, P. O. Box 176, Jefferson City,	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmark of St. Louis, 917 Locust, 7th Floor, St. Louis, M	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Rec City Hall; MO Historical Soc.; Heritage/St. Louis	
7.	Building? yes		
9.	Ownership: Private	8. On National Register or part of estab. distri 10. Visible from public road? Yes 11. Endange	
12.	Original name:		
13.	Present name/ow	er's name:	
14.	Street address:	6255 Simpson 15. Style: Queen Anne	
16.	Date(s): 1897	building permit (Heritage/St. Louis)	
17.	Architect: Wal	er J. Lewis 18. Builder: unknown	
19.	Original Use: r	esidence 20. Present Use: residence	
21.	No. of stories:	2 1/2 22. Basement? yes 23. Wall construction:	frame
24.	Foundation mate	rial: stone 25. Roof type/material: comple	×
26.	No. Bays: Fron	3 Side 5 27. Wall treatment: clapboard/s	hingles
28.	Plan shape: see	site map 29. Changes: Addition? Altere	d?
30.	Exterior condit	on: good 31: Open to public? no	
32.	Other Surveys i	which included: Heritage/St. Louis survey, 1971	
at t	ent planes and su the 2nd story and	cion of important features: This house features man rfaces. 4 rows of imbricated wood shingling band th cross the gables. The main roof is hipped, but gab located all over it. The front gable overhangs the	e house les of

(cont'd. below)

low, itself a projection from the house. Below, a porch crosses the width of

the house supported by thin wood posts. Another overhanging

At this time, pre-1926 building permits are not available; however, in 1970, it was possible to see some permits that are now inaccessible. Heritage/St. Louis reports that there was an 1897 permit for this house by owner architect Walter Lefferson Lewis (1/16/1897: \$1,900). Lewis lived here until a 1920.

^{34.} History and Significance: gable at the south side shelters a two-story bay window. The house is sited back from the street at a considerable distance in an almost wooded setting facing the park.



1.	No. 176	•			s: Missouri Office of Historic Box 176, Jefferson City, MO 65102
2.	City/County: City of St. Louis, MO	4. Prepare	ed by	: Cynthia	Hill Longwisch, Landmarks Assn., 7th Floor, St. Louis, MO 63101
5.	Date: 8/15/91	1			on: St. Louis Public Records, Soc.; Heritage/St. Louis files
7.	Building? yes				
9.	Ownership:	8. On Nat	onal	Register	or part of estab. district? No
	Private	10. Visible	e fro	m public	road? Yes 11. Endangered? No
12.	Original name:				
13.	Present name/ow	ner's name:			
14.	Street address:	6101 Simpson	n Ter	race 1	5. Style: Bungalow
16.	Date(s): c. 19	24		·	
17.	Architect: bui	lder		18. Buil	der: H. C. Vollmar?
19.	Original Use: r	esidence	20.	Present	Use: residence
21.	No. of stories:	1 1/2 22.	Basem	ent? yes	23. Wall construction: frame
24.	Foundation mate	rial: stucco	ed	25. Ro	of type/material: side gable
26.	No. Bays: Fron	t 3 Side 2		27. Wa	ll treatment: aluminum siding
28.	Plan shape: see	site map	29.	Changes:	Addition? Altered? yes
30.	Exterior condit	ion: good		31: 0	pen to public? no
32.	Other Surveys i	n which inclu	ded:	Heritage	/St. Louis survey, 1971
elev porc	vation has triple th roof, supporte	6-over-1 wind d by tapered	dows. (outs	The hou	A gabled dormer in the front se roof extends to become the rs) and straight pillars. Paired ter doorway, which also has

34. History and Significance: Although pre-1925 building permits are unavailable in 1991, some were still there in the 1970-71 pre-microfilm days. Heritage/St. Louis found permits for three of the four bungalows on Simpson Terrace. Builder H. C. Vollmar took out the permits in early 1924. One of the houses is not clearly identified; it is apparently either this one or the one next door at 6107 Simpson Terrace. The houses cost \$4,000 apiece; no other information was recorded. In all likelihood, Vollmar built all four, as local residents believe.

vertical Craftsman paning. On the east side, two new "greenhouse windows" flank


the chimney.



y/County: y of St. s, MO e: 8/15/91 ding? yes ership: yate ginal name:	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No
ding? yes ership: vate	City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No
ership: vate	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No
vate	10. Visible from public road? Yes 11. Endangered? No
inal name:	
ent name/ow	wner's name:
et address:	: 6107 Simpson Terrace 15. Style: Bungalow
e(s): c. 19	924
nitect: bui	ilder 18. Builder: H. C. Vollmar?
ginal Use: r	residence 20. Present Use: residence
of stories:	: 1 1/2 22. Basement? yes 23. Wall construction: frame
ndation mate	erial: stuccoed 25. Roof type/material: side gable
Bays: Fron	ont 3 Side 2 27. Wall treatment: wood clapboarding
abano: coo	e site map 29. Changes: Addition? rear Altered?
r anghe: see	tion: good 31: Open to public? no
erior condit	
	hape: se

dormer are 3-over-1 double-hung sash; those below are the same, except paired, flanking the doorway. The roof extends to become the porch roof, supported by heavy tapering, stuccoed pillars at the corners. A wood railing encloses the porch. Stone has been applied to the front of the foundation and to the steps. Windows in side elevations tend to be smaller. Rear 1-story frame addition.

^{34.} History and Significance: Although no pre-1925 building permits are available for this block in 1991, in the pre-microfilm days of 1970-71, Heritage/St. Louis found permits for three of the four Simpson Terrace bungalows. One permit is not clear as to the actual address; it is either for this house or the one next door at 6101 Simpson Terrace. The permits were taken out by builder H. C. Vollmar and the houses cost \$4,000 each. No other information is given. Voll-

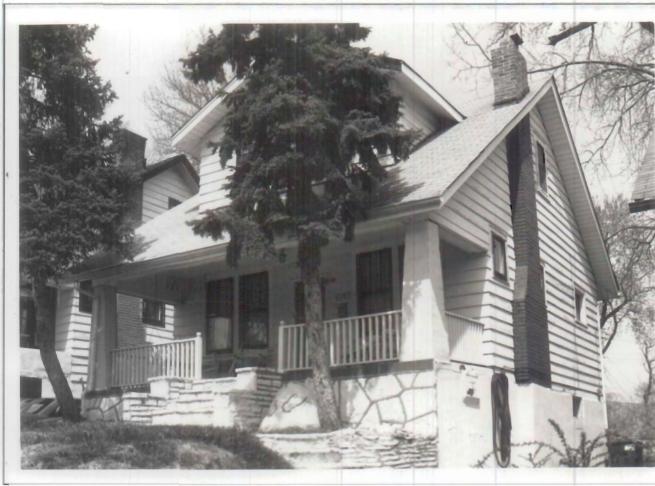

1.	No. 178	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	8. On National Register or part of estab. district? No	
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address: 6109 Simpson Terrace 15. Style: Bungalow		
16.	Date(s): 2/27/1924 - building permit (Heritge/St. Louis)		
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories: 1 1/2 22. Basement? yes 23. Wall construction: frame		
24.	Foundation material: stuccoed 25. Roof type/material: side gable		
26.	No. Bays: Front 3 Side 3 27. Wall treatment: wood clapboarding		
28.	Plan shape: see site map 29. Changes: Addition? Altered?		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
		· · · · · · · · · · · · · · · · · · ·	

- 33. Further description of important features: The gabled dormer of this house has exposed rafter ends and three 3-over-1 double-hung windows. Paired windows of the same type flank the door. The roof extends to become the porch roof, supported by square pillars. The pillars and side walls of the porch have been stuccoed.
- 34. History and Significance: Heritage/St. Louis researchers found a building permit taken out in 1924 for this house and the one next door at 6111 Simpson Terrace. Builder H. C. Vollmar built the houses for \$4,000 each. There is an additional permit for this street that is for one of the two remaining houses; however, he must have built all four bungalows. No other information is given on the permit. Edward Lambe, superintendent of the Lafayette Station Post Office, lived here at least 1925-30.



1.	No. 179	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes		
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address: 6111 Simpson Terrace 15. Style: Bungalow		
16.	Date(s): 2/27/1924 - building permit (Heritage/St. Louis)		
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: frame	
24.	Foundation material: stuccoed 25. Roof type/material: side gable		
26.	No. Bays: Front 2 Side 2 27. Wall treatment: vinyl siding		
28.	Plan shape: see site map 29. Changes: Addition? Altered? yes		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		

this dormer has been altered to form a double unit. The roof of the house extends to form the porch roof, supported by tapering pillars at the outside corners and straight pillars at the opening, all sheathed in siding. Triple windows on the front first story; door offset to left.

^{34.} History and Significance: Although pre-1925 building permits are not available in 1991, in 1970-71 (before microfilming), Heritage/St. Louis researchers found some permits for the Simpson Terrace bungalows. This one was for this house and its neighbor at 6109. They cost \$4,000 apiece; no other information was given. Vollmar was a local builder; he almost certainly built all four bungalows on Simpson Terrace.



1.	No. 175	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files	
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address: 6112 Simpson Terrace 15. Style: Craftsman		
16.	Date(s): c. 1920		
17.	Architect: unknown 18. Builder: unknown/		
19.	Original Use: r	esidence 20. Present Use: residence	
21.	No. of stories:	2 22. Basement? yes 23. Wall construction: frame	
24.	Foundation mate	rial: obscured 25. Roof type/material: hipped	
26.	No. Bays: Front 3 Side 3 27. Wall treatment: clapboarding		
28.	Plan shape: see site map 29. Changes: Addition? Altered? yes		
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
trip from	a pyramidally hi led. A side doo at entrance of do	tion of important features: Almost a foursquare, this house pped roof. Windows are 3-over-1 double-hung sash, paired or (photo, left) has a shed-roof bracketed hood, while a uble doors is located in a projecting, windowed bay. A has been attached to the front elevation next to the en-	

^{34.} History and Significance: All pre-late 1925 building permits are unavailable for this city block. Frost Mrazek, a buyer for Penny & Gentles Co., lived in this house in 1925.

trance bay.



1.	No. 037	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Ass of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis file
9.	Ownership:	8. On National Register or part of estab. district?
*************************	Private	10. Visible from public road? Yes 11. Endangered?
12.	Original name:	
13.	Present name/owner's name:	
14.	Street address: 2300 Sulphur 15. Style: Col.Revival/Craftsma	
16.	Date(s): 9/23/1927 - building permit	
17.	Architect: builder 18. Builder: H. C. Vollmar	
19.	Original Use: residence 20. Present Use: residence	
21.	No. of stories: 2 22. Basement? yes 23. Wall construction: frame	
24.	Foundation material: concrete 25. Roof type/material: mock gambre	
26.	No. Bays: Front 3 Side 2 27. Wall treatment: aluminum siding	
28.	Plan shape: see site map 29. Changes: Addition? Altered?	
30.	Exterior condition: good 31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971	
effe	cures a standard ect is one of a g	tion of important features: *Interesting roofline treatments of important features: *Interesting roofline treatments of the sample of the samp

wood brackets. A one-story, flat-roofed room, apparently original, extends to

the west; it has an upper railing and second-floor door access.

^{34.} History and Significance: The house is nearly identical to survey #36 across the street; H. C. Vollmar was almost certainly the builder for it as well as for this one. Vollmar's permit for this house showed a cost of \$3,000 in 1927. He was a prolific builder in the area and completed all the houses on the west side of City Block 4648 in 1926-27.



1.	No. 185	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No
12.	Original name:	
13.	Present name/owner's name:	
14.	Street address: 2301 Sulphur 15. Style: Shotgun	
16.	Date(s): c. 1905-10; 1951 & 1953 rear additions	
17.	Architect: unknown 18. Builder: unknown	
19.	Original Use: residence 20. Present Use: residence	
21.	No. of stories: 1 22. Basement? yes 23. Wall construction: frame	
24.	Foundation material: stuccoed 25. Roof type/material: front gable	
26.	No. Bays: Front 2 Side 9 27. Wall treatment: asbestos siding*	
28.	Plan shape: see site map 29. Changes: Addition? yes! Altered? yes	
30.	Exterior condition: fair/good 31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971	
33.	Further description of important features: *This house has four rear ad-	

ditions, one behind the other, almost the entire length of the lot. The original part is a front-gabled shotgun with a porch enclosed with multipane casement windows. A shorter frame addition behind that has the same siding. Behind that is a cinder block addition, then an enclosed frame breezeway, then what was frame garage. Side windows of the first two sections are 1-over-1 double-hung.

^{14.} History and Significance: Like many of the city blocks in Clifton Heights, his one does not have available inactive building permits (before 1926, in this ase). The garage part was built in 1951 and the concrete block addition was one in 1953 for \$3,500, both additions made by Elmer Duncan. The house is urrently for sale.



1.	No. 038	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63103
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files
9.	Ownership: Private	8. On National Register or part of estab. district? No
		10. Visible from public road? Yes 11. Endangered? No
12.	Original name:	
13.	Present name/owner's name:	
14.	Street address: 2306 Sulphur 15. Style: Bungaloid	
16.	Date(s): 9/23/1927 - building permit; 1951 garage; 1971 room addition	
17.	Architect: builder 18. Builder: Harry C. Vollmar	
19.	Original Use: residence 20. Present Use: residence	
21.	No. of stories: 1 22. Basement? yes 23. Wall construction: masonr	
24.	Foundation material: stuccoed 25. Roof type/material: front gable	
26.	No. Bays: Front 2 Side 3 27. Wall treatment: brown brick	
28.	Plan shape: see site map 29. Changes: Addition? yes Altered?	
30.	Exterior condition: good 31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971	
33.	Further descrip	tion of important features: A gabled, full-width porch

tops. A low brick sidewall encloses the porch slightly. Tripled windows in the front elevation have flat arches. Side windows are segmentally arched.

34. History and Significance: The permit for this house and its neighbor,

extends across the front of this house, its brick pillars tapering toward the

survey #39, were taken out together in 1927 by builder H. C. Vollmar. The 24 x 30' houses were to be built for \$3,000 apiece and the permit specified hot air heat. Vollmar built all the houses on the west side of this city block, usually taking out permits for multiple houses, all during 1926-27. Several members of the Vollmar family were involved in contracting in St. Louis during the 1920s and '30s: H. C. lived nearby at 6105 Simpson



1.	No. 039	3. Location of Negatives: Missouri Office of Historic	
2.	City/County: City of St. Louis, MO	Preservation, P. O. Box 176, Jefferson City, MO 6510 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes	8. On National Register or part of estab. district? No	
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:	<u> </u>	
13.	Present name/ow	ner's name:	
14.	Street address: 2308 Sulphur 15. Style: Bungaloid		
16.	Date(s): 9/23/1927 - building permit		
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry	
24.	Foundation mate	rial: stuccoed 25. Roof type/material: front gable	
26.	No. Bays: Front 2 Side 4 27. Wall treatment: brown brick		
28.	Plan shape: see site map 29. Changes: Addition? rear Altered? yes		
30.	Exterior condition: good 31: Open to public? no		
	Other Surveys in which included: Heritage/St. Louis survey, 1971		

entrance to the porch is on the south side, rather than the usual front access.

Rear frame addition.

and foundation have been covered with what appears to be permastone. The material also appears on the front elevation window and door surrounds.

Side windows are segmentally arched.

^{34.} History and Significance: This house and its neighbor, survey #38, were on a single building permit taken out by Harry C. Vollmar in 1927. The two 24 x 30' dwellings were to cost \$3,000 each and have hot air heat. Vollmar was a prolific area builder in the mid-to-late 1920s. He resided in Clifton Heights at 6105 Simpson



1.	No. 040	₹		=		Office of Historic
2.	City/County: City of St. Louis, MO	4. Prepare	ed by	: Cynthia	Hill Longw	isch, Landmarks Assn. , St. Louis, MO 6310
5.	Date: 8/15/91	1		-		uis Public Records,
7.	Building? yes					tage/St. Louis files
9.	Ownership:	8. On Nat:	ional	Register ———	or part of	estab. district? No
	Private	10. Visible	e fro	m public	road? Yes	11. Endangered? No
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address: 2314 Sulphur 15. Style: Bungaloid		Bungaloid			
16.	Date(s): 11/26/1926 - building permit					
17.	. Architect: builder 18. Buil		der: Harry	C. Vollmar		
19.	9. Original Use: residence 20. Present Use: residence		dence			
21.	. No. of stories: 1 22. Basement? yes 23. Wall construction:		construction: masonry			
24.	Foundation mate	rial: stucco	ed	25. Ro	oof type/mate	erial: front gable
26.	No. Bays: Front 2 Side 4 2		27. Wa	all treatmen	t: red textured brick	
28.	Plan shape: see site map 29. Changes: Addition? rear Altered? ?		rear Altered? ?			
30.	Exterior condit	ion: good		31: 0	Open to publ	ic? no
32.	2. Other Surveys in which included: Heritage/St.		e/St. Louis	survey, 1971		
33	Further description of important features. The front norch of this house		norch of this house			

- 33. Further description of important features: The front porch of this house extends across most of the front elevation and features a gabled roof separate from the roofline of the house. The straight pillars, low sidewalls and foundation of the porch are sheathed with what appears to be coursed limestone, an apparent alteration. Front windows are paired and have brick sills. Front door has narrow, divided sidelights. Side and basement windows (cont'd. below)
- 34. History and Significance: have double rowlock segmental arches. This house and the six houses to its south on Sulphur were listed on the same building permit, taken out in 1926 by local builder H. C. Vollmar. The original permit was in October for 7 frame houses, but changed in November to brick. The 24 x 36' houses had hot air heat and cost \$3,000 each \$1,000 each more than needed for the frame houses on the first permit. Little is known of Vollmar. He built many Clifton Heights houses and lived at 6105 Simpson



1.	No. 186	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County:		
4.	City of St.	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn.	
	Louis, MO	of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
		of St. Hours, 31, Hottate, 7th 11001, St. Hours, no out-	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
J.	Date. 0/13/31	City Hall; MO Historical Soc.; Heritage/St. Louis files	
7	D.::13:0	City hall; mo historical boc., heritage/bc. bodis liles	
7.	Building? yes	O O W I : 1 D : 1	
		8. On National Register or part of estab. district? No	
9.	Ownership:		
	Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address:	2315 Sulphur 15. Style: Queen Anne	
16.	Date(s): c. 19	00-05	
17.	Architect: unk	nown 18. Builder: unknown	
	——————————————————————————————————————		
19.	Original Use: r	esidence 20. Present Use: residence	
19.	Original Use. I	esidence zo. Hesent ose. Tesidence	
21	V	1 1/2 22 P	
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: brick/fr	
24.	Foundation mate	rial: stone 25. Roof type/material: complex	
26.	No. Bays: Fron	t 3 Side 2 27. Wall treatment: red brick & frame	
28.	Plan shape: see	site map 29. Changes: Addition? Altered?	
30.	Exterior condit	ion: good 31: Open to public? no	
			
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971	
33.	Further descrip	tion of important features: The main roof of this house,	
	-		
		pyramid, has a very large front-facing gable and hipped	
		ltilevel roofline. In the frame gable end, a tripartite	
		the upper corners. A full-width front porch is even with	
the	grade, while muc	h of the basement is exposed at the rear due to grade slope	
C			

^{34.} History and Significance: windows flank the center door. Side windows are segmentally arched with double rowlocks and stone sills. No inactive building permits are available for this city block.

(cont'd. below)

Squared wood posts support the porch roof. 1-over-1 paired



1.	No. 041		_		Office of Historic fferson City, MO 65102
2.	City/County: City of St. Louis, MO	-		-	isch, Landmarks Assn. , St. Louis, MO 63101
5.	Date: 8/15/91	f	f informati		uis Public Records, tage/St. Louis files
7.	Building? yes				estab. district? No
9.	Ownership: Private			road? Yes	
12.	Original name:				
13.	Present name/owner's name:				
14.	Street address: 2316 Sulphur 15. Style: Bungaloid		Bungaloid		
16.	Date(s): 11/26/1926 - building permit				
17.	Architect: builder 18. Builder: H. C. Vollmar				
19.	Original Use: residence 20. Present Use: residence		dence		
21.	No. of stories: 1 22. Basement? yes 23. Wall construction: masonry				
24.	Foundation material: stuccoed 25. Roof type/material: front gable		erial: front gable		
26.	No. Bays: Front 2 Side 4 27. Wall treatment: brown brick		t: brown brick		
28.	Plan shape: see site map 29. Changes: Addition? rear Altered? yes		rear Altered? yes		
30.	Exterior condition: good 31: Open to public? no		ic? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971			survey, 1971	
33.	Further description of important features: The gable end of this house				

has a segmentally arched window. Below, an almost full-width, front-gabled porch has been partially infilled with frame to provide added living space. The straight brick pillars are both still intact. The low porch sidewall has been covered with coursed limestone. The doorway, at the left, is sheltered under the small amount of porch left. Small rear frame addition may be a porch.

^{4.} History and Significance: This house, along with survey #40-46, was on a ingle 1926 building permit. Each of the seven were originally slightly diferent from one another while remaining essentially the same. See also Item 34 f survey #40.



1.	No. 042	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No	
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No	
L 2 .	Original name:		
13.	Present name/ow	Present name/owner's name:	
4.	Street address: 2320 Sulphur 15. Style: Bungaloid		
16.	Date(s): 11/26/1926 - building permit		
17.	Architect: bui	lder 18. Builder: H. C. Vollmar	
19.	Original Use:	residence 20. Present Use: residence	
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry	
24.	Foundation mate	rial: stuccoed 25. Roof type/material: front gable	
6.	No. Bays: Fron	t 2 Side 4 27. Wall treatment: red textured brick	
8.	Plan shape: see	site map 29. Changes: Addition? rear Altered?	
0.	Exterior condit	ion: good 31: Open to public? no	
2.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971	
1	Further descrip	tion of important features. The front gable of this house	

^{3.} Further description of important features: The front gable of this house is a flat-arched window. A separately gabled porch extends across most of the cont elevation, supported by straight brick pillars. Low brick porch sidewalls we inset stone caps at the top of the steps. Front windows are paired. Front or has narrow sidelights; door itself has narrow glass panels divided by ntins. Segmentally-arched side windows.

[.] History and Significance: This house is one of seven listed on a single mit taken out in 1926 by H. C. Vollmar. See Item 34 of survey #40 and #41 more information.



1.	No. 043	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No	
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address: 2322 Sulphur 15. Style: Bungaloid		
16.	Date(s): 11/26/1926 - building permit		
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry	
24.	Foundation mate	rial: stuccoed 25. Roof type/material: front gable	
26.	No. Bays: Fron	t 2 Side 4 27. Wall treatment: red brick	
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered? ?	
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		

pillars support the porch at the outside corners. The low sidewalls are covered with stone or a stonelike material, possibly a later alteration. Paired front windows have flat arches; side windows are segmentally arched. (cont'd below)

34. History and Significance: Front door has narrow, divided sidelights and

Its gable is infilled with brick-look asphalt siding. Two straight brick

has itself narrow muntin divisions. Rear frame addition or porch. House is one of seven listed on single permit in 1926 taken out by H. C. Vollmar, local builder. See Item 34, survey #40 and #41 for more information.



1.	No. 044	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes		
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address:	2324 Sulphur 15. Style: Bungaloid	
16.	Date(s): 11/26/1926 - building permit		
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use:	residence 20. Present Use: residence	
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry	
24.	Foundation material: stuccoed 25. Roof type/material: front gab		
26.	No. Bays: Front 2 Side 4 27. Wall treatment: brown brick		
28.	Plan shape: see site map 29. Changes: Addition? Altered?		
30.	Exterior condit	ion: good 31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
22			

^{33.} Further description of important features: Front gable of porch is covered with brick-look asphalt siding; side eaves have exposed rafters. Porch is supported by straight brick pillars at the outside corners; low solid brick sidewalls are topped by a header course with stone end caps at the steps. Paired front windows have flat arches. Doorway has Craftsmanlike sidelights with a replacement door. Segmentally arched side windows. Rear frame porch.

^{34.} History and Significance: House is one of seven on a single permit taken out in 1926 by H. C. Vollmar. See Item 34 of survey #40 and #41 for more information.



1.	No. 045		 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 	
2.	City/County: City of St. Louis, MO	4. Prepared by	y: Cynthia Hill Longwisch, Landmarks Assn. 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files		
7.	Building? yes			
9.	Ownership:	8. On National	l Register or part of estab. district? No	
**************************************	Private	10. Visible fro	om public road? Yes 11. Endangered? No	
12.	Original name:			
13.	Present name/owner's name:			
14.	Street address: 2326 Sulphur 15. Style: Bungaloid			
16.	Date(s): 11/26/1926			
17.	Architect: builder 18. Builder: H. C. Vollmar			
19.	Original Use: residence 20. Present Use: residence			
21.	No. of stories: 1 22. Basement? yes 23. Wall construction: masonr			
24.	Foundation material: stuccoed 25. Roof type/material: front gable		25. Roof type/material: front gable	
26.	No. Bays: Fron	t 2 Side 4	27. Wall treatment: red brick	
28.	Plan shape: see site map 29. Changes: Addition? Altered??		Changes: Addition? Altered? ?	
30.	Exterior condition: good 31: Open to public? no			
32.	Other Surveys i	n which included:	Heritage/St. Louis survey, 1971	
33.	Further descrip	tion of important	features: The porch on this house is	

front-gabled, but unlike the others built at the same time in that it does not extend across the whole width of the front elevation. 2 straight brick pillars support a gabled porch roof that essentially just covers the doorway. The low brick sidewalls do extend across the front elevation to form a patiolike, uncovered porch. There is no visible evidence that this is not (cont'd. below)

tem 34 of survey #40 and #41 for more information.

History and Significance: original. Paired front windows have soldier irches. Door features narrow, divided sidelights and narrow vertical glass anes in the door itself. Segmentally arched side windows. ouse is one of seven listed on a single 1926 permit by H. C. Vollmar.



1.	No. 046	3 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes		
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address:	treet address: 2330 Sulphur 15. Style: Bungaloid	
16.	Date(s): 11/26	/1926 - building permit; 1966 attic addition	
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry	
24.	Foundation mate	rial: stuccoed 25. Roof type/material: front gable	
26.	No. Bays: Fron	t 2 Side 4 27. Wall treatment: textured brown brk	
28.	Plan shape: see	site map 29. Changes: Addition? yes Altered? yes	
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971	
33. almo	st all the way a	tion of important features: Front-gabled porch extends cross the front elevation; it is supported by wrought-iron around porch; permastone on porch foundation and front	

window and door surrounds - not original features. Craftsman-type sidelights on front door. Large, obtrusive frame dormers on north and south elevations

were added in 1966 when the attic was made into living space.

^{34.} History and Significance: This house is one of seven listed on a single suilding permit taken out in 1926 by H. C. Vollmar. See Item 34 on survey #40 and #41 for additional information.



1.	No. 047	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,	
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No	
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/ow	ner's name:	
14.	Street address: 2332 Sulphur 15. Style: Bungaloid		
16.	Date(s): 11/4/1926 - building permit		
17.	. Architect: builder 18. Builder: Harry C. Vollmar		
19.	Original Use:	residence 20. Present Use: residence	
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry	
24.	Foundation mate	rial: stuccoed 25. Roof type/material: front gable	
26.	No. Bays: Fron	t 2 Side 4 27. Wall treatment: textured brown brk.	
28.	Plan shape: see	site map 29. Changes: Addition? Altered?	
30.	Exterior condit	ion: good 31: Open to public? no	
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971	
33. sepa	-	tion of important features: The front porch roof is gabled roofline of the house. It extends almost the width of the	

house and is supported at the outside corners by straight brick pillars. Sho solid brick side walls on the porch are laid with a header course on top. Paired front windows have flat arches. Doorway has narrow sidelights. Side

windows are segmentally arched.

^{34.} History and Significance: H. C. Vollmar took out a single building permit for this house in 1926, one of many in the area he built during 1926-27. The permit specified that the house be built for \$3,000, have hot air heat, and the size was to be 24×36 . Vollmar built all the houses on the west side of this city block. He lived nearby at 6105 Simpson.



1.	No. 048	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes		
9.	Ownership:	8. On National Register or part of estab. district? No	
	Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/owner's name:		
14.	Street address: 2334 Sulphur 15. Style: Craftsman/Bungaloid		
16.	Date(s): 9/23/1926 - building permit		
17.	Architect: builder 18. Builder: Harry C. Vollmar		
19.	Original Use:	residence 20. Present Use: residence	
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry	
24.	Foundation mate	rial: stuccoed 25. Roof type/material: front gable	
26.	No. Bays: Front 2 Side 27. Wall treatment: brown brick		
28.	Plan shape: see	site map 29. Changes: Addition? Altered?	
30.	Exterior condit	ion: good 31: Open to public? no	
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
22			

- 33. Further description of important features: The gabled right bay of this house projects, lining up with the edge of an unroofed porch. It features paired, flat-arched windows of 3-over-1 double-hung sash with brick sills. The main body of the house is also gabled, this gable echoed by the hood above the front door. The door also features sidelights and Craftsman-style paning in the door itself. A brick and concrete porch has an iron railing.
- 34. History and Significance: The building permit for this house was one of five (survey #48 52) houses listed on a single permit taken out in 1926 by local builder H. C. Vollmar. The permit allots \$3,000 per house, with hot air heat specified but no size listed. A number of the Vollmar family were builders in St. Louis during the 1920s and '30s; H. C. worked extensively in this vicinity, building all the houses on the west side of this city block, among others.



1.	No. 049	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102	
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101	
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files	
7.	Building? yes	City hall, Mo historical Soc., heritage/St. Louis lifes	
9.	Ownership:	8. On National Register or part of estab. district? No	
<i>J</i> .	Private	10. Visible from public road? Yes 11. Endangered? No	
12.	Original name:		
13.	Present name/own	ner's name:	
14.	Street address: 2338 Sulphur 15. Style: Open gable/Craftsman		
16.	Date(s): 9/23/1926 - building permit		
17.	Architect: builder 18. Builder: H. C. Vollmar		
19.	Original Use: residence 20. Present Use: residence		
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry	
24.	Foundation material: stuccoed 25. Roof type/material: front gable		
26.	No. Bays: Front 2 Side 3 27. Wall treatment: textured brick		
28.	Plan shape: see	site map 29. Changes: Addition? Altered? yes	
30.	Exterior condition: good 31: Open to public? no		
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971		
33. atio	Further description of important features: This house has had some alteron work done to the facade; it probably originally looked very much like		

(cont'd. below)

survey #55, with triple windows and a small gabled porch supported by brick pillars (now cut off and topped with stone); unroofed portion has short brick side walls and extends the width of the facade. The doorway now has a gabled

frame hood. A single window is located in the front gable.

This house was one of five on a single 1926 building permit taken out by H. C. /ollmar. See Item 34 of survey #48 for additional information.

^{34.} History and Significance: Door has 6-over-3 Craftsman-style panes. Side windows are segmentally arched.



1.	No. 187	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared	by: Cynth	ia Hill Longwisch, Landma st, 7th Floor, St. Louis,	rks Assn.	
5.	Date: 8/15/91	ł.		tion: St. Louis Public R al Soc.; Heritage/St. Lou		
7.	Building? yes		- w			
9.	Ownership: Private	8. On Nation	al Registo	er or part of estab. dist	rict? No	
		10. Visible f	rom publi	c road? Yes 11. Endan	gered? No	
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address:	2339 Sulphur		15. Style: Queen Anne		
16.	Date(s): c. 1910					
17.	Architect: unk	nown	18. Bu	ilder: unknown		
19.	Original Use: r	esidence 20	. Presen	t Use: residence		
21.	No. of stories:	2 1/2 22. Bas	ement? ye	s 23. Wall construction	: frame	
24.	Foundation mate	rial: permaston	ed 25.	Roof type/material: fron	t gable	
26.	No. Bays: Front 3 Side 2 27. Wall treatment: (aluminum?) sid					
28.	Plan shape: see	site map 29	. Change	s: Addition? side Alte	red? yes	
30.	Exterior condit	ion: good	31:	Open to public? no		
32.	Other Surveys i	n which included	: Herita	ge/St. Louis survey, 1971		
man are	l Queen Anne, tha feel, while the 1-over-1 replace	nks to moderniza new shutters giv ments. Very lar	tion. The e it a mon ge 1-stor	s: This house is sort of e bracketed door hood has re Colonial Revival air. y attached garage additio mastoned foundation. Pro	a Crafts- Windows	

^{34.} History and Significance: No pre-1926 building permits are available for this city block.

north side bay is interestingly joined at the roof.



1.	No. 050	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101 				
2.	City/County: City of St. Louis, MO					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files				
7.	Building? yes					
9.	Ownership:	8. On National Register or part of estab. district? No				
	Private	10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address: 2342 Sulphur 15. Style: Bungaloid					
16.	Date(s): 9/23/1926 - building permit					
17.	Architect: builder 18. Builder: H. C. Vollmar					
19.	Original Use:	residence 20. Present Use: residence				
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry				
24.	Foundation mate	rial: concrete 25. Roof type/material: front gable				
26.	No. Bays: Fron	t 2 Side 27. Wall treatment: textured brown brk				
28.	Plan shape: see	site map 29. Changes: Addition? Altered?				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys in which included: Heritage/St. Louis survey, 1971					
2.2						

^{33.} Further description of important features: Although the front porch, with its solid brick sidewalls, extends across most of the width of the house, only the portion in front of the door is roofed, featuring a substantial gable supported by straight brick pillars. Paired windows have flat arches and are replacements. Front door has multipaned sidelights. Side windows are segmentally arched.

^{34.} History and Significance: This house is one of five listed on a single building permit taken out in 1926 by H. C. Vollmar. See Item #34 of survey #48 for additional information.



1.	No. 051	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files				
7.	Building? yes					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address: 2344 Sulphur 15. Style: Bungaloid					
16.	Date(s): 9/23/1926 - building permit					
17.	Architect: builder 18. Builder: H. C. Vollmar					
19.	Original Use:	residence 20. Present Use: residence				
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry				
24.	Foundation mate	rial: concrete 25. Roof type/material: front gable				
26.	No. Bays: Fron	t 2 Side 4 27. Wall treatment: textured brick				
28.	Plan shape: see	site map 29. Changes: Addition? Altered?				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971				
33.		tion of important features: Gabled front porch extends front of house. It is supported by straight brick pillars				

north end of porch, presumably to block snow/rain from front door.

and has short solid brick sidewalls topped with a header course. Paired front windows are 3-over-1 double-hung sash; front door has 4-over-2 Craftsman-style sidelights. Rafter ends visible. Wood frame windows have been installed in

^{34.} History and Significance: This house is one of five listed on a single building permit taken out by H. C. Vollmar in 1926. See Item 34 of survey \$48 for further details.



1.	No. 052	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
7.					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:				
13.	Present name/owner's name:				
14.	Street address: 2348 Sulphur 15. Style: Bungaloid				
16.	Date(s): 9/23/1926 - building permit				
17.	Architect: bui	lder 18. Builder: H. C. Vollmar			
19.	Original Use:	residence 20. Present Use: residence			
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry			
24.	. Foundation material: concrete 25. Roof type/material: front				
26.	No. Bays: Fron	t 2 Side 4 27. Wall treatment: brown brick			
28.	Plan shape: see site map 29. Changes: Addition? rear Altered? yes				
30.	Exterior condit	ion: good 31: Open to public? no			
32.	Other Surveys in	n which included: Heritage/St. Louis survey, 1971			
It i	ss the front of s s supported at the	tion of important features: A gabled front porch extends this house, its roof separate from the roof of the house. The outside corners by straight brick pillars. Paired, 3-ont elevation; front door has sidelights. Segmentally			

arched side windows. Large frame dormer for conversion of attic into living

space. Rear frame addition.

^{34.} History and Significance: This house is one of five listed on a single building permit taken out in 1926 by H. C. Vollmar. See Item 34 of survey #48 for further information.



No. 188	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
Date: 8/15/91	<u>{</u>			•	
Building? yes					
Ownership: Private	10. Visible from public road? Yes 11. Endangered? No				
Original name:	Original name:				
Present name/owner's name:					
Street address:	Street address: 2351 Sulphur			15. Style: Queen Anne	
Date(s): c. 1905					**************************************
Architect: unknown 18. Builder: unknown					
Original Use: residence 20.		Present Use: residence			
No. of stories:	2 22.	Baser	ment? y	es 23. Wall construction: frame	
. Foundation material: stuccoed 25. Re			Roof type/material: gabled		
S. No. Bays: Front 3 Side 2 27. Wall treatment: asbest			Wall treatment: asbestos siding		
Plan shape: see	site map	29.	Chang	es: Addition? Altered?	
Exterior condit	ion: good		31:	Open to public? no	
Other Surveys in	n which inclu	ded:	Herita	age/St. Louis survey, 1971	
	City of St. Louis, MO Date: 8/15/91 Building? yes Ownership: Private Original name: Present name/own Street address: Date(s): c. 196 Architect: unkn Original Use: re No. of stories: Foundation mater No. Bays: Front Plan shape: see Exterior condition	City/County: City of St. Louis, MO Date: 8/15/91 Building? yes Ownership: Private Original name: Present name/owner's name: Street address: 2351 Sulphu Date(s): c. 1905 Architect: unknown Original Use: residence No. of stories: 2 Poundation material: stucco No. Bays: Front 3 Side 2 Plan shape: see site map Exterior condition: good	City/County: City of St. Louis, MO Date: 8/15/91 Building? yes Ownership: Private Original name: Present name/owner's name: Street address: 2351 Sulphur Date(s): c. 1905 Architect: unknown Original Use: residence Foundation material: stuccoed No. Bays: Front 3 Side 2 Plan shape: see site map 29.	City/County: City of St. Louis, MO Date: 8/15/91 Building? yes Cownership: Private Counces of inform City Hall; MO Histori Building? yes Cownership: Private Counces of inform City Hall; MO Histori Building? yes 8. On National Regis Original name: Present name/owner's name: Street address: 2351 Sulphur Date(s): c. 1905 Architect: unknown Counces of inform City Hall; MO Histori Regis Original Regis Original Name: Street address: 2351 Sulphur Date(s): c. 1905 Architect: unknown Counces of inform City Hall; MO Histori Regis On National Regis Original Name: Street address: 2351 Sulphur Date(s): c. 1905 Architect: unknown Counces of inform City Hall; MO Histori Regis On National Regis Original Regis Street address: 2351 Sulphur Date(s): c. 1905 Architect: unknown Counces of inform City Hall; MO Histori Regis On National Regis On Street address Street address: 2351 Sulphur Date(s): c. 1905 Architect: unknown Street address: 2351 Sulphur Date(s): c. 1905 Architect: unknown Street address: 2351 Sulphur Date(s): c. 1905 Architect: unknown Street address: 2351 Sulphur Change Street address: 2351 Sulphur Counces of inform City Hall; MO Histori Regis Regis On National Regis Street address: 2351 Sulphur Date(s): c. 1905 Architect: unknown Street address: 2351 Sulphur Counces of inform City Hall; MO Histori Regis Regis On National Regis Street address: 2351 Sulphur Date(s): c. 1905 Architect: unknown Street address: 2351 Sulphur Counces of inform City Hall; MO Histori Regis Regis On National Regis Regis Counces of inform City Hall; MO Histori Regis Regis	City/County: City of St. Louis, MO A. Prepared by: Cynthia Hill Longwisch, Landmarks Assof St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63 Date: 8/15/91 Building? yes 8. On National Register or part of estab. district? Ownership: Private 10. Visible from public road? Yes 11. Endangered? Original name: Present name/owner's name: Street address: 2351 Sulphur 15. Style: Queen Anne Date(s): c. 1905 Architect: unknown Original Use: residence 18. Builder: unknown Original Use: residence 20. Present Use: residence No. of stories: 2 22. Basement? yes 23. Wall construction: frame Foundation material: stuccoed 25. Roof type/material: gabled No. Bays: Front 3 Side 2 27. Wall treatment: asbestos siding Plan shape: see site map 29. Changes: Addition? Altered? Exterior condition: good 31: Open to public? no

basically a gabled ell with smaller projecting gables. Windows are 1-over-1 double-hung sash, none paired. The front porch has an unusually high ceiling; its gabled roof is supported by thin square posts. Projecting bays at both side elevations; the south side projection juts out in the middle of the first story; it must be at a stairwell.

^{34.} History and Significance: No pre-1926 building permits available for this city block. Heritage/St. Louis could find no permit; they report that in 1906 Merrill Eicholtz, electrician, was first listed at this address. In 1907, Edward B. Eicholtz, carpenter and contractor, was also listed as living here.



1.	No. 053	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102			
2.	City/County: City of St. Louis, MO	ity/County: 4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn			
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,			
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files			
9.	Ownership: Private	8. On National Register or part of estab.	district? No		
		10. Visible from public road? Yes 11.	Endangered? No		
12.	Original name:				
13.	Present name/owner's name:				
14.	Street address: 2354 Sulphur 15. Style: Bungaloid				
16.	Date(s): 3/1/1927 - building permit				
17.	Architect: builder 18. Builder: Harry C. Vollmar				
19.	Original Use:	residence 20. Present Use: residence			
21.	No. of stories:	1 22. Basement? yes 23. Wall construc	ction: masonry		
24.	Foundation mate	rial: concrete 25. Roof type/material:	front gable		
26.	No. Bays: Fron	t 2 Side 3 27. Wall treatment: text	ured brown brk.		
28.	Plan shape: see	site map 29. Changes: Addition?	Altered?		
30.	Exterior condit	ion: good 31: Open to public? no	31: Open to public? no		
32.	Other Surveys i	n which included: Heritage/St. Louis survey,	1971		
the	capered brick pil house. A short	tion of important features: Gabled front porclars at the corners; it extends across almost brick side wall features a row of basketweaver course. Triple front windows have flat arch	the width of patterning and		

1 double-hung sash. Unlike Vollmar's 1926 houses, doorway has no sidelights.

Segmentally arched side windows.

^{34.} History and Significance: Harry C. Vollmar, a prolific local builder who resided at nearby 6105 Simpson, took out a building permit listing four dwellings at \$3,000 per unit. The 24 x 36' houses were to have hot air heat. The four are survey \$53 - 56, 2354-64 Sulphur. The first two are very much alike; the second pair are virtual twins of a slightly different design. All are familiar area Vollmar designs; he built all the houses on the west side of this



1.	No. 054	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files					
7.	Building? yes	8. On National Register or part of estab. district?					
9.	Ownership: Private	10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 2358 Sulphur 15. Style: Bungaloid						
16.	Date(s): 3/1/1927 - building permit						
17.	Architect: bui	lder 18. Builder: H. C. Vollmar					
19.	Original Use:	residence 20. Present Use: residence					
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: concrete 25. Roof type/material: front gable					
26.	No. Bays: Front 2 Side 3 27. Wall treatment: textured red bri						
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered?					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys in	n which included: Heritage/St. Louis survey, 1971					

brick pillars. Short, solid brick side walls are topped with a header course. Triple front windows have 3-over-1 double-hung sash. Front door features vertically divided panes. Segmentally arched side windows. Rear frame porch/addition.

^{34.} History and Significance: This house is one of four listed on a single permit taken out in 1927 by H. C. Vollmar. See Item #34 of survey #53 for additional information.



1.	No. 055	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 2360 Sulphur 15. Style: Bungloid/Craftsman						
16.	Date(s): 3/1/1927 - building permit						
17.	Architect: bui	lder 18. Builder: H. C. Vollmar					
19.	Original Use: residence 20. Present Use: residence						
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: stuccoed 25. Roof type/material: front gable					
26.	No. Bays: Fron	t 2 Side 3 27. Wall treatment: red brick					
28.	Plan shape: see	site map 29. Changes: Addition? Altered?					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971					
fron	nds the full wid t of the doorway	tion of important features: The front porch of this house th of the facade; however, only the area immediately in is covered by the gabled porch roof. Straight brick pil- of. The short, solid brick walls of the rest of the porch					

serve to enclose a patiolike, uncovered area. Triple windows of 3-over-1 double hung sash are located on the front elevation. Segmentally arched side windows.

^{34.} History and Significance: This building is the third of four listed on a single 1927 building permit by H. C. Vollmar. For additional information, see Item 34 of survey #53.



1.	No. 056	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership:	8. On National Register or part of estab. district? No					
	Private	10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 2364 Sulphur 15. Style: Bungaloid/Craftsman						
16.	Date(s): 3/1/1927 - building permit						
17.	Architect: bui	lder 18. Builder: H. C. Vollmar					
19.	Original Use:	residence 20. Present Use: residence					
21.	No. of stories:	1 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: stuccoed 25. Roof type/material: front gable					
26.	No. Bays: Fron	t 2 Side 3 27. Wall treatment: textured brick					
28.	Plan shape: see	site map 29. Changes: Addition? Altered?					
30.	Exterior condit	ion: good 31: Open to public? no					
32.	Other Surveys i	which included: Heritage/St. Louis survey, 1971					
33.	Further descrip	tion of important features: This house is very similar to					

survey #55 next door. A porch with short, solid brick walls extends across the width of the house; the gabled roof, however, only covers the area immediately before the front door. It is supported by straight brick pillars. Triple windows have 3-over-1 double-hung sash echoed by a single gable window. Segment-ally arched side windows.

^{34.} History and Significance: This house is the last of four in a row listed on a single building permit taken out in 1927 by H. C. Vollmar. See Item 34 of survey #53 for additional information.



1.	No. 057	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 6510 				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 6310				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records, City Hall; MO Historical Soc.; Heritage/St. Louis files				
7.	Building? yes					
9.	Ownership:	8. On National Register or part of estab. district? No				
	Private	10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address: 2366 Sulphur 15. Style: Bungalow					
16.	Date(s): 4/16/1927 - building permit					
17.	Architect: builder 18. Builder: H. C. Vollmar					
19.	Original Use:	residence 20. Present Use: residence				
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry				
24.	Foundation mate	rial: stuccoed 25. Roof type/material: side gable				
26.	No. Bays: Fron	t 2 Side 27. Wall treatment: red brick				
28.	Plan shape: see	site map 29. Changes: Addition? Altered?				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys i	n which included: Heritage/St. Louis survey, 1971				
	overhangs; it e corted by straigh	tion of important features: The roof of this house feature xtends in the front to become the full-width porch roof, t brick pillars. A large frame, gabled dormer with triple				

3-over-1 windows is centered; the windows are repeated below in the front elevation. A row of basketweave patterning highlights the short, brick porch

walls, which is capped by a header course and stone at the steps.

History and Significance: This house and its neighbor, survey #58 (2368 Sulphur) were listed on one building permit taken out by Harry C. Vollmar, a local builder. The houses were shown to cost \$3,000 apiece and were to be 24 x 27' each. Vollmar built all the houses on this side of the block in 1926-

^{27.} He resided at 6105 Simpson in Clifton Heights.



1.	No. 058	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,				
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files				
9.	Ownership:	8. On Nat	ional	Registe	r or part of	estab. district? No
	Private	10. Visibl	10. Visible from public road? Yes 11. Endangered? No			
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address: 2368 Sulphur 15. Style: Bungalow					Bungalow
16.	Date(s): 4/16/1927 - building permit					
17.	Architect: bui	lder		18. Bui	lder: H. C.	Vollmar
19.	Original Use:	residence	20.	. Presen	t Use: resid	lence
21.	No. of stories:	1 1/2 22.	Basen	ment? yes	23. Wall o	construction: masonry
24.	Foundation mate	rial: stucco	ed	25. R	oof type/mate	erial: side gable
26.	No. Bays: Front 2 Side			27. W	all treatment	t: red brick mix
28.	Plan shape: see site map 29.			Changes	: Addition?	Altered?
30.	Exterior condit	ion: good		31:	Open to publi	ic? no
32.	Other Surveys i	n which inclu	ıded:	Heritag	e/St. Louis s	survey, 1971
33.	Further descrip	tion of impor	tant	features	: A large fi	rame dormer dominates

- 33. Further description of important features: A large frame dormer dominates the roofline; it is covered with brick-look asphalt siding and has exposed rafter ends and triple 3-over-1 double-hung sash windows. The roof of the house extends to cover the full-width porch and also has exposed rafter ends. Straight brick pillars support the porch roof at the outside corners. The porch has brick sidewalls that feature basketweave patterning. (cont'd. below)
- 34. History and Significance: Triple 3-over-1 windows in the front elevation. The building permit for this house included survey #57 next door. Local builder H. C. Vollmar filled out the permit in 1927, stating that the 24 x 27' dwellings would cost \$3,000 each. Vollmar did quite a lot of work in the vicinity of Clifton Heights during the late 1920s. He lived at 6105 Simpson.



					_			
1.	No. 059		3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepar	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91		•					
7.	Building? yes		City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership:	8. On National Register or part of est				estab. district? No		
	Private	10. Visibl	10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:							
13.	Present name/owner's name:							
14.	Street address: 2500 Sulphur 15. Style: Bungalow					Bungalow		
16.	Date(s): 11/4/	1926 - buildi	ng pe	rmit				
17.	Architect: bui	lder		18. Bui	lder: Harry	C. Vollmar		
19.	Original Use:	residence	20.	Presen	t Use: resi	dence		
21.	No. of stories:	1 1/2 22.	Basem	ent? yes	23. Wall	construction: masonry		
24.	Foundation mate	rial: stucco	ed	25. R	oof type/mat	erial: side gable		
26.	No. Bays: Front 2 Side 3 27. Wall treatment: red brick mix				t: red brick mix			
28.	Plan shape: see	site map	29.	Changes	: Addition?	Altered?		
30.	Exterior condit	ion: good		31:	Open to publ	ic? no		
32.	Other Surveys i	n which inclu	ided:	Heritag	e/St. Louis	survey, 1971		
33.	Further descrip	tion of impor		features	· The roofl	ine of this house		

- 33. Further description of important features: The roofline of this house extends to cover the porch, supported at the corners by straight brick pillars. Wide overhanging eaves. A frame dormer with triple 3-over-1 double-hung sash dominates the roof. Solid brick short porch walls are topped with a brick header course and stones inset at the opening. Triple windows on front elevation are same as those above. Segmentally arched side windows.
- 34. History and Significance: Builder Harry C. Vollmar took out a single building permit listing six houses in 1926. These were survey #59 64, 2500 2516 Sulphur. The cost was noted as \$24,000 total, or \$4,000 apiece for the 24 x 27' dwellings \$1,000 2,000 more per unit than most of the rest of his local houses. It is not known why these were more expensive; perhaps the answer lies in interior detailing. Vollmar was quite active in the immediate area in the mid-late 1920s. He lived at 6105 Simpson



1.	No. 060					s: Missouri Office of Hist Box 176, Jefferson City, M	
(City/County: City of St. Louis, MO	4. Prepare	ed by	y: Cynthi	ia I	Hill Longwisch, Landmarks 7th Floor, St. Louis, MO	Assn.
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	8. On National Register or part of estab. district? No					
	Ownership: Private					or part of estab. districtions of the condition of the co	
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 2504 Sulphur 15. Style: Bungalow						
16.	Date(s): 11/4/1926 - building permit						
17.	Architect: buil	lder		18. Bu	i ldı	ler: H. C. Vollmar	
19.	Original Use: 1	residence	20.	. Preser	nt I	Use: residence	
21.	No. of stories:	1 1/2 22.	Baser	ment? yes	5	23. Wall construction: m	asonry
24.	Foundation mater	rial: stucco	ed	25. I	Roof	of type/material: side ga	ble
26.	No. Bays: Front	t 2 Side 3		27. V	Wal:	.l treatment: red brick mi	x
28.	Plan shape: see	site map	29.	Changes	s:	Addition? Altered	?
30.	Exterior condit	ion: good		31:	Opo	pen to public? no	
32.	Other Surveys in	which include	ded:	Heritag	 ge/:	St. Louis survey, 1971	
roofl it ex	ine has 3-over- tends to form po	double-hung orch roof, su	sast pport	n windows ted by st	s. trai	Gabled frame dormer cent Roof of house has wide e light brick pillars. Porc lows in front elevation al	aves; h has

Segmentally arched side windows.

over-1.

^{34.} History and Significance: This house is the second of six listed on a single 1926 building permit taken out by H. C. Vollmar. See Item 34 of survey #59 for more details.



1.	No. 061	3. Locati		_	ves: Miss				
2.	City/County: City of St. Louis, MO	4. Prepare of St. Lou	ed by	: Cynth	ia Hill 1	Longwi	sch, L	andmarks	Assn.
5.	Date: 8/15/91	1			tion: St				-
7.	Building? yes	_	City Hall; MO Historical Soc.; Heritage/St. Louis files 8. On National Register or part of estab. district? No						
9.	Ownership: Private				c road?			Endanger	
12.	Original name:								
13.	Present name/owner's name:								
14.	Street address:	2506 Sulphu	r		15. St	yle:	Bungal	OW	
16.	Date(s): 11/4/1926 - building permit								
17.	Architect: builder 18. Builder: H. C. Vollmar								
19.	Original Use:	residence	20.	Prese	ent Use:	resid	ence		
21.	No. of stories:	1 1/2 22.	Basem	ent? ye	es 23. l	Wall c	onstru	ction: m	asonry
24.	Foundation mate	rial: stucco	ed	25.	Roof type	e/mate	rial:	side ga	ble
26.	No. Bays: From	t 3 Side		27.	Wall trea	atment	: red	brick	
28.	Plan shape: see	site map	29.	Change	s: Addi	tion?		Altered	?
30.	Exterior condit	ion: good		31:	Open to	publi	c? no	1	
32.	Other Surveys i	n which inclu	ded:	Herita	ge/St. Lo	ouis s	urvey,	1971	
	Further descriptures a hipped rockiows flank the cer	of and triple	3-ov	er-1 do	uble-hun	g sash	. Pai	red, 3-o	ver-1

is supported by tapering brick pillars. Brick short walls terminate in stone

caps. Segmentally arched side windows.

^{34.} History and Significance: This house is one of six listed on a single permit by H. C. Vollmar in 1926. See Item 34 of survey 59 for more information.



1.	No. 062	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 2512 Sulphur 15. Style: Bungalow						
16.	Date(s): 11/4/1926 - building permit						
17.	Architect: bui	lder 18. Builder: H. C. Vollmar					
19.	Original Use:	residence 20. Present Use: residence					
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: stuccoed 25. Roof type/material: side gable					
26.	No. Bays: From	t 3 Side 27. Wall treatment: red brick mix					
28.	Plan shape: see	site map 29. Changes: Addition? Altered?					
30.	Exterior condition: good 31: Open to public? no						
32.	Other Surveys is	n which included: Heritage/St. Louis survey, 1971					
line	windows are cen of this house.	tion of important features: Triple, 3-over-1 double-hung tered in the gabled frame dormer that dominates the roof- The roof, which features wide overhanging eaves, extends to supported by "stepped" brick pillars. The porch has short					

brick side walls terminating in stone caps at the openings; stone is also used to highlight the steps of the pillars. Doubled 3-over-1 (cont'd. below)

^{34.} History and Significance: windows flank the centered doorway. Segmentally arched side windows.

H. C. Vollmar took out the permit that listed this and five other houses in 1926. For more information, see Item 34 of survey #59.



1.	No. 063	3. Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102				
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101				
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,				
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files				
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No				
12.	Original name:					
13.	Present name/owner's name:					
14.	Street address: 2514 Sulphur 15. Style: Bungalow					
16.	Date(s): 11/4/	1926 - building permit				
17.	Architect: builder 18. Builder: H. C. Vollmar					
19.	Original Use:	residence 20. Present Use: residence				
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry				
24.	Foundation mate	rial: stuccoed 25. Roof type/material: side gable				
26.	No. Bays: Front 3 Side 27. Wall treatment: red brick mix					
28.	Plan shape: see	site map 29. Changes: Addition? Altered?				
30.	Exterior condit	ion: good 31: Open to public? no				
32.	Other Surveys i	which included: Heritage/St. Louis survey, 1971				
The	ripped; it has trace to the leading of the leading	tion of important features: The frame dormer of this house iple windows. Paired windows flank the centered front door. nouse extends to become the porch roof, supported by taper—Short, solid brick side walls have a header course and are				

capped with stone at the steps.

^{34.} History and Significance: This house is the fifth of six houses listed on a single 1926 building permit by H. C. Vollmar. For more details, see Item 34 of survey #59.



1.	No. 064	 Location of Negatives: Missouri Office of Historic Preservation, P. O. Box 176, Jefferson City, MO 65102 					
2.	City/County: City of St. Louis, MO	4. Prepared by: Cynthia Hill Longwisch, Landmarks Assn. of St. Louis, 917 Locust, 7th Floor, St. Louis, MO 63101					
5.	Date: 8/15/91	6. Sources of information: St. Louis Public Records,					
7.	Building? yes	City Hall; MO Historical Soc.; Heritage/St. Louis files					
9.	Ownership: Private	8. On National Register or part of estab. district? No 10. Visible from public road? Yes 11. Endangered? No					
12.	Original name:						
13.	Present name/owner's name:						
14.	Street address: 2516 Sulphur 15. Style: Bungalow						
16.	Date(s): 11/4/1926 - building permit						
17.	Architect: builder 18. Builder: H. C. Vollmar						
19.	Original Use:	residence 20. Present Use: residence					
21.	No. of stories:	1 1/2 22. Basement? yes 23. Wall construction: masonry					
24.	Foundation mate	rial: stuccoed 25. Roof type/material: side gable					
26.	No. Bays: Front 3 Side 2 27. Wall treatment: red brick mix						
28.	Plan shape: see	site map 29. Changes: Addition? rear Altered?					
30.	Exterior condit	ion: good 31: Open to public? no					
		n which included: Heritage/St. Louis survey, 1971					

- triple 3-over-1 double-hung sash; it also has a small window cut into the south side. The roofline has wide overhangs and extends to cover the front porch. It is supported by "stepped" brick pillars. The short brick walls are topped with a header course and stone at the openings. Paired, 3-over-1 windows flank the centered front door. Side openings are segmentally arched. (cont'd. below)
- 34. History and Significance: Rear frame porch/addition.
- H. C. Vollmar took out a single building permit listing this and five other houses in 1926. More information can be found in Item 34 of survey #59.

